

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

TJW 1406241816

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company: BOPCO, L.P. <i>260737</i>	Contact: Tony Savoie
Address: 522 W. Mermod, Suite 704 Carlsbad, N.M. 88220	Telephone No. 575-887-7329
Facility Name: PLU-129	Facility Type: Exploration and Production

Surface Owner: Federal	Mineral Owner: Federal	API No. 30-015-29552
------------------------	------------------------	----------------------

LOCATION OF RELEASE


Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
H	20	24S	31E	1980	North	660	East	Eddy

Latitude N 32.204440 Longitude W 103.793891

NATURE OF RELEASE

Type of Release: Crude oil and produced water	Volume of Release: 2 bbls crude oil and 38 bbls produced water. 40 bbls total fluid	Volume Recovered: 1 bbl crude oil and 29 bbls produced water. 30 bbls total fluid
Source of Release: 2 7/8" flow line	Date and Hour of Occurrence: <u>12/16/13</u> time unknown	Date and Hour of Discovery: <u>12/16/13</u> at 5:00 p.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? NMOCD emergency #104 and BLM	
By Whom? Tony Savoie	Date and Hour: 12/17/13 at 9:58 a.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse	

If a Watercourse was Impacted, Describe Fully.*

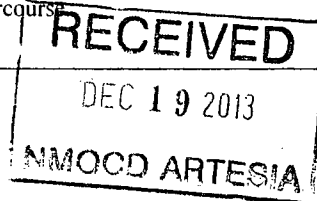

Describe Cause of Problem and Remedial Action Taken.*

The flow line developed a leak at a collar connection. The well was shut in, a vacuum truck was used to pull the fluid out of the line and pick up the free standing fluid. The section of pipe was scheduled to be replaced on 12/17/13.

Describe Area Affected and Cleanup Action Taken.*

The spill impacted approximately 1.950 square feet of pasture, a crew was dispatched to the site to gather information for one-call clearance and BLM arch. clearance. A crew started removing the heavily saturated soil at 9 a.m. 12/18/13 after receiving permission from the BLM to access the site. The spill will be cleaned up in accordance to the NMOCD and BLM guidelines for spill remediation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Tony Savoie</i>	OIL CONSERVATION DIVISION	
Printed Name: Tony Savoie	Approved by Environmental Specialist <i>Mike Brando</i>	Signed By <i>Mike Brando</i>
Title: Waste Management and Remediation Specialist	Approval Date: JAN 02 2014	Expiration Date:
E-mail Address: tasavoie@basspet.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 12/18/13 Phone: 432-556-8730	Remediation per OCD Rule & Guidelines, & like approval by BLM. SUBMIT REMEDIATION PROPOSAL NO LATER THAN:	

* Attach Additional Sheets If Necessary

Feb. 2, 2014

2RP-2128