


District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 S. First St., Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

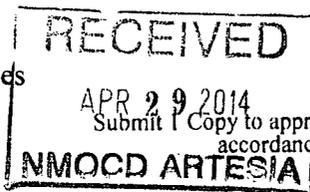

Form C-141  
Revised August 8, 2011

**Release Notification and Corrective Action**

**OPERATOR**

Initial Report  Final Report

Name of Company: Linn Operating, Inc.	Contact: Brian Wall
Address: 2130 W. Bender Hobbs, NM 88240	Telephone No. 575-738-1739
Facility Name: Skelly #33	Facility Type: Injection

Surface Owner Federal	Mineral Owner Federal	API No. 30-015-05140
-----------------------	-----------------------	----------------------

**LOCATION OF RELEASE**

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
M	14	17S	31E	660	South	660	West	Eddy

Latitude <sup>32.8291697</sup>~~32.86647~~ Longitude <sup>103.6467836</sup>~~103.6571~~

**NATURE OF RELEASE**

Type of Release: Produced Water	Volume of Release 130 bbls	Volume Recovered 10
Source of Release: Steel Pipeline	Date and Hour of Occurrence 10/04/13 8:30 A.M.	Date and Hour of Discovery 10/04/2013 8:30 A.M.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Burton BLM- Mike Bratcher NM OCD	
By Whom?	Date and Hour 01-22-13 2:20 PM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.\*  
NA

Describe Cause of Problem and Remedial Action Taken.\*  
Bad collar on 2" steel line, collar and joint replaced. A vacuum truck was utilized to capture approximately 10 bbls of fluid.

Describe Area Affected and Cleanup Action Taken.\*  
There was approximately 3500 sf. ft of impacted pad and pasture area. The spill was delineated by Diversified Field Services, Inc. Impacted soils were removed to a NMOCD approved disposal facility. Confirmation samples were then submitted to a commercial lab for analyses. Backfill of the excavation was approved by the NMOCD and the BLM. The excavation was backfilled and the site was contoured to the surrounding landscape. The area was seeded with Lesser Prairie Chicken seed mix.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	<b>OIL CONSERVATION DIVISION</b>	
	Approved by Environmental Specialist:	
Printed Name: Brian Wall	Approval Date: 5/22/14	Expiration Date: NA
Title: Construction Foreman II	Conditions of Approval: <i>Final</i>	
E-mail Address: bwall@linenergy.com	Attached <input type="checkbox"/>	
Date: 03/25/2014 Phone: 806-367-0645		

\* Attach Additional Sheets If Necessary

2RP-2045