

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company	Apache Corp.	Contact	Natalie Gladden
Address	P.O. Box 1849, Eunice, NM, 88231	Telephone No.	(575) 390-4186
Facility Name	Empire Abo Unit G312 (near Washington 33 #53)	Facility Type	Production

Surface Owner	State	Mineral Owner	State	API No.	30-015-40077
---------------	-------	---------------	-------	---------	--------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
J	33	17S	28E	2290	FSL	2175	FEL	Eddy

Latitude _____ Longitude _____

NATURE OF RELEASE

Type of Release	Oil/Water	Volume of Release	300 bbls	Volume Recovered	225 bbls
Source of Release	Flowline	Date and Hour of Occurrence	6/10/2012	Date and Hour of Discovery	6/10/2012
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	Mike Bratcher		
By Whom?	Natalie Gladden	Date and Hour	6/14/2012		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.			

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*


Fiberglass line leak. A local contractor found the leak at 10:40 pm. Fiberglass line was repaired, standing fluid was recovered and one-call was made.

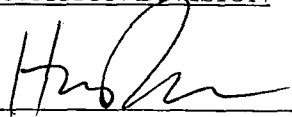
Describe Area Affected and Cleanup Action Taken.*

The leak affected a total area of 27,046 square feet including a lease road and pasture land. Samples were collected and sent to a commercial lab for chloride and TPH analyses. The leak was excavated and impacted soils were removed to a NMOCD approved disposal facility. The excavations in the pasture were backfilled with clean imported caliche to 1 ft. bgs, and the remaining 1 ft. was backfilled with clean imported topsoil. The site was contoured to the surrounding area. The excavation in the lease road was backfilled with clean imported caliche and leveled.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

OIL CONSERVATION DIVISION

Signature: 
Printed Name: Natalie Gladden
Title: EH&S Environmental Tech
E-mail Address: Natalie.gladden@apachecorp.com
Date: 11/9/12 Phone: (575) 390-4186

Approved by District Supervisor: 

Approval Date: 4/12/15

Expiration Date: N/A

Conditions of Approval:

Final

Attached ☐

* Attach Additional Sheets If Necessary

2RD-1193