Form 3160-5 (June 2015)

# UNITED STATES

FORM APPROVED OMB NO. 1004-0137

DEPARTMENT OF THE INTERIOR				Expires: January 31, 2018		
BUREAU OF LAND MANAGEMENT  SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.  SUBMIT IN TRIPLICATE - Other instructions on page 2				5. Lease Serial No. NMLC028992J		
			<u> </u>	an, Allottee or T	ribe Name	
			7. If Unit	7. If Unit or CA/Agreement, Name and/or No.		
Type of Well     ☐ Gas Well    ☐ Other				8. Well Name and No. BRIGHAM B 2		
Name of Operator Contact: KENNETH A PRESTON ROVER OPERATING LLC E-Mail: kpreston@roverpetro.com  Contact: KENNETH A PRESTON E-Mail: kpreston@roverpetro.com				9. API Well No. 30-015-04257-00-S1		
3a. Address 17304 PRESTON ROAD SCHIE SOLD A Phr. 214-234-9115 DALLAS, TX 75252			10. Field FREI	10. Field and Pool or Exploratory Area FREN		
4. Location of Well (Footage, Sec., T., R., Mil of State of Description)				11. County or Parish, State		
Sec 22 T17S R30E SWSW 330FSL 990FWL				EDDY COUNTY, NM		
Sec 22 1175 R30E SWSW 330FSL 990FWL				i COUNTY,	IAIAI	
12. CHECK THE AP	PROPRIATE BOX(ES) TO	INDICATE NATURE O	F NOTICE, REPOR	Γ, OR OTHE	ER DATA	
TYPE OF SUBMISSION		TYPE OF	ACTION	N		
Notice of Intent   ■ Notice of Intent	☐ Acidize	Deepen	☐ Production (Start/	Resume)	■ Water Shut-Off	
_	☐ Alter Casing	☐ Hydraulic Fracturing	□ Reclamation		■ Well Integrity	
☐ Subsequent Report	□ Casing Repair	■ New Construction	☐ Recomplete		☐ Other	
☐ Final Abandonment Notice	□ Change Plans	□ Plug and Abandon				
	☐ Convert to Injection	□ Plug Back	■ Water Disposal			
following completion of the involved testing has been completed. Final Ab determined that the site is ready for fi Mr. Zota Stevens, Rover Petroleum respectfully v	nandonment Notices must be filed of an inspection.	nly after all requirements, includ	ing reclamation, have bee	n completed and	the operator has	
on September 1, 2019. This w	ellbore has potential utility fo	r future waterflood operation	ons.	F	RECEIVED	
Proposed Procedure:				" <del>1</del> 71	IECEIAED	
MIRU ND WH, NU BOP			~ - \ <b>Y</b>			
POOH with rods, pump		GC 10-1 Accepted for record -	NMOCD	00	T 1 2 2018	
TOH with tubing RU WL. Set CIBP at 1875?, te	est CIBP & casing to 500#					
Cap with 25 sxs cmt	-			DISTRICT	II-ARTESIA O.C.D.	
Notify BLM official and perform	n witnessed MII					
TH HARTONED unt	-,1 /0/3//9.					
14. I hereby/certify that the foregoing is	Electronic Submission #435	365 verified by the BLM Wel ERATING LLC, sent to the C	I Information System			
Com	mitted to AFMSS for processi	ing by PRISCILLA PEREZ or	n 09/17/2018 (18PP267	9SE)		
Name (Printed/Typed) BRADY W	ILTON	Title ENGINE	ER			
Signature (Electronic S	(ubmission)	Date 09/14/20	118			
	· · · · · · · · · · · · · · · ·	FEDERAL OR STATE			<del></del>	
				<del></del>	D	
_Approved By _ZOTA STEVENS	<del>i</del>	UM ENGINEER	<del></del>	Date 10/03/2018		
Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would entitle the applicant to condu-		1				

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Office Carlsbad

## Additional data for EC transaction #435365 that would not fit on the form

32. Additional remarks, continued

Clean loc, RDMO

# ROVER PETROLEUM, LLC WELLBORE DIAGRAM - CURRENT

Lease/Well No.:

**Brigham B Federal #2** 

330' FSL & 990' FWL

UL: M, SEC 22, T17S, R30E

**EDDY County, NM** 

API No.:

Location:

30-015-04257

EIEI

FIELD: GB JACKSON; SR, Q, GB, SA


Spudded:

6/23/1962

Completed:

7/12/1962

ELEVATION, GL: 3627'

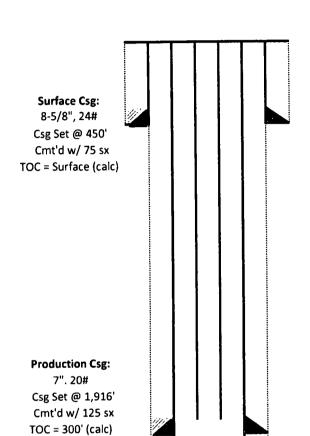

1925' PBTD 1925' TD Tubing Count 2-3/8" TBG Rod Count 5/8" RODS

Plugs N/A

### **FORMATIONS:**

<u>TOPS</u>	DEPTH, ft		
Salt (Bottom)	1,150'		
Yates	1,400'		
Seven Rivers	1,760'		

PERFORATIONS

<u>DEPTHS</u> 1916' - 1925' ZONE

SPF - # OF HOLES OPEN HOLE DATE

## **ROVER PETROLEUM, LLC** WELLBORE DIAGRAM - PROPOSED

Lease/Well No.:

**Brigham B Federal #2** 

ELEVATION, GL: 3627'

Location:

330' FSL & 990' FWL

UL: M, SEC 22, T17S, R30E

FIELD: GB JACKSON; SR, Q, GB, SA

**EDDY County, NM** 

API No.:


30-015-04257

Spudded:

6/23/1962

Completed:

7/12/1962

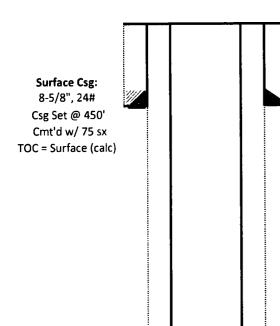

**Tubing Count** N/A

Rod Count

N/A

<u>Plugs</u> CIBP @ 1875' CAPPED W/ 25 SXS CMT

## **FORMATIONS:**

**TOPS** DEPTH, ft Salt (Bottom) 1,150' 1,400' Yates 1,760' Seven Rivers

**Production Csg:** 7". 20# Csg Set @ 1,916' Cmt'd w/ 125 sx TOC = 300' (calc)

> 1925' PBTD 1925' TD

**PERFORATIONS** 

**DEPTHS** 1916' - 1925' ZONE

SPF - # OF HOLES **OPEN HOLE** 

DATE

### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

### Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.
  - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, placed with tubing.
  - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.
  - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
  - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
  - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. Followells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use of plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- 1. Submits a subsequent Sundry Notice (Form 3180-5) requesting T/A approval with well bore diagram with all perforations and CIBP's and tops of coment on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place teach on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Well Name: Golden Spur Federal 001H Submit Subsequent Report and well bore diagram with all Perforations and CIBP with tops of cement. Well may be approved to be TA for a period of 6 months or until 08/01/2018 after successful MIT and subsequent report is submitted. This well has been shut-in since November 2016.