

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPL
(Other instructions
verse side)


Budget Bureau No. 1004-1
Expires August 31, 1985
5. LEASE DESIGNATION AND SERIAL
LC 029395 (b)

C/S

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. NAME OF OPERATOR
ARCO Oil and Gas Company
3. ADDRESS OF OPERATOR
P. O. Box 1610, Midland, Texas 79701
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface
660' FSL & 660' FWL

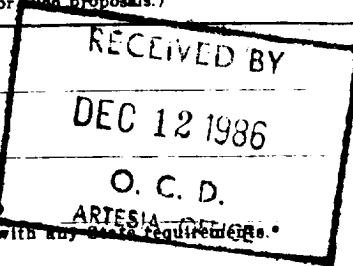

6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Turner "B"
9. WELL NO.
13
10. FIELD AND POOL OR WILDCAT
Fren Seven Rivers
11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA
20-17S-31E
12. COUNTY OR PARISH
Eddy
13. STATE
NM

14. PERMIT NO
API #30-015-05285
15. ELEVATIONS (Show whether DF, RT, GR, etc.)
3627.62 DF

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING


ABANDONMENT*

☐
☐
☒
☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

10-14-86. MIRU. Tbg stuck. Removed most of tbg leaving fish in hole. TOF @ 1958' in OH section. Spot'd 100 sx Cl "H" Neat cmt f/1958' - 1564'. WOC. RIH & tag TOC @ 1688' (OH Plug). Tstd 5-1/2" csg to 500 # ok. Perf'd 4 sqz holes in 5-1/2" csg @ 1310'. RIH w/CICR & set @ 1198'. Cmdt perfs @ 1310' w/150 sx Cl "H" Neat cmt. Dapd 62' cmt on CICR (B-Salt). Perf'd 5-1/2" csg w/4 holes @ 530'. Cmdt'd holes @ 530' w/300 sx Cl "H" Neat cmt down 5-1/2". Did not circulate. Ran TS & indicated TOC @ 326'. After numerous attempts to pump cmt thru holes @ 530' out annulus w/o success, approval given to perf 5-1/2" @ 200' by Bob Pitschke - BLM. Unable to break circ. Perf'd 5-1/2" csg w/4 holes @ 109'. Cmdt down 5-1/2" csg out BH & into cellar around 7" surf pipe w/125 sx Cl "C". Cut off WH. Weld on dry hole marker. Well P&A'd 10-20-86.

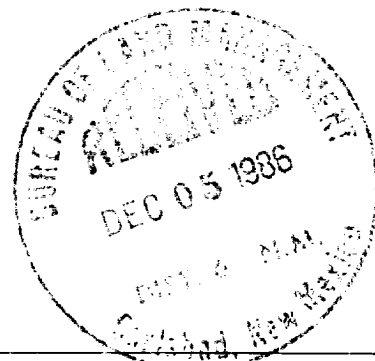

18. I hereby certify that the foregoing is true and correct

915-688-5672

SIGNED Ken W. Gosnell

TITLE Engr. Tech. Spec.

DATE 12-2-86

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE 12-9-86

Liability under land is not assumed
surface restoration is completed.

*See Instructions on Reverse Side

Post FD-2
12-19-86
P&A