District II
1000 Rto Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

# State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office.

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

Pit, Closed-Loop System, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application
Type of action:  Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method  Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method  Modification to an existing permit  Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method  Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
operator: WILLIAMS PRODUCTION COMPANY, LLC OGRID #: 120782
Address: PO Box 640 Aztec, NM 87410
Facility or well name: ROSA UNIT #044B
API Number: 3003926685 OCD Permit Number:
Section 35C Township 32N Range 06W County RIO ARRIBA
Latitude: 36.942250000000001 Longitude 107.4278099999999 NAD: 1983 Surface Owner: FEDERAL
Pit:       Subsection F or G of 19.15.17.11 NMAC         Temporary:       □ Drilling       □ Workover         □ Permanent       □ Emergency       □ Cavitation       □ P&A         □ Lined       □ Unlined Liner type: Thickness
Closed-loop System: Subsection H of 19.15.17.11 NMAC   Type of Operation: P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent)   Drying Pad Above Ground Steel Tanks Haul-off Bins Other
Liner Seams:   Welded   Factory   Other    4.
5.  Alternative Method:

Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

31	
6. \$\vec{v}\$,  Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)	
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, is the time and barbed.)	hospital,
institution or church)  Four foot height, four strands of barbed wire evenly spaced between one and four feet	
Alternate. Please specify	
7.	
Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks)	
Screen Netting Other	
Monthly inspections (If netting or screening is not physically feasible)	
8. Signs: Subsection C of 19.15.17.11 NMAC	
12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
Signed in compliance with 19.15.3.103 NMAC	
Administrative Approvals and Exceptions:	
Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.  Please check a box if one or more of the following is requested, if not leave blank:	
Administrative approval(s): Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau consideration of approval.	office for
Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	
10.	
Siting Criteria (regarding permitting): 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptance.	otable source
material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appro	priate district
office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dryi	
above-grade tanks associated with a closed-loop system.	
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank.  - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa	☐ Yes ☐ No
lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	☐ Yes ☐ No ☐ NA
(Applies to temporary, emergency, or cavitation pits and below-grade tanks)  - Visual inspection (certification) of the proposed site; Acrial photo; Satellite image	L NA
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	☐ Yes ☐ No ☐ NA
(Applies to permanent pits) - Visual inspection (certification) of the proposed site, Aerial photo; Satellite image	LI NA
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock	☐ Yes ☐ No
watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.  - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	Yes No
adopted pursuant to NMSA 1978, Section 3-27-3, as amended.  - Written confirmation or verification from the municipality; Written approval obtained from the municipality	
Within 500 feet of a wetland.  - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area.	☐ Yes ☐ No
- Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	
Within a 100-year floodplain.  - FEMA map	☐ Yes ☐ No

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC  Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design) API Number: or Permit Number:
12. Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are
attached.
☐ Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19.15.17.9 ☐ Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.10 NMAC ☐ Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC ☐ Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC
Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design)  API Number:
☐ Previously Approved Operating and Maintenance Plan API Number: (Applies only to closed-loop system that use
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
13. Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC
☐ Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC ☐ Climatological Factors Assessment
Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC
☐ Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC ☐ Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC
☐ Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC ☐ Quality Control/Quality Assurance Construction and Installation Plan
☐ Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC
Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
<ul> <li>Nuisance or Hazardous Odors, including H₂S, Prevention Plan</li> <li>Emergency Response Plan</li> </ul>
☐ Oil Field Waste Stream Characterization ☐ Monitoring and Inspection Plan
Erosion Control Plan
Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Proposed Closure: 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System
☐ Alternative Proposed Closure Method: ☑ Waste Excavation and Removal
Waste Removal (Closed-loop systems only)
☐ On-site Closure Method (Only for temporary pits and closed-loop systems) ☐ In-place Burial ☐ On-site Trench Burial
Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.
☑ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC
<ul> <li>         \infty Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC</li> <li>         \infty Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings)     </li> </ul>
<ul> <li>         Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC</li> <li>         Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15.17.13 NMAC     </li> </ul>
Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Instructions: Please indentify the facility or facilities for the disposal of liquids facilities are required.		
Disposal Facility Name:	Disposal Facility Permit Number:	
Disposal Facility Name:		
Will any of the proposed closed-loop system operations and associated activities  ☐ Yes (If yes, please provide the information below) ☐ No		
Required for impacted areas which will not be used for future service and operation Soil Backfill and Cover Design Specifications based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	te requirements of Subsection H of 19.15.17.13 NMAC n I of 19.15.17.13 NMAC	· ·
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the provided below. Requests regarding changes to certain siting criteria may requested an exception which must be submitted to the Santa Fe Environment demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC	ire administrative approval from the appropriate distr al Bureau office for consideration of approval.  Justi	rict office or may be
Ground water is less than 50 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Database search; USG	ata obtained from nearby wells	☐ Yes ⊠ No ☐ NA
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Database search;	ata obtained from nearby wells	☐ Yes ⊠ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Database search; US	ata obtained from nearby wells	☐ Yes ☐ No ☑ NA
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other s lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	ignificant watercourse or lakebed, sinkhole, or playa	☐ Yes ⊠ No
Within 300 feet from a permanent residence, school, hospital, institution, or churce-Visual inspection (certification) of the proposed site; Aerial photo; Satell	ch in existence at the time of initial application. ite image	☐ Yes ☒ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that le watering purposes, or within 1000 horizontal feet of any other fresh water well or - NM Office of the State Engineer - iWATERS database; Visual inspection	spring, in existence at the time of initial application.	☐ Yes 🏻 No
Within incorporated municipal boundaries or within a defined municipal fresh wa adopted pursuant to NMSA 1978, Section 3-27-3, as amended.  - Written confirmation or verification from the municipality; Written approximate		☐ Yes ☒ No
Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Vis	ual inspection (certification) of the proposed site	☐ Yes ☑ No
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Minimum.	ng and Mineral Division	☐ Yes 🖾 No
<ul> <li>Within an unstable area.</li> <li>Engineering measures incorporated into the design; NM Bureau of Geold Society; Topographic map</li> </ul>	gy & Mineral Resources; USGS; NM Geological	☐ Yes ⊠ No
Within a 100-year floodplain FEMA map		☐ Yes ☑ No
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of by a check mark in the box, that the documents are attached.  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements Construction/Design Plan of Burial Trench (if applicable) based upon the Construction/Design Plan of Temporary Pit (for in-place burial of a drying Protocols and Procedures - based upon the appropriate requirements of 19. Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Disposal Facility Name and Permit Number (for liquids, drilling fluids and Soil Cover Design - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsections.	equirements of 19.15.17.10 NMAC of Subsection F of 19.15.17.13 NMAC appropriate requirements of 19.15.17.11 NMAC pad) - based upon the appropriate requirements of 19.15.17.13 NMAC equirements of Subsection F of 19.15.17.13 NMAC of Subsection F of 19.15.17.13 NMAC I drill cuttings or in case on-site closure standards cannot 1 of 19.15.17.13 NMAC on I of 19.15.17.13 NMAC	15.17.11 NMAC

19.	
Operator Application Certification:  Thereby certify that the information submitted with the	is application is true, accurate and complete to the best of my knowledge and belief.
•	
Name (Print):	Title:
Signature:	Date:
e-mail address:	Telephone:
20. OCD Approval: ☐ Permit Application (including of	Losure plan) 🖂 🔏 losure P <del>lan (only)</del> 🔲 OCD Conditions (see attachment)
OCD Representative Signature:	) - Kelly Approval Date: 8/15/2011
Title: Compliance Office	OCD Permit Number:
The closure report is required to be submitted to the d section of the form until an approved closure plan ha	completion): Subsection K of 19.15.17.13 NMAC proved closure plan prior to implementing any closure activities and submitting the closure report. livision within 60 days of the completion of the closure activities. Please do not complete this is been obtained and the closure activities have been completed.  Disposal Facility name and permit #_S.J. Regional Landfill, NMED permit SWM-052426_
22.	
Closure Method:  ☐ Waste Excavation and Removal ☐ On-Site Clo ☐ If different from approved plan, please explain.	sure Method
23. Closura Papart Pagarding Wasta Pamayal Clasura	For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only:
	for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than
Disposal Facility Name:	Disposal Facility Permit Number:
	Disposal Facility Permit Number:
Disposal Facility Name:	Disposal Facility Permit Number: lactivities performed on or in areas that will not be used for future service and operations?
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated  Yes (If yes, please demonstrate compliance to the  Required for impacted areas which will not be used for	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telephone	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telephone	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telegraphy (Closure Report Attachment Checklist: Instructions mark in the box, that the documents are attached.  Proof of Closure Notice (surface owner and divi	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telegraphy (Photo Documentation)  Revegetation Application Rates and Seeding Telegraphy (Photo Documents are attached.)  Proof of Closure Notice (surface owner and diviced Proof of Deed Notice (required for on-site closure)	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding To Re-vegetation Application Rates and Seeding To Rate Report Attachment Checklist: Instructions mark in the box, that the documents are attached.  Proof of Closure Notice (surface owner and divided Proof of Deed Notice (required for on-site closured Plan (for on-site closures and temporary pit Confirmation Sampling Analytical Results (if applications)	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding To Re-vegetation Application Rates and Seeding To Results in the box, that the documents are attached.  Proof of Closure Notice (surface owner and diviced Proof of Deed Notice (required for on-site closured Plan (for on-site closures and temporary pited Confirmation Sampling Analytical Results (if applications).	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding To Re-vegetation Application Rates and Seeding To Revegetation Application Rates and Seeding To Report Attachment Checklist: Instructions mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and diviproof of Deed Notice (required for on-site closured Plot Plan (for on-site closures and temporary pit Confirmation Sampling Analytical Results (if applications of Plot Plan (Sampling Analytical Results (reductions)	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding To Re-vegetation Application Rates and Seeding To Results in the box, that the documents are attached. Proof of Closure Notice (surface owner and diviorable Proof of Deed Notice (required for on-site closur Plot Plan (for on-site closures and temporary pit Confirmation Sampling Analytical Results (if application Sampling Analytical Results (recomplication Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding To	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding To Re-vegetation Application Rates and Seeding To Results in the box, that the documents are attached.  Proof of Closure Notice (surface owner and diviorable Proof of Deed Notice (required for on-site closure)  Plot Plan (for on-site closures and temporary pit Confirmation Sampling Analytical Results (for Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding To Site Reclamation (Photo Documentation)	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telescope (Seeding Telescope)  24.  Closure Report Attachment Checklist: Instructions mark in the box, that the documents are attached.  Proof of Closure Notice (surface owner and diviting Proof of Deed Notice (required for on-site closure)  Plot Plan (for on-site closures and temporary pit Confirmation Sampling Analytical Results (if application Sampling Analytical Results (reduced Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telescope (Photo Documentation)  On-site Closure Location: Latitude	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding To Re-vegetation Application Rates and Seeding To Results in the box, that the documents are attached.  Proof of Closure Notice (surface owner and diviorable Proof of Deed Notice (required for on-site closure)  Plot Plan (for on-site closures and temporary pit Confirmation Sampling Analytical Results (for Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding To Site Reclamation (Photo Documentation)	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telegraphs (Photo Documentation)  Re-vegetation Application Rates and Seeding Telegraphs (Proof of Closure Notice (surface owner and diviewed)  Proof of Closure Notice (required for on-site closure Plot Plan (for on-site closures and temporary pith Confirmation Sampling Analytical Results (if application Sampling Analytical Results (if application Plot Plan (For On-site Closure Notice Installation Re-vegetation Application Rates and Seeding Telegraphs (Photo Documentation)  On-site Closure Location: Latitude	Disposal Facility Permit Number:
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telegraphs (Photo Documentation)  Re-vegetation Application Rates and Seeding Telegraphs (Proof of Closure Notice (surface owner and diviewed)  Proof of Closure Notice (required for on-site closure Plot Plan (for on-site closures and temporary pith Confirmation Sampling Analytical Results (if application Sampling Analytical Results (if application Plot Plan (For On-site Closure Notice Installation Re-vegetation Application Rates and Seeding Telegraphs (Photo Documentation)  On-site Closure Location: Latitude	Disposal Facility Permit Number: diactivities performed on or in areas that will not be used for future service and operations? The items below) \Boxed No  refuture service and operations  echnique  SEE ach of the following items must be attached to the closure report. Please indicate, by a check ision)  (SEE)
Disposal Facility Name:  Were the closed-loop system operations and associated Yes (If yes, please demonstrate compliance to the Required for impacted areas which will not be used for Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Telegraphs (Proof of Closure Report Attachment Checklist: Instructions mark in the box, that the documents are attached.  Proof of Closure Notice (surface owner and diviting Proof of Deed Notice (required for on-site closure Plot Plan (for on-site closures and temporary piting Confirmation Sampling Analytical Results (if application Sampling Analytical Results (results (if application Sampling Analytical Results (results (Poperator Closure Location: Latitude)  25.  Operator Closure Certification:  I hereby certify that the information and attachments subblief. I also certify that the closure complies with all substitutes in the content of the conten	Disposal Facility Permit Number: d activities performed on or in areas that will not be used for future service and operations? ne items below)  \Boxed No r future service and operations  echnique  sechnique  sechnique  sechnique  Longitude  \Boxed NAD: \Boxed 1927 \Boxed 1983  ubmitted with this closure report is true, accurate and complete to the best of my knowledge and applicable closure requirements and conditions specified in the approved closure plan.

### Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Report

Well: (Rosa Unit #044B)
API No: 30-039-26685

Location: C-S35-T32N-R06W, NMPM

In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

### **Closure Conditions and Timing:**

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure
  under these conditions will be initiated within 60 days of cessation of the BGT's
  operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

#### **General Plan Requirements:**

Prior to initiating any BGT Closure except in the case of an emergency, WPX will
review County Tax Records for the current landowner of record. The landowner of
record will be notified of the intent to closure the BGT by certified mail and a copy of
this notification will be included in the closure report. In the case of an emergency,
the landowner of record will be notified as soon as practical.

Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated 5/4/09.

- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
  - a. Operators Name (WPX)
  - b. Well Name and API Number
  - c. Location (USTR)

<u>Aztec District office was notified of Williams E&P intent to close on (06/07/2010). Email attached.</u>

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.

<u>Williams closed the BGT used by the Rosa 44B separator and piped all liquids to the Produced Water Storage Tank.</u>

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API:

30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled</u> to the Rosa <u>Unit disposal wells listed.</u>

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberglass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.

  The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

	10000 11 0100010 011101101101		
Components	Testing Methods	Closure Limits (mg/Kg)	
Benzene	EPA SW-846 Method 8021B or 8260B	0.2	ND
BTEX	EPA SW-846 Method 8021B or 8260B	50	ND
TPH	EPA SW-846 Method 418.1(1)	100	33.2
Chlorides	EPA SW-846 Method 300.1(1)	250(2)	5

<sup>(1)</sup> Method modified for solid waste.

9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

No release detected.

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pit area backfilled with clean earthen material following sample results. No contaminated soil taken off site.</u> Backfill compacted to avoid settling and pit area remains in use for production operations.

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant

 $<sup>^{(2)}</sup>$  If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13. I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.

<u>Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.</u>

**12.** For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above. See above notes.

### **Closure Report:**

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation



Exploration & Production FO Box 640 Aztec NM 81137 505/634 4219 505/634 4214 Fox

March 10, 2009

Mr Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy. Farmington, NM 87401

Sent via Certified Mail

RE: Notification of Production Pit Closure

Rule 19.15 17 13 NMAC

Production Pits associated Natural Gas Development

Operated by Williams Production Co, LLC

Pursuant to Rule 19.15.17 13 NMAC, this correspondence is to notify the Bureau of Land Management, Farmington Field Office, of Williams Production LLC's (Williams ) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County, New Mexico Closure will follow the plan included with this correspondence.

Thank you for your consideration. If there are any questions or additional information is requested, please contact me at (505) 634-4209.

Respectfully submitted.

Holly C Perkins EH&S Specialist

Encl. Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assets: Below-Grade Tank Closure Plan

cc. Environmental Fire

WELLS W/FEDERAL SURF MGT	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
COX CANYON UNIT #001	3004511397	PLANCO MV	16N	32N	1 1 W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNII #001A	3004522086	BLANCO MV	16C	3211	11W	BG1	HDPF SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #001B	3004530791	BLANCO MV	16L	3211	11W	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #001C	3004532023	BLANCO MV	16E	3211	1 1 VV	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #003	3004511495	BLANCO MV	91	32N	11VV	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #003A	3004522088	BLANCO MV	9P	32N	11W	BGI	DBL WALL STEEL
COX CANYON UNIT #003B	3004530871	BLANCO MV	9J	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #004	3004511368	BLANCO MV	21A	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #004A	3004522093	BLANCO MV	21P	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #004B	3004532186	BLANCO MV	21F	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #005	3004511326	BLANCO MV	21K	32N	1 1 VV	BGT	DBL WALL STEFI
COX CANYON UNIT #005A	3004522094	BLANCO MV	210	32N	1 1 V V	BGT	DBL WALL STEEL
COX CANYON UNIT #005B	3004532142	BASIN DK / BLANCO MV	2111	3214	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #005C	3004533493	BLANCO MV	21F	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #006	3004511463	BLANCO MV	16A	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #006A	3004522095	BLANCO MV	161	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #006B	3004532693	BLANCO MV	16B	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #006C	3004532733	BLANCO MV	160	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #007	3004511455	BLANCO MV	17G	32N	11W	FGP	DBL WALL STEEL
COX CANYON UNIT #007A	3004522091	BLANCO MV	170	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #007C	3004533018	BASIN DK	17K	32N	11VV		DBI. WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
OX CANYON UNIT #008	3004511492	BLANCO MV	81	32N	11Vv		HDPE SECONDARY LINER
COX CANYON UNIT #008A	3004522096	- BLANCO MV	17H	32N	11W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #008B	3004532080	BLANCO MV	8P	32N	11W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #008C	3004531187	BLANCO MV	17P	3211	11W	BGT	HDPE SECONDARY LINER
COX CANYON UNIT #009A   COM	3004522092	BLANCO MV	20D	32N	11W		FIBERGLASS TANK w/BANDED 20-mill HDPE SECONDARY LINER
COX CANYON UNIT #009B	3004022002	BASIN DK /	Z ()L/	0214	, , , ,	DOT	THE GEOGRAPHIC ENGER
COM	3004533926	BLANCO MV BASIN DK /	20B	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #009C	3003933851	BL ANCO MV	20F	3211	11W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
COX CANYON UNIT #013	3004521489	BLANCO PC	20A	32№	11W		HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
COX CANYON UNIT #023	The second secon						FIBERGLASS TANK w/BANDED 20-mil
COM	3004522537	BLANCO PC	17C	32N	111//	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #025	3004522572	BLANCO PC	90	32N	11W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #200	3004527878	BASINFIC	91.	3214	11W	BGT	HDPE SECONDARY LINER
COX CANYON UNIT #200A	3004532126	BASINFTC	9O	3214	11W	BGT	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil 1
COX CANYON UNIT #203	3004527872	BASINFIC	17A	3214	11W	BGT	HDPE SECONDARY LINER
MADDOX #001	3004511487	BLANCO MV	10N	32N	11W	BG1	DBL WALL STEEL
MADDOX #001A	3004523539	BLANCO MV	10P	32N	11W	BGI	DBL WALL STEEL
NM 32-11 #001	3004511309	BLANCO MV BASIN DK /	200	32N	11W	BGT	DBL WALL STEEL
NM 32-11 #001B COM	3004532024	BLANCO MV BASIN DK /	20J	32N	11W	BG1	DBL WALL STEEL
NM 32 11 #001C COM	3004532804	BLANCO MV	20L	32N	11W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
NM 32-11 #002 COM	3004511380	BLANCO MV	19A	32N	1 I W	BGT	HDPE SECONDARY LINER
NM 32 11 #002A COM	3004529017	BLANCO MV	190	3211	11W	BGT	DBL WALL STEEL
NM 32-11 #002B COM	3004532670	BLANCO MV	191	32N	11W	BG1	DBI WALL STEFT
NM 32-11 #002C COM	3004533077	BLANCO MV	19G	32N	11VV	BG1	DBL WALL STEEL
ROSA UNIT #001 SWD	3003927055	SWD BASIN DK /	231	31N	06W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #001E	3003925411	BLANCO MV BLANCO MV /	11F	3111	06W		HDPE SECONDARY LINER
ROSA UNIT #005A	3003925407	ROSA PC BASIN DK /	26P	31N	0674	BGT	DBI WALL STEEL
ROSA UNIT #005B	3003926927	BLANCO MV	26B	3114	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #005Y	3003926078	BLANCO MV BLANCO MV /	26H	31N	06/0	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #008	3003907944	ROSA PC BLANCO MV /	26M	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #006	3003907944	ROSA PC BLANCO MV /	26M	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #006A	3003925430	ROSA PC	26D	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #008C	3003926944	BLANCO MV	26N	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
₹OSA UNIT #009	3003907975	BLANCO MV	11K	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #009A	3003925584	BASIN DK / BLANCO MV	11C	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #009B	3003927042	BLANCO MV	11E	3111	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
:OSA UNIT #010B	3003926556	BLANCO MV	13N	31N	06W	BG1	HDPE SECONDARY LINER
OSA UNIT #010C	3003926918	BLANCO MV	13N	31N	()6W	BGT	DBL WALL STEEL
OSA UNIT #0101	3003926556	BLANCO MV	13N	31N	06W	BG1	DBL WALL STEEL

VVELLS W/FEDERAL	4						
SURF MG1	API	FM1	SEC	TWN	RNG	PIT TYPI	CONSTRUCTION MATERIAL
ROSA UNIT #012A	3003925900	BLANCO MV / ROSA PC BASIN DK /	15J	31N	oevv	5G1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #012B	3003926555	BLANCO MV	15P	3110	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #012C	3003929486	BLANCO MV	15A	31N	06W	SGT	SINGLE WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #013	3003907936	BLANCO MV	31G	31N	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #013A	3003926298	BLANCO MV BASIN DK /	31F	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	()5Vv	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #014	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #014A	3003926280	BLANCO MV BASIN DK /	23P	31N	0677	BG1	HDPE SECONDARY LINER
ROSA UNIT #014C	3003930132	BLANCO MV	23H	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #015	3003907946	BI ANCO MV	2911	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #016	3003907963	BLANCO MV	14N	3111	06W	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #016A	3003925496	BLANCO MV	14C	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #016B	3003926218	BLANCO MV	14M	31N	W80	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #017A	3003926272	BLANCO MV BASIN DK /	200	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #017B	3003926971	BLANCO MV BLANCO MV /	20.1	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #018	3003907960	ROSA PC BLANCO MV /	22H	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #018A	3003925436	ROSA PC	22P	31N	06W	SGI	DBL WALL STEEL
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #019	3003907955	BLANCO MV	24K	31N	06W	BGT	HOPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #019B	3003926560	BLANCO MV	241	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #020	3003907969	BL ANCO MV	14G	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mill
ROSA UNIT #020A	3003925495	BLANCO MV	140	31N	06W	BGT	HDPE SECONDARY LINER
ROSĂ UNIT #020B	3003926220	BLANCO MV	14A	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 2(I-mill
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #021A	3003926121	BLANCO MV	23C	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #021B	3003926554	BLANCO MV	23K	3111	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #022	3003907971	BLANCO MV	18A	31N	05W	BG1	HDPE SECONDARY LINER

'WELLS W/FEDERAL							
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #022A 30	03926390	BLANCO MV	18C	3114	0674	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #023 30	03907942	BLANCO MV	29M	31N	05Vv	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #023B 30	03926553	BLANCO MV	29E	31N	05W	BGT	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #023C 30	03927609	BLANCO MV	291	31N	05W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #024 30	03907933	BLANCO MV	32M	31N	05W	BGT	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #024A 30	03925568	BLANCO MV	32E	31N	05W	SGT	DBL WALL STEEL
500		BASIN DK /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #024B 309	03926630	BLANCO MV	32N	31N	05W	BG1	HDPE SECONDARY LINER
DOOL 1911 - 6615		BASIN DK /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #024C 30	03926968	BLANCO MV	32C	31N	05W	BG1	HDPE SECONDARY LINER
DOGA LINET WOODA		BASIN DK /					
ROSA UNIT #026A 300	03925580	BI ANCO MV	32O	31N	05W	SGI	DBL WALL STEEL
DOSA LIBER MODES		0.40.44.444					and the same
ROSA UNIT #026B 306	03926788	BASIN DK	32G	31N	05W	SG1	DBI WALI STEEL
DOY A LIMIT 4000		#D 4 1 1 4 2 4 1 1 4 1 1 1					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #029 300	04511136	BLANCO MV	32H	32N	06VV	BGT	HDPE SECONDARY LINER
FIGS C CHAIR ADDIST		BASIN DK /					FIBERGLASS TANK w/BANDED 20-mil
FOSA UNIT #029B 300	04530709	BLANCO MV	32B	32N	061/4	BGT	HDPE SECONDARY LINER
ROSA UNIT #029M 300	. 47 00.50.4	BASIN DK /	001			6.03	ENERGY AND A CONTENT
TKOSA UNIT #028KI 300	14529584	BLANCO MV	321	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #030 COM 300	VAVA E E 74	BASIN DK /	400			5.03	FIBERGLASS TANK w/BANDED 20 mil
ROSA ONE #030 COM 300	13925570	BLANCO MV	120	31N	06VV	BGT	HDPE SECONDARY LINER
ROSA UNIT #030A 300	100.000.00	DI MICCIAN	4.014.4	0.441		D () 7	FIBERGLASS TANK w/BANDFD 20-mil
1000 ONIT 4030N 300	3926068	BLANCO MV	12M	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #030B 300	19696761	ELL ARICO RAV	4081	2441	OCHAI	DOT.	FIBERGLASS TANK W/BANDED 20-mil
300	3926601	BLANCO MV	12N	3111	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #030C 300	3929842	BLANCO MV	12P	31N	06W	BGT	DBL WALL STEEL
	70020012	Et / MOO MIT	, 2 (	0111	(,,,,,		FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #031 300	3926279	BLANCO MV	17C	31N	05VV		HDPE SECONDARY LINER
	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	CALLY III COCO III II	110	,,,,,	0011		FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #031A 300	3926346	BLANCO MV	171.	31N	05W		HDPE SECONDARY LINER
		BASIN DK /			(())	1.5 ( ) .	FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #031B 300	13926579	BLANCO MV	17[)	31N	05W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #031C 300	3926578	BLANCO MV	17N	3111	05W	BGT	HDPE SECONDARY LINER
		BLANCO MV /					
ROSA UNIT #032 300	3925389	ROSA PC	2111	31N	0674	BGT	DBL WALL STEEL
		BLANCO MV /					
ROSA UNIT #032A 300	3925417	ROSA PC	21F	31N	06W	BGI	DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #032B 300	13926771	BLANCO MV	21G	31N	06W	BGT	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #032C 300	3927240	BLANCO MV	21F	31N	06W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #034 300	3907984	BLANCO MV	36B	3211	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #034A 300	3926119	BI ANCO MV	361	32N	06W	BGI	DBL WALL STEEL
ROSA UNIT #034A 300	3926119	BLANCO MV	361	32N	06W	SG1	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #034E 300	3926629	BLANCO MV	36J	32N	06W	BG1	HDPE SECONDARY LINER

A .

WELLS W/FEDERAL		,					
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
							FIBERGLASS TANK W/BANDED 20-nul
ROSA UNIT #034C	3003926969	BLANCO MV	36H	3214	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #035X	3004510996	BLANCO MV	5K	3111	06Vv	BG1	DBL WALL STEEL
				*****			FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #036	3003907977	<b>PLANCO MV</b>	1111	31N	06VV	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #036C	3003930182	BLANCO MV	11G	3111	06W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #041	3003907981	BLANCO MV	5K	31N	05W	BGT	HDPE SECONDARY LINER
5.504   1111   1544		BASIN DK /					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #041B	3003927014	BLANCO MV	6P	3110	05Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #044	3003925873	BI ANCO MV	35K	32N	06W	BG1	DBL WALL STEEL
1007	3000323073	DI ARCO MV	Octiv	3214	OOVV	100	DDI WALL STEET
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	ogw	SGI	SINGLE WALL STEEL
							-
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	06VV	SGI	DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #044B	_3003926685	BLANCO MV	35C	32N	. 06W	BGT	HDPF SECONDARY LINER
DOCA LIBERT FOAT	000000000000	EL MICOLD	Z.3. A	0.11			FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #045	3003923013	BLANCO MV BASIN DK /	Me	3111	()5W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #046A	3003926986	BLANCO MV	8O	31N	05W	BG1	HDPE SECONDARY LINER
	Socializ Gado	BLANCO MV	0()	0114	UNIV	DG1	THE SECRETARY ENGLY
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	06W	BG1	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #053	3003920293	BASIN DK	8B	31N	05W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #055	3003920923	BASIN DK	341	31N	()5W	BGT	HDPE SECONDARY LINER
DOGA HALL WILED DA	0000022020	ELA CHAL EUZ	01.61	5441	7.101 A.	0.07	COLUMN CIETI
ROSA UNIT #059 DK	3003923270	BASIN DK	25N	3110	06W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mile
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06W	BG1	HDPE SECONDARY LINER
	0003020210	ONDEO OF	2 (7) 4	O 111	OOVV		FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #060	3004529798	BLANCO MV	41	31N	06VV		HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05VV	BGT	DBL WALL STEEL
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05W	SGI	DBI WALL STEEL
ROSA UNIT #064M	3003925563	BASIN DK / BLANCO MV	29F	31N	05W	BGT	DBL WALL STEEL
WOOM SHIP MONT	3003023003	DE ANOS III	2 (1)	300	ayvv		FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #065	3003921702	BASIN DK	17A	31N	05W		HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #066	3003921758	BASIN DK	13L	31N	06W	BG1	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #066M	3003925747	BLANCO MV	13F	31N	06W		HDPE SECONDARY LINER
DOCA HARIT HOTO	0000005500	D1 441/20 441/	<b>4</b> 11	0.444			FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #072	3003925509	BLANCO MV	61	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #072A	3003925795	BLANCO MV	6K	31N	05W		FIBERGLASS TANK w/BANDED 2()-mil HDPE SECONDARY LINER
reading the manual and	3003323133	DE / HOO MY	(//\	2114	UUVV		FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #075	3004529895	BLANCO MV	10l	31N	06W		HDPE SECONDARY LINER
	_						FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #075A	3004529854	BLANCO MV	40	31N	06VV	BGT	HDPE SECONDARY LINER
	\	DK/UNDES					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #077	3003922538	GL/BLANCO	33L	31N	05W	BG1	HDPE SECONDARY LINER

WELLS W/FEDERAL. , SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #079	3003922539	BASIN DK / BLANCO MV BASIN DK /	22K	3111	06W	BGT	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV BLANCO MV /	22K	3114	06W	SG1	DBL WALL STEEL
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	22E	3114	06W	BG1	DBI WALL STEEL
ROSA UNIT #079B	3003926920	BLANCO MV	22C	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #079C	3003929902	BLANCO MV BASIN DK /	31P	3111	05W	BG I	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-
ROSA UNIT #080	3003922537	BLANCO MV	вĸ	31N	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-
ROSA UNIT #080A	3003926413	BLANCO MV	8F	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	0517	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-
ROSA UNIT #085A	3003926314	BLANCO MV	20C	3111	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #085B	3003930130	BLANCO MV	20D	3111	05W	BG1	DBI WALL STEEL
ROSA UNIT #086	3003922766	UNDES GI	12W	31N	04W	SG1	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	BLANCO MV / ROSA PC	8F	31N	W80	BGT	DBL WALL STEEL
ROSA UNIT #089	3003922782	BLANCO MV	34A	3210	06VV	BGT	FIBERGLASS TANK WBANDED 20 I HDPE SECONDARY LINER
ROSA UNIT #089A	3003925512	BLANCO MV	340	32N	06W	BG1	FIBERGLASS TANK WBANDED 20 HDPE SECONDARY LINER
ROSA UNIT #089B	3003926851	BLANCO MV	341	32N	06W	BGT	DBI WALL STEEL
ROSA UNIT #089C	3003926674	BLANCO MV	34G	3214	0674	SG1	SINGLE WALL STEEL
ROSA UNIT #090 COM	3004525370	BLANCO MV	33G	32N	06VV	BGT	FIBERGLASS TANK WBANDED 20-1 HDPE SECONDARY LINER
ROSA UNIT #090A COM	3004529259	BLANCO MV	33G	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #091	3003922780	BLANCO MV	35H	32N	06W	BG1	FIBERGLASS TANK WBANDED 20-1 HDPE SECONDARY LINER
COSA UNIT #091A	3003925790	BLANCO MV -	35O	32N	06W	SG1	DBI WALI STEEL
ROSA UNIT #091B	3003926684	BLANCO MV	35P	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #091C	3003926991	BI ANCO MV	35G	3211	06W	BGT	FIBERGLASS TANK WBANDED 20-1 HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
ROSA UNIT #098	3003923265	BASIN DK / GL	23L	31N	06W	BG1	FIBERGLASS TANK WBANDED 20-1 HDPF SECONDARY LINER
ROSA UNIT #100B	3003929547	BASIN DK / BLANCO MV	210	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #100C	3003929851	BLANCO MV	21K	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #100E	3003925135	BLANCO MV / ROSA PC	211	31N	0644	SG1	SINGLE WALL STEEL
OSA UNIT #10114	3003925577	BLANCO MV	24F	31N	06W	BG1	DBL WALL STEEL
OSA UNIT #108	3003923506	BASIN DK / GL	7G	31N	05VV	BG1	FIBERGLASS TANK W/BANDED 20 I HDPE SECONDARY LINER

.

WELLS W/FEDERAL SURF MGT	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #119	3003925143	BASIN DK	18N	31N	0517	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-m
ROSA UNIT #125	3003925144	BLANCO MV	13B	3111	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #125C	3003929843	BLANCO MV BASIN DK /	13G	31N	06W	BG1	DRI WALL STEEL FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #125E	3003925526	BLANCO MV	13.1	31N	06W	HG1	HDPE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	34E	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #129A	3003926297	BLANCO MV	34K	3211	06W	BGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-n
ROSA UNIT #137	3003925410	BLANCO MV BLANCO MV /	31K	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	ROSA PC	311	31N	05W		DBL WALL STEEL
ROSA UNIT #137B	3003927002	BLANCO MV	31P	31N	05W	BG1	FIBERGLASS TANK WBANDED 20-n HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #138	3004529147	BLANCO MV / ROSA PC BLANCO MV /	171	31N	W80		HDPE SECONDARY LINER
ROSA UNIT #138A	3004529134	ROSA PC	17H	3114	06W	BGT	DBI WALL STEEL
ROSA UNIT #138B	3004532168	BLANCO MV	17H	31N	06W	BG1	DBI WALL STEFI
ROSA UNIT #139A	3004529600	BLANCO MV	17M	31N	06W	BG1	DPL WALL STEEL
ROSA UNIT #140	3003925435	ROSA PC	22K	31N	0674	BG1	DBL WALL STEEL
ROSA UNIT #144	3003925421	ROSA FC	26A	3114	06₩	BG1	DBI WALL STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	16F	31N	06W		DBI WALL STEEL FIBERGLASS TANK w/BANDED 20-n
ROSA UNIT #146A	3003925513	BLANCO MV	28N	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #146C	3003930187	BLANCO MV	28B	31N	(15W	BGT	DBI WALL STEEL
ROSA UNIT #148	3003925493	BASIN DK	20	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #148A	3003925776	BLANCO MV	21/	31N	06W	-	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 n
ROSA UNIT #148B	3003926985	BLANCO MV	2P	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV BASIN DK /	12F	31N	06W		DBI, WALL STEEL FIBERGLASS TANK w/BANDED 20-n
ROSA UNIT #149B	3003926599	BLANCO MV	12E	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #150	3004529229	BLANCO MV	32F	32N	06W		FIBERGLASS TANK W/BANDED 20-n HDPE SECONDARY LINER
ROSA UNIT #150A	3004529592	BLANCO MV	32M	32N	06W	BG1	DBI WALI STEEL
ROSA UNIT #15(IB	3004530874	BASIN DK / BLANCO MV	32D	32N	06W	BG1	DBI WALI STEEL
ROSA UNIT #150C	3004532157	BLANCO MV	32K	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #15:	3004529267	BLANCO MV	33C	32N	06VV	BG1	DBL WALL STEEL

·WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	33L	32N	06Vv	BGI	DBL WALL STEEL
ROSA UNIT #151C	3004532196	BLANCO MV.	3314	32N	06\\	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #152	3003925494	BLANCO MV	36E	32N	06\7	BGT	HDPE SECONDARY LINER
ROSA UNIT #152A	3003925695	BLANCO MV	36N	3214	06W	BG1	DBL WALL STEEL
ROSA UNIT #152B	3003926631	BI ANCO MV	36C	32N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-1
ROSA UNIT #152C	3003927635	BLANCO MV	361	32N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
ROSA UNIT #153	3003925524	BLANCO MV	170	31N	05VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
ROSA UNIT #153A	3003926329	BLANCO MV	17/	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
ROSA UNIT #153B	3003927603	BASIN DK / BLANCO MV	171	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	7N	31N	05Vv	BGT	DBL WALL STEEL
ROSA UNIT #154A	3003926274	BLANCO MV	7P	3114	0577	BGT	FIBERGLASS TANK WBANDED 20-1 HDPE SECONDARY LINER
ROSA UNIT #156	3004529661	BLANCO MV	9A	3114	06W	BG1	FIBERGLASS TANK WBANDED 20-1 HDPE SECONDARY LINER
ROSA UNIT #156A	3004529640	BLANCO MV	91	31N	0677	BG1	FIBERGLASS TANK WBANDED 20-r HDPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BASIN DK / BLANCO MV	190	31N	05W		DBI WALL STEEL FIBERGLASS TANK W/BANDED 20 n
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3111	05W	BGI	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #15C	3003930111		29G	31N	05W		HOPE SECONDARY LINER
ROSA UNIT #160	3003925890	BLANCO MV / ROSA PC	250	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV	25N	31N	06W		DBL WALL STEEL
ROSA UNIT #160B	3003926962	BASIN DK / BLANCO MV	251	31N	06W		FIBERGLASS TANK w/BANDED 20-n HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	06W	_	DBI. WALL STEEL
ROSA UNIT #162	3003926069	BLANCO MV	30K	31N	05W		FIBERGLASS TANK W/BANDED 20-6 HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BLANCO MV	30P	31N	05W		DBL WALL STEEL
ROSA UNIT #163	3003926345	BLANCO MV	24G	31N	06W	BG1	FIBERGLASS TANK W/BANDED 20-11 HDPE SECONDARY LINER
ROSA UNIT #163A	3003926336	BLANCO MV	240	31N	06W		FIBERGLASS TANK W/BANDED 20-n HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BLANCO MV	24B	31N	06W	SGI	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV	24J	31N	06W		SINGLE WALL STEEL
ROSA UNIT #164	3003926151	BASIN DK / BLANCO MV	1.J	31N	06W	BG1	FIBERGLASS TANK WBANDED 20-n HDPE SECONDARY LINER
ROSA UNIT #164A	3003926080	BI ANCO MV	1.)	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20-n HDPE SECONDARY LINER
ROSA UNIT #164E	3003927242	BASIN DK / BLANCO MV	1 J	3111	06W		FIBERGLASS TANK W/BANDED 20-n HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MGT	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #165	3003926070	BLANCO MV / ROSA PC	25F	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #166A	3003926150	BLANCO MV BASIN DK /	25B	31N	06VV	BG1	HDPE SECONDARY LINER
ROSA UNIT #165B	3003926557	BLANCO MV BASIN DK /	25E	31N	06VV	BGT	DBI WALL STEEL
ROSA UNIT #165C	3003926961	BI ANCO MV	25G	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-n
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #166A	3003926282	BLANCO MV	301-	31N	05W	BG1	HDFE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #167A	3004529886	BLANCO MV	A8	31N	06W	BG1	HDPF SECONDARY LINER
ROSA UNIT #169	3003926130	BLANCO MV	3J	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #169A	3003926149	BLANCO MV	3.1	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-n
ROSA UNIT #169C	3003927717	BLANCO MV	2M	3111	06Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #170	3003925851	BLANCO MV	21N	31N	06 <b>V</b> V	BGT	DBI WALL STEEL
ROSA UNIT #171	3003926286	BLANCO MV	/G	3111	05W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #171A	3003926389	BLANCO MV	7G	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WIBANDED 20-m
ROSA UNIT #171B	3003927013	BLANCO MV	6P	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #180	3004529898	BLANCO MV	9N	31N	W80	BGT	HDPE SECONDARY LINER
ROSA UNIT #180B	3004533134	BLANCO MV	91	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #180C	3004533191	BLANCO MV	9E	31N	OGVV	BGT	DBL WALL STEEL
ROSA UNIT #181	3003926463	BLANCO MV	11K	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #181A ROSA UNIT #181C (shared	3003926312	BLANCO MV	15A	31N	06W	BGT	HDPL SECONDARY LINER FIBERGLASS TANK W/BANDED 20 m
w/169C)	3003927714	BLANCO MV	214	3114	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #182	3003926283	BLANCO MV	18N	31N	05W		HDPF SECONDARY LINER
ROSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05W	<b>6</b> 61	DBL WALL STEEL
ROSA UNIT #182C	3003930180	BLANCO MV	18P	31N	05W		SINGLE WALL STEEL FIBERGLASS TANK WBANDED 20-m
ROSA UNIT #183	3003926387	BLANCO MV	19G	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-ni
ROSA UNIT #183A	3003926386	BLANCO MV	19F	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #183B	3003930087	BLANCO MV BASIN DK /	19B	31N	05W	BG7	DBI WALL STEEL
ROSA UNIT #185B	3004532734	BLANCO MV	16F	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #185C	3004534484	BLANCO MV	16F	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #18¢	3003930186	BLANCO MV	21G	31N	05VV	BG1	DBL WALL STEEL

WELLS W/FEDERAL SURF MG1	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #231	3003924441	BASINFTC	31N	3111	05Vv	SGT	SINGLE WALL STEEL
ROSA UNIT #335A	3003930222	BASINFIC	05J	31N	05VV	SG1	SINGLE WALL STEEL

.

### Meador, Tasha

From: Meador, Tasha

Sent: Monday, June 07, 2010 7:29 AM

To: Meador, Tasha; 'Jones, Brad A., EMNRD'

Cc: Basye, Matt; Lane, Myke; 'Powell, Brandon, EMNRD'

Subject: Review for Pit Closure- Rosa 080A, Rosa 044B, and Rosa 091

#### Brad:

We need to take the following below grade tanks out of service, and we would like to close these existing BGTs. We request your review and approval to allow closure.

_	WELLSITE	API	<u>FM</u> T	SEC	TW
	Rosa Unit #080A	3003926413	BLANCO MV	8F	051
	Rosa Unit #044B	3003926685	BLANCO MV	35C	061
	Rosa Unit #091	3003922780	BLANCO MV	35H	061

Please contact me or Myke Lane if there are any problems or you request additional information. Thanks for your consideration

### Tasha Meador

EH&S Coordinator Williams Exploration & Production 721 S Main Aztec, NM

Office: 505-634-4200 Direct:505-634-4241 Fax: 505-634-4205

tasha.meador@williams.com

District I
1625 N. French Dr. Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

### State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form


Form C-141


Revised October 10, 2003


### **Release Notification and Corrective Action**

						OPERATOR Initial Report						Final Report	
Name of Co	mpany	WILLIAMS	PRODUC	CTION, LLC		Contact	Vanessa Fields						
Address				EC, NM 87410	7	Telephone N	No. (505) 634-	4209					
Facility Nan	ne	Rosa Unit#					e Well Site	*, *,		, ,		**	
						, , , , , , , , , , , , , , , , , , ,							
Surface Own	ner: Fede	eral		Mineral O	wner:	er: Lease No.							
				1004	TION	ON OF PELEVOR							
						OF REI	<del> </del>						
Unit Letter	Section	Township	Range	Feet from the	North/S	South Line	Feet from the	East/V	Vest Line	County			
С	25	2221	0011										
	35	32N	06W						!				
		L	atitude	36.9422501	}	Longitude	-107.427809	9					
						_							
				NAT	URE ·	OF RELI	EASE						
Type of Relea	ise No Rel	lease Occurred				Volume of			Volume R	ccovered			
Source of Rel							lour of Occurrenc	e	Date and	Hour of Disc	overy	/	
Was Immedia	ite Notice			_		If YES, To	Whom?						
			Yes _	] No 🛛 Not Re	quired								
By Whom?						Date and F	lour						
Was a Watero	ourse Rea	iched?				If YES, Vo	olume Impacting t	he Wate	ercourse.				
			Yes 🛚	] No									
If a Watercourse was Impacted, Describe Fully.* N/A													
n a watercou	rse was m	npacted, Descr	ibe runy.	· IN/A									
Describe Cau	se of Prob	lem and Reme	dial Action	n Taken *									
No action req		iciii ana iteme	diai riciio	ir rukeii.									
Tro delion req	unca												
Describe Area	a Affected	and Cleanup A	Action Tak	cen.*									
N/A													
11. 1 4	C. d d					- 1 C	1		- d dl - d	NINAC	OCD.		
				is true and completed is true and completed in the contract of									
				ce of a C-141 repo									
				investigate and re									
				otance of a C-141 i									
					opon ac	oes not renet	o the operator of t	Съроно		ompilaree w			
<u>,                                    </u>			)				OIL CONS	SFRV	ATION	DIVISIO	N		
OIL CONSERVATION DIVISION													
Signature	Cu		lesson	6D/									
Approved by District Supervisor:													
Printed Name: Vanessa Fields													
									<del></del>				
Title: EH&S	Coordinat	tor				Approval Dat	te:		Expiration l	Date:			
		~ ~				~							
E-mail Addre	ss: Vanes	ssa.ficlds@will	iams.com		(	Conditions of	Approval.			Attached	П	!	
<b>D</b>	10		51	(505) (24 422)								;	
Date: 10-14	-10		Phon	e: (505) 634-4209	,								

<sup>\*</sup> Attach Additional Sheets If Necessary

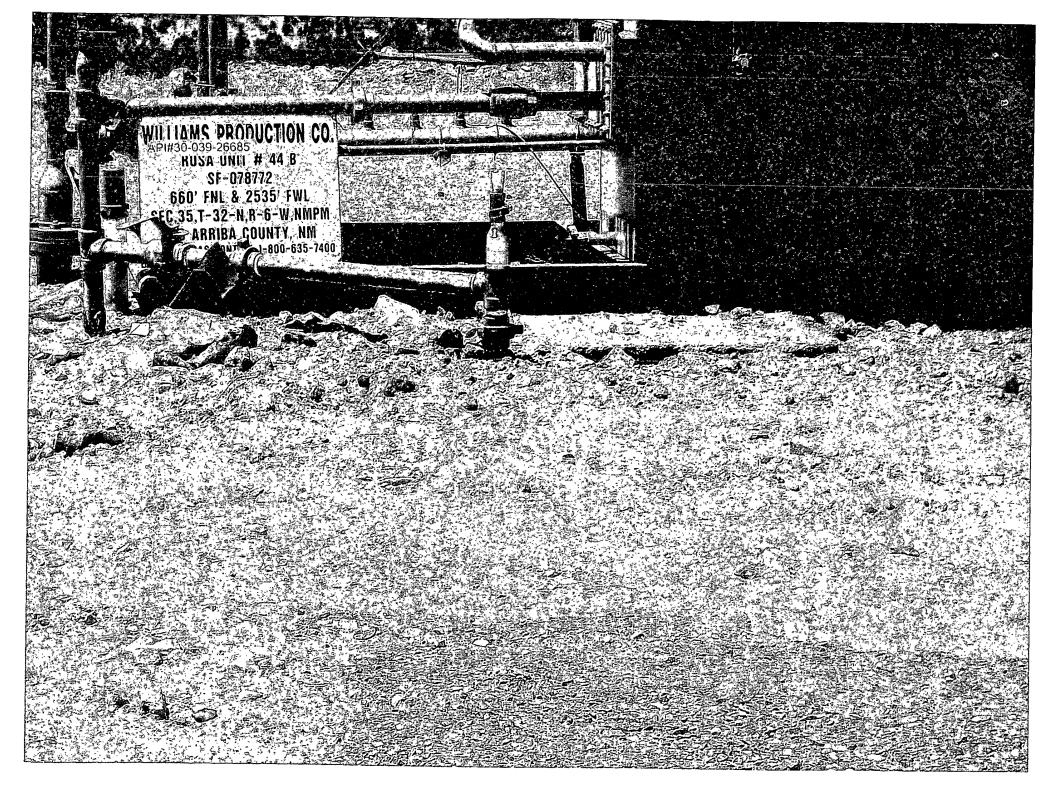

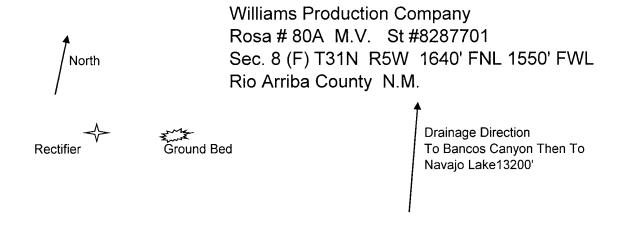

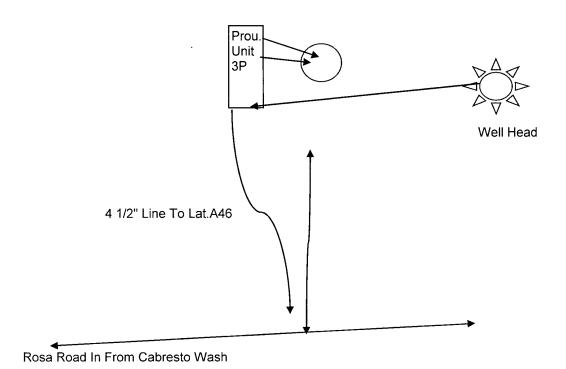

Sep. Pesco 3 Ph. Ser #203971 Year 2001 Pit 120 Bbl Fiberglass Lined & leak Detection Rectifier A. J. Electronic 180/240 Volts Ser.# 99167

### Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

### Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

### General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
  - a. Operators Name (WPX)
  - b. Well Name and API Number
  - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Talala	٦.	Cl	0.44	£	DOT-
lable	1:	Closure	Criteria	TOF	ROIS

Components	Testing Methods	aGlošvie kimils (mg/kg) .
Benzene	EPA SW-846 Method 8021B or 8260B	- 0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

- (1) Method modified for solid waste.
- (2) If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.
- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.1 NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

#### Closure Report:

All closure activities will include proper documentation and will be submitted to QCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

### Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Fiberalass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

### Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

### Operations and Maintenance Plan

- 1. WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin-Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
  - a. All discharges will be shut off to the pit.
  - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
  - c. WPX will notify and report to NMOCD as follows:
  - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
  - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15.3.116.B (1)(d).
  - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3. Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

### Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Below-Grade Tank Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

### General Plan Requirements:

- All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) 1-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
  - a. Operators Name (WPX)
  - b. Well Name and API Number
  - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed, of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.

Table 1: Closure Criteria for BGTs

Components	Jesting Methods	Closue limits (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 8015 M(Full Range)*	100
	or Method 418.1	
Chlorides	EPA SW-846 Method 300.1	250

<sup>\*</sup> Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-appröved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

						Liner	Leak o	letection	Pit	
						Plastic liner,				
						Double Wall				
					SGT.	Steel, Bottom				
					BGT,	Plastic				Comments / Repairs
Date	WellName	Run	Formation	Construction	Above	Liner	Y/N	level	level	needed
	ROSA UNIT					Banded Plastic				
9/4/2008	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	Liner.	Yes	0"	46"	
	UNIT					Plastic				
9/9/2008	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	Liner.	Yes	0"	48"	
10/29/2008	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	YES	0"	12"	
20/23/2000	UNIT						123			
11/18/2008	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	Yes	2"	18"	
1/2/2009	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	1"	29"	
1/2/2003	UNIT		IVICSA VETAC	1 IDENCEACO		110	yes	*		
1/22/2009	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	1"	37"	
0 /40 /0000	UNIT	04.04			D C T	NO				
2/12/2009	#044B UNIT	04-64	Mesa verde	FIBERGLASS	BGT	NO	yes			
3/5/2009	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	1"	51"	
	UNIT	24.24			5.0-					
5/6/2009	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	1"	24"	
5/6/2009	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	1"	24"	
	UNIT	04.5:								
6/30/2009	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	37"	
7/23/2009	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	49"	1"	

Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs needed
						1			r	· · · · · · · · · · · · · · · · · · ·
8/18/2009	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	58"	
·	UNIT						· · · · · · · · · · · · · · · · · · ·		,	
9/29/2009		04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	23"	
10/30/2009	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	35"	
	UNIT						,			
11/19/2009	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	42"	
12/23/2009	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	13"	
1/14/2010	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	18"	
	UNIT									
2/16/2010	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	36"	
3/11/2010	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	42''	
	UNIT					-	,		. –	
4/22/2010	#044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	12"	
5/18/2010	UNIT #044B	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	2"	20"	

٠.



### EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	Williams	Project #:	04108-0136
Sample ID:	BGT	Date Reported:	01-05-11
Laboratory Number:	56941	Date Sampled:	12-29-10
Chain of Custody No:	9573	Date Received:	01-03-11
Sample Matrix:	Soil	Date Extracted:	01-03-11
Preservative:		Date Analyzed:	01-04-11
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Rosa Unit 44B

Analyst



### EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

### **Quality Assurance Report**

101%

75 - 125%

<b>Gasoline Rang</b>	e C5 - C10	ND	250	253	101%	75 - 125%
Spike Conc.	(mg/Kg)	Sampl	e Spike Added	Spike Result	% Recovery	Accept Range
Diesel Range	C10 - C28	ND	ND	0.0%	0 - 30%	
Gasoline Range	e C5 - C10	ND	ND	0.0%	0 - 30%	
Duplicate Co	nc. (mg/Kg)	Sampl	e Duplicate	% Difference	Accept: Range	
Diesel Range	C10 - C28		ND		0.1	
Gasoline Range	6 C5 - C10		ND		0.2	
Blank Conc.	(mg/L - mg/Kg		Concentration		Detection Limit	
Diesel Range	C10 - C28	01-04-1	11 9.9960E+002	1.0000E+003	0.04%	0 - 15%
Gasoline Range		01-04-1			0.04%	0 - 15%
			ومومان الزخار الأيوان والمتحال المتحار والمتحار والمتحار والمتحار والمار والمتحار والمتحار والمتحار	C-Cal RF:	% Difference	Accept Range
Condition:		N/A		Analysis Requeste	ed:	TPH
Preservative:		N/A		Date Analyzed:		01-04-11
Sample Matrix:		Methylene (	Chloride	Date Received:		N/A
Laboratory Numl	oer:	56941		Date Sampled:		N/A
Sample ID:		01-04-11	QA/QC	Date Reported:		01-05-11
Client:		QA/QC		Project #:		N/A

ND - Parameter not detected at the stated detection limit.

References:

Diesel Range C10 - C28

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

252

250

SW-846, USEPA, December 1996.

ND

Comments:

QA/QC for Samples 56941-56946

Analyst



### EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Williams	Project #:	04108-0136
Sample ID:	BGT	Date Reported:	01-04-11
Laboratory Number:	56941	Date Sampled:	12-29-10
Chain of Custody:	9573	Date Received:	01-03-11
Sample Matrix:	Soil	Date Analyzed:	01-04-11
Preservative:		Date Extracted:	01-03-11
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	10

		Det.	
	Concentration	Limit	
Parameter	(ug/Kg)	(ug/Kg)	

Benzene	ND	0.9
Toluene	ND	1.0
Ethylbenzene	ND	1.0
p,m-Xylene	ND	1.2
o-Xylene	ND	0.9
Total BTEX	ND	

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	97.1 %
	1,4-difluorobenzene	106 %
	Bromochlorobenzene	91.9 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

**Comments:** 

Rosa Unit 44B

Analyst



### EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client	N/A	Project #:	N/A
Sample ID:	0104BBLK QA/QC	Date Reported:	01-04-11
Laboratory Number:	56941	Date Sampled:	N/A
Sample Matrix:	Soil	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	01-04-11
Condition:	N/A	Analysis:	BTEX
		Dilution:	10
Calibration and	ECALRE C.C.	il RF: % %Diff	ankata sa Detect
* Detection Limits (ug/L)	Acc	ept Range 0 - 15%	one limit
the distance of the state of th			

Detection Limits (ug/L)		Accept Rang	e 0 - 15%	Conc.	) · · Limit
3enzene	1.4154E+005	1.4182E+005	0.2%	ND	0.1
oluene	1.4945E+005	1.4975E+005	0.2%	ND	0.1
thylbenzene	1.3970E+005	1.3998E+005	0.2%	ND	0.1
,m-Xylene	3.2344E+005	3.2409E+005	0.2%	ND	0.1
o-Xylene	1.2826E+005	1.2852E+005	0.2%	ND	0.1

Duplicate Conc. (ug/Kg)	Sample ( Dür	olicate.	%Diff:	Accept Range	Detect, Limit
Benzene	ND	ND	0.0%	0 - 30%	0.9
Toluene	ND	ND	0.0%	0 - 30%	1.0
Ethylbenzene	NĐ	ND	0.0%	0 - 30%	1.0
p,m-Xylene	ND	ND	0.0%	0 - 30%	1.2
o-Xylene	ND <sub>.</sub>	ND	0.0%	0 - 30%	0.9

Spike Conc. (ug/Kg)	Sample Amo	unt Spiked Spik	ed Sample. %	Recovery	Accept Range
Benzene	ND	500	499	100%	39 - 150
Toluene	ND	500	491	98.2%	46 - 148
Ethylbenzene	ND	500	461	92.3%	32 - 160
p,m-Xylene	ND	1000	971	97.1%	46 - 148
o-Xylene	ND	500	474	94.9%	46 - 148

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photolonization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1998.

Comments:

**QA/QC for Samples 56941-56946** 

Analyst



Client:	Williams	Project #:	04108-0136
Sample ID:	BGT	Date Reported:	01-04-11
Laboratory Number:	56941	Date Sampled:	12-29-10
Chain of Custody No:	9573	Date Received:	01-03-11
Sample Matrix:	Soil	Date Extracted:	01-04-11
Preservative:		Date Analyzed:	01-04-11
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

**Total Petroleum Hydrocarbons** 

33.2

6.6

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Rosa Unit 44B

Analyst



## EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Client:	QA/QC	Project #:	N/A
Sample ID:	QA/QC	Date Reported:	01-04-11
Laboratory Number:	01-04-TPH.QA/QC 56941	Date Sampled:	N/A
Sample Matrix:	Freon-113	Date Analyzed:	01-04-11
Preservative:	N/A	Date Extracted:	01-04-11
Condition:	N/A	Analysis Needed:	TPH

Calibration	I-Cal Date	C-Cal Date	I-Cal RF:	C-Cal RF:	% Difference	Accept Range
•	12-27-10	01-04-11	1,660	1,720	3.6%	+/- 10%

Blank Conc. (mg/Kg)	Concentration	Detection Limit
TPH	ND	6.6

Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	Accept. Range
TPH	33.2	31.9	3.9%	+/- 30%

Spike Conc. (mg/Kg)	Sample		Spike Result		Accept Range
TPH	33.2	2,000	1,730	85.1%	80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 56941-56946

Analyst



### Chloride

Client:	Williams	Project#:	04108-0136
Sample ID:	BGT	Date Reported:	01-04-11
Lab ID#:	56941	Date Sampled:	12-29-10
Sample Matrix:	Soil	Date Received:	01-03-11
Preservative:		Date Analyzed:	01-04-11
Condition:	Intact	Chain of Custody:	9573

Parameter	Concentration (mg/Kg)

**Total Chloride** 

5

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

Rosa Unit 44B

Analyst

### CHAIN OF CUSTODY RECORD

Client: WWWS								_		*													
Client Address:		s	ampler Name:	CORDO					X	X			Ţ		T		X	*	1	<del></del> -	$\top$		-4-
7215 ma	رخم	4	22+	Bas	UP.				3015	805	3260	<sub>w</sub>		}				]	Ì				•
Client Phone No.:		Ó	lient No.:			***			d g ∈	l be	Bo	etal	ion		₹		=		]			ᇹᅵ	ä
1034-4241			04108	-01	36	•			[종] TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	RCRA 8 Metals	Cation / Anion		TCLP with H/P		TPH (418.1)	CHLORIDE				Sample Cool	Sample Intact
Sample No./	Sample	Sample	Lab No.	1	ample	No./Volume	Pre	servat	ive E	Ä	20	SRA	ation	5		PAH	표	일	ļ			틽	dur
Identification	Date	Time		<del>/</del>	Matrix	of Containers	HgCI,	HCI	<u> </u>	<u> </u>	>_	Ĕ	<u> </u>	낊	F	2	F.	ਹ			_	ΐ	Š
BGT	12/29	19:90	56941	Solid	Sludge Aqueous	1500			X	X							X	K				N	A
				Soil Solid	Sludge Aqueous																		
	-			Soil Solid	Sludge Aqueous	-						`,	·										
				Soil Solid	Sludge			-			-									<del> -</del>			
				Soil	Aqueous Sludge		-			ļ		!							_		+		
			<del></del>	Solid	Aqueous Sludge		-			<u> </u>			<u> </u>							-		$\dashv$	
				Solid	Aqueous								ļ 		_								
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous			,															
				Soil Solid	Sludge Aqueous								_	, <u></u>									
		-		Soil Solid	Sludge					-						-						1	
Relinquished by: (Signa	iture)	1000	lor	<del></del>	Aqueous Date	Time	F	Recei	ved by:	(Signa	ature)		4	 לכל	1					Date	/[1]	Tin	
Relinquished by: (Signa	iture)	18210			7-111-H	11.20	F	Recei	ved by:					<u> </u>			•	<u>.</u>	<del>.  </del>	1,	1		
Relinquished by: (Signa	ture)						F	lecei	ved by:	(Signa	ature)							•••					
				(	3	env	/ i	r(	ot la	e (	<b>h</b>								<u> </u>				

5796 US Highway 64 • Farmington, NM 87401 • 505-632-0615 • lab@envirotech-inc.com