District I 1625 N French Dr., Hobbs, NM 88240 District II 1301 W Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S St Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Department
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

7	7	2	7
	, ,		,

<u>Pit, Closed-Loop System, Below-Grade Tank, or</u> <u>Proposed Alternative Method Permit or Closure Plan Application</u>

Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
1,
Operator. WILLIAMS PRODUCTION COMPANY, LLC OGRID # 120782
Address PO Box 640 Aztec, NM 87410
Facility or well name: ROSA UNIT #148B
API Number 3003926985 OCD Permit Number.
Section 2P Township 31N Range 06W County RIO ARRIBA
Latitude: 36.922150000000002 Longitude 107.42682000000001 NAD 1983 Surface Owner FEDERAL
Pit: Subsection F or G of 19 15 17 11 NMAC Temporary Drilling Workover Permanent Emergency Cavitation P&A Lined Unlined Liner type Thickness mil LLDPE HDPE PVC Other String-Reinforced Liner Seams Welded Factory Other volume bbl Dimensions: L x W x D
3
☐ Closed-loop System: Subsection H of 19 15 17 11 NMAC Type of Operation ☐ P&A ☐ Drilling a new well ☐ Workover or Drilling (Applies to activities which require prior approval of a permit or notice of
intent)
☐ Drying Pad ☐ Above Ground Steel Tanks ☐ Haul-off Bins ☐ Other
☐ Lined ☐ Unlined Liner type Thicknessmil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other
Liner Seams Welded Factory Other Other
Liner Seams Welded Factory Other
Below-grade tank: Subsection I of 19 15 17 11 NMAC
Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off
Tank Construction material FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off
☐ Visible sidewalls and liner ☐ Visible sidewalls only ☐ Other
Liner type Thickness mil HDPE PVC Other
5.
Alternative Method:
Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval

Fencing: Subsection D of 19 15 17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks) Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, institution or church) Four foot height, four strands of barbed wire evenly spaced between one and four feet Alternate Please specify	hospital,
Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks) Screen □ Netting □ Other □ Monthly inspections (If netting or screening is not physically feasible)	
Signs: Subsection C of 19 15 17 11 NMAC ☐ 12"x 24". 2" lettering, providing Operator's name, site location, and emergency telephone numbers ☐ Signed in compliance with 19 15.3 103 NMAC	
Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required Please refer to 19 15.17 NMAC for guidance Please check a box if one or more of the following is requested, if not leave blank: Administrative approval(s) Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau consideration of approval Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval	office for
Siting Criteria (regarding permitting): 19 15 17 10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the approoffice or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dry above-grade tanks associated with a closed-loop system.	priate district pproval.
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells	☐ Yes ☐ No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) - Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application (Applies to temporary, emergency, or cavitation pits and below-grade tanks) - Visual inspection (certification) of the proposed site; Aerial photo, Satellite image	Yes No
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application (Applies to permanent pits) - Visual inspection (certification) of the proposed site; Aerial photo, Satellite image	☐ Yes ☐ No ☐ NA
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application - NM Office of the State Engineer - iWATERS database search, Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality	☐ Yes ☐ No
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area.	☐ Yes ☐ No

Within a 100-year floodplain - FEMA map

Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources, USGS; NM Geological Society, Topographic map

☐ Yes ☐ No

<u> </u>	
Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Instructions: Each of the following items must be attached to the application. Please indicate, by a check attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsecting Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15.17 10 Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements	k mark in the box, that the documents are ction B of 19 15 17 9 NMAC of Subsection B of 19 15 17 9 NMAC NMAC
and 19 15 17 13 NMAC	
Previously Approved Design (attach copy of design) API Number or F	Permit Number
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check attached. Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragra Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.11 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirement and 19.15.17.13 NMAC	uph (3) of Subsection B of 19 15 17.9 quirements of 19 15 17 10 NMAC
Previously Approved Design (attach copy of design) API Number	
Previously Approved Operating and Maintenance Plan API Number(Applies only to closed-loop system that use
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)	
Permanent Pits Permit Application Checklist: Subsection B of 19 15.17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Emergency Response Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.	NMAC NMAC 7 11 NMAC 5 17 11 NMAC I NMAC
Proposed Closure: 19 15 17 13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closs Type Drilling Workover Emergency Cavitation P&A Permanent Pit Below-g Alternative Proposed Closure Method Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe	rade Tank
Alternative Closure Method (Exceptions must be submitted to the Santa Fe Waste Excavation and Removal Closure Plan Checklist: (19.15 17.13 NMAC) Instructions: Each of the closure plan. Please indicate, by a check mark in the box, that the documents are attached. Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17.13 NMAC	he following items must be attached to the F of 19 15 17 13 NMAC
Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NM	AC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: (19.15.17.13) Instructions: Please indentify the facility or facilities for the disposal of liquids, drilling fluids and drill cuttings. Use attachment if	
facilities are required.	
Disposal Facility Name Disposal Facility Permit Number	
Disposal Facility Name Disposal Facility Permit Number	
Will any of the proposed closed-loop system operations and associated activities occur on or in areas that will not be used for future ser Yes (If yes, please provide the information below) No	vice and operations?
Required for impacted areas which will not be used for future service and operations Soil Backfill and Cover Design Specifications based upon the appropriate requirements of Subsection H of 19 15.17.13 NMA Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC	C
Siting Criteria (regarding on-site closure methods only): 19 15 17 10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable sou provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate dist considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval. Just demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC for guidance.	rict office or may be
Ground water is less than 50 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search, USGS; Data obtained from nearby wells	☐ Yes ☑ No ☐ NA
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS; Data obtained from nearby wells	☐ Yes ☒ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - 1WATERS database search, USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) - Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application - Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	☐ Yes ☑ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site	☐ Yes ☑ No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality	☐ Yes ⊠ No
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ⊠ No
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☑ No
Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources; USGS, NM Geological Society, Topographic map	☐ Yes ☑ No
Within a 100-year floodplain - FEMA map	☐ Yes ⊠ No
18 On-Site Closure Plan Checklist: (19 15 17 13 NMAC) Instructions: Each of the following items must be attached to the closure plan.	an Please indicate
by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection F of 19.15 17.13 NMAC Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of 19 15 17 11 NMAC Construction/Design Plan of Temporary Pit (for in-place burial of a drying pad) - based upon the appropriate requirements of 19 NMAC Protocols and Procedures - based upon the appropriate requirements of 19 15 17.13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC Waste Material Sampling Plan - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings or in case on-site closure standards cann Soil Cover Design - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15.17.13 NMAC	15 17 11 NMAC

* 2
Operator Application Certification:
I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief
Name (Print) Title:
Signature Date_
e-mail address Telephone
OCD Approval: Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment) OCD Representative Signature: Approval Date: S/29/20[] Title: OCD Permit Number:
Closure Report (required within 60 days of closure completion): Subsection K of 19 15 17 13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed. Closure Completion Date:4/30/10 Disposal Facility Name and Permit #:S.J. Regional Landfill, NMED SWM-052426_
Closure Method: Waste Excavation and Removal On-Site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain.
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please indentify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities were utilized.
Disposal Facility Name Disposal Facility Permit Number
Disposal Facility Name Disposal Facility Permit Number
Were the closed-loop system operations and associated activities performed on or in areas that <i>will not</i> be used for future service and operations? [Yes (If yes, please demonstrate compliance to the items below) [No
Required for impacted areas which will not be used for future service and operations Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site closure) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location Latitude Longitude NAD. 1927 1983
25.
Operator Closure Certification: I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.
Name (Print) Vanessa Fields TitleEH&S Coordinator
Signature
e-mail address vanessa fields@williams com Telephone 505-634-4209



Exploration & Fraduction FO Box 640 Aztec NM 81137 505/634 4219 505/634 4214 Fax

March 10, 2009

Mr. Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy Farmington, NM 87401

Sent via Certified Mail

RE Notification of Production Pit Closure

Rule 19 15 17 13 NMAC

Production Pits associated Natural Gas Development

Operated by Williams Production Co. LLC

Pursuant to Rule 19 15 17 13 NMAC this correspondence is to notify the Bureau of Land Management, Farmington Field Office, of Williams Production LLC's (Williams) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Amba County, New Mexico - Closure will follow the plan included with this correspondence

Thank you for your consideration. If there are any questions or additional information is requested, please contact me at (505) 634-4209.

Respectfully submitted

Holly C #erkins EH&S Specialist

Encl Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assets Below-Grade Tank Closure Plan

cc Environmental Fils

WELLS W/FEDERAL SURF MGT API **EMT** SEC TWN CONSTRUCTION MATERIAL RNG PIT TYPE COX CANYON UNIT #001 3004511397 PLANCO MV 16N 32N 11W BGT DBL WALL STEFL FIBERGLASS TANK w/BANDED 20-mil COX CANYON UNIT #001A 3004522086 BLANCO MV 160 3211 11W BG1 HIDDE SECONDARY LINER FIRERGLASS TANK W/BANDED 20-mil COX CANYON UNIT #001B 3004530791 BLANCO MV HDPE SECONDARY LINER BG1 161 32N 11WCOXICANYON UNIT #001C BLANCO MV 3004532023 16E. 32N 11Vv BGI DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil COX CANYON UNIT #003 BLANCO MV 11VV HOPE SECONDARY LINER 3004511495 qt 32N BGT COX CANYON UNIT #003A BLANCO MV 3004522088 9P 32N 11W BGI DBL WALL STEEL COX CANYON UNIT #003B BLANCO MV 3004530871 9J32N 11W BGT DBL WALL STEEL COX CANYON UNIT #004 32N 3004511368 BLANCO MV 21A BGI DBL WALL STEEL 11W COX CANYON UNIT #004A 3004522093 BLANCO MV 21P 32N BG1 DBL WALL STEEL 11W COX CANYON UNIT #004B BLANCO MV 3004532186 21F 32N BGT DBI WALL STEEL 11W COX CANYON UNIT #005 BLANCO MV 21K 32N BGT DBL WALL STEEL 3004511326 1.1 W COX CANYON UNIT #005A BLANCO MV 32N BGT 3004522094 210 1.1 VV DBL WALL STEEL BASIN DK / COX CANYON UNIT #005B BLANCO MV 21N BGI DBL WALL STEEL 3004532142 32N 11W COX CANYON UNIT #005C BLANCO MV 21F 32N RGI DBI WALL STEEL 3004533493 11Vv COX CANYON UNIT #006 BLANCO MV 3004511463 16A 32N 11W BGT DBL WALL STEEL COX CANYON UNIT #006A BLANCO MV 3004522095 161 32N 11W BGT DBL WALL STEEL COX CANYON UNIT #006B 3004532693 BLANCO MV 16B 32N 11W BGI DBL WALL STEEL COX CANYON UNIT #006C 32N 3004532733 BLANCO MV 160 11W **RGI** DBL WALL STEEL COX CANYON UNIT #007 3004511455 **BLANCO MV** 17G 32N 11W FGP DBL WALL STEEL COX CANYON UNIT #007A BLANCO MV 170 3004522091 32N 11W BG1 DBL WALL STEEL COX CANYON UNIT #007C 3004533018 **BASIN DK** 17K 32N 11V/ BG1 DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mill COX CANYON UNIT #008 HDPE SECONDARY LINER 3004511492 BLANCO MV 81 32N 11W BGI COX CANYON UNIT #008A 3004522096 BLANCO MV 17H 32N 11W BG1 DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil COX CANYON UNIT #008B 3004532080 **BLANCO MV** 8P 32N 11W BGI HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil COX CANYON UNIT #008C 3004531187 **BLANCO MV** 17P 32N 11W RGI HDPE SECONDARY LINER COX CANYON UNIT #009A FIBERGLASS TANK w/BANDED 20-mil COM 3004522092 **BLANCO MV** 20D 32N 11W BGT HDPE SECONDARY LINER COX CANYON UNIT #009B BASIN DK / COM BLANCO MV 20B 11W BGT DBL WALL STEEL 3004533926 32N BASIN DK / COX CANYON UNIT #009C 3003933851 BLANCO MV 20F 32N 11W **BGI** DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil 11W HDPE SECONDARY LINER COX CANYON UNIT #013 20A BGT 3004521489 BLANCO PC 32N

WELLS W/FEDERAL							
SURF MGT COX CANYON UNIT #023	API	FMT	SEC	TWN	RNG	PIT TYPE	FIBERGLASS TANK W/BANDED 20-mil
COM	3004522537	BLANCO PC	17C	32N	1111	BG1	HDPE SECONDARY LINER
	3004022007	DIMICOTO	170	.1214	1 4 4	DG	FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #025	3004522572	BLANCO PC	9O	32N	11W	BGT	HDPE SECONDARY LINER
	C. C. C. T. L. C. C. C.	1211111111111111		OL.	, , , ,	.,,	FIBERGLASS TANK w/BANDED 20-mil
COX CANYON UNIT #200	3004527878	BASINFIC	91	32N	11VV	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #200A	3004532126	BASIN FTC	90	3211	11W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #203	3004527872	BASINFIC	17A	32N	111/	BGT	HDPE SECONDARY LINER
LAA CITA AND MAAN							
MADDOX #001	3004511487	BLANCO MV	10N	32N	11W	BG1	DBI WALL STEEL
MADDOX #001A	20045225	OLANCO M	100	COAL	4 4 1 6 7	0.01	DDL WALL CACE
IMADDOX #001A	3004523539	BLANCO MV	10F	32N	11W	BG1	DBI WALL STEEL
NM 32-11 #001	3004511309	BLANCO MV	200	32N	11W	BGT	DBI WALL STEEL
	0004011700	BASIN DK /	200	3214	1171	001	
NM 32-11 #001B COM	3004532024	BLANCO MV	203	32N	11W	BGT	DBL WALL STEEL
		BASIN DK /					
NM 32-11 #001C COM	3004532804	BLANCO MV	20L	32N	11W	BG1	DBI WALL STEEL
							FIBERGLASS TANK W/BANDED 20-mill
NM 32-11 #002 COM	3004511380	BLANCO MV	19A	32N	11W	BG1	HDPE SECONDARY LINER
NM 32 11 #002A COM	3004529017	BLANCO MV	190	421	1 1 VV	BGT	DBI WALL STEFL
AU 100 11 H0005 CO11	2004626276	5) 41/0/2 10/	4.601				NEW MARK 675 E.
NM 32-11 #002B COM	3004532670	BLANCO MV	191	3214	11W	BGT	DBL WALL STEFL
NM 32-11 #002C COM	3004533077	BI ANCO MV	19G	2011	11W	BG1	CODE MALL STEEL
140026 6600	3004553077	DI ANCO MV	13767	32N	1100	BGI	DBL WALL STEEL
ROSA UNIT #001 SWD	3003927055	SWD	231	31N	06W	BG1	DBL WALL STEEL
	5000027000	BASIN DK /	2 ())	JIIV	COVV	БОТ	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #001E	3003925411	BLANCO MV	11P	31N	06W	BGT	HDPE SECONDARY LINER
ı		BLANCO MV /					
ROSA UNIT #005A	3003925407	ROSA PC	26F	31N	06VV	BG1	DBL WALL STEEL
		BASIN DK /					
ROSA UNIT #005B	3003926927	BLANCO MV	26B	3111	OGW	BGT	DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #005Y	3003926078	BLANCO MV	26H	51N	00	BG1	HDPE SECONDARY LINER
ROSA UNIT #008	200,000,01	BLANCO MV /	****	0.111	611.161	0.03	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #008	3003907944	ROSA PC BLANCO MV /	26M	31N	06W	BGT	FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	ogw	BG1	HDPE SECONDARY LINER
(5)37 (5)47 (4)(5)	30000011044	BLANCO MV /	ZOW	JIII	Cicio	001	FIBERGLASS TANK WIBANDED 20-mil
ROSA UNIT #006A	3003925430	ROSA PC	26D	31N	06W	BG1	HDPE SECONDARY LINER
			- • -				FIBERGLASS TANK W/BANDED 20-mil
3800# TINU AZOS	3003926944	BLANCO MV	26N	31N	06W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
₹OSA UNIT #009	3003907975	BLANCO MV	11K	31N	06W	BG1	HDPE SECONDARY LINER
		BASIN DK /					
ARUUH TINU ARUS	3003925584	BI ANCO MV	11C	31N	06W	BG1	DBL WALL STEEL
V26 1 (1) 1/2 (10) 1/2			_				FIBERGLASS TANK w/BANDED 20-mil
COSA UNIT #009B	3003927042	BLANCO MV	11E	31N	06W	BGT	HDPE SECONDARY LINER
1000 A 11A117 #0400	20000000	DIANOCANA	4041	0.44	0.0011	50-	FIBERGLASS TANK W/BANDED 20 mil
'OSA UNIT #010B	3003926556	BLANCO MV	13N	31N	06W	BG1	HDPE SECONDARY LINER
OSA UNIT #010C	3003926918	BLANCO MV	13N	31N	()E/AI	BGT	DBL WALL STEEL
CONTINUE TO THE	30038Z0810	DE MINCO INIV	1018	SHY	06W	ВОТ	DDL WALL STEEL
OSA UNIT #010C	3003926556	BLANCO MV	13N	31N	06W	BG1	DBL WALL STEEL
	3555520000				0011		DUE 117ILE VILEE

· • • •

WELLS W/FEDERAL							
SURF MGT	API	FM1 BLANCO MV /	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #012A	3003925900	ROSA PC	15J	31N	OGW	BG1	DBI WALL STEFI
		BASIN DK /				• • • • • • • • • • • • • • • • • • • •	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #012B	3003926555	PLANCO MV	15P	3111	Wan	BGI	HDPE SECONDARY LINER
ROSA UNIT #012C	3003929486	BLANCO MV	15A	31N	06\V	SGT	SINGLE WALL STEEL FIBERGLASS LANK WBANDED 20 mil
ROSA UNIT #013	3003907936	BLANCO MV	31G	3111	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #013A	3003926298	BLANCO MV BASIN DK /	31F	31N	05VV	BG1	HDPE SECONDARY LINER
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	()5Vv	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-niil
ROSA UNIT #014	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPF SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #014A	3003926280	BLANCO MV BASIN DK /	23P	3111	0674	BG1	HDPE SECONDARY LINER
ROSA UNIT #014C	3003930132	BLANCO MV	23H	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #015	3003907946	BI ANCO MV	29H	31N	05W	BGT	HDPF SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #016	3003907963	BLANCO MV	14N	3111	06 V V	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #016A	3003925496	BLANCO MV	14C	31N	06W	BGT	HOPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #016B	3003926218	BLANCO MV	14M	31N	VV80	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #01/A	3003926272	BLANCO MV BASIN DK /	200	31N	(15W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #017B	3003926971	BLANCO MV BLANCO MV /	20J	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #018	3003907960	ROSA PC BLANCO MV /	22H	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #018A	3003925436	ROSA PC	22P	31N	06W	SGT	DBI WALI STEEI
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W	BGT	DBI. WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #019	3003907955	BLANCO MV	24K	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #019B	3003926560	BLANCO MV	241	31N	ย ₆ W	BG1	HDPE SECONDARY LINER
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBI WALL STEEL
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #020	3003907969	BLANCO MV	14G	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #020A	3003925495	BLANCO MV	14()	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #020B	3003926220	BI ANCO MV	14A	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #021A	3003926121	BLANCO MV	23C	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #021B	3003926554	BLANCO MV	23K	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #022	3003907971	BLANCO MV	18A	31N	05W		HDPE SECONDARY LINER

ŧ

WELLS W/FEDERAL							
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #022A	3003926390	BLANCO MY	18C	3111	05W	BG1	HDPE SECONDARY LINER
Į.							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #023	3003907942	BLANCO MV	29M	31N	05Vv	BGI	HDPE SECONDARY LINER
1							FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #0238	3003926553	BLANCO MV	29E	31N	05W	RG1	HDPE SECONDARY LINER
		BASIN DK /	COL	*****			FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #023C	3003927609	BLANCO MV	291	31N	05Vv	BG1	HDPL SECONDARY LINER
	GOOGICE TOOL	EN 7 W CO CO INTO	2.00	5111	COVV	1.107	FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #024	3003907933	BLANCO MV	32IM	31N	05Vv	BGI	HDPE SECONDARY LINER
The control of the co	5005507555	BASIN DK /	JZ IVI	SHA	OOV	001	THE CLOONDANT LINEN
ROSA UNIT #024A	200 1000 150		IO.E	(1.4.1.1	rut 12.1	C C T	INDUMAN CITTI
TROOM OINT #UZ4A	3003925568	BLANCO MV	32E	31N	05Vv	SGT	DBL WALL STEEL
DOV A LIBIT HOUSE		BASIN DK /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #024B	3003926630	BLANCO MV	32N	31N	05W	BGT	HDPE SECONDARY LINER
B001 BUIL 0010		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #024C	3003926968	BLANCO MV	32C	31N	05W	BG1	HOPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #026A	3003925580	BLANCO MV	32O	31N	05W	SGT	DBL WALL STEEL
ROSA UNIT #026B	3003926788	BASIN DK	32G	31N	05W	SG1	DBI WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #029	3004511136	BLANCO MV	32H	32N	06W	BGT	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w/BANDED 20-mil
POSA UNIT #029B	3004530709	BLANCO MV	32B	32N	06VV	BGT	HUPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #029M	3004529584	BLANCO MV	321	32N	OOV	BG1	DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #030 COM	3003925570	BLANCO MV	120	31N	06W	BGT	HDPE SECONDARY LINER
	0000010010		120		(,,,,,	D() I	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #030A	3003926068	BLANCO MV	12M	31N	06W	BGT	HDPE SECONDARY LINER
1007 0111 40007	5005820000	DI ANCO MIV	12101	9118	OOVV		FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #030B	3/3/1/20/20/21/14	1) A. (1) (1) (1)	47.63	21.4.3.1	() () ()		
1703A 01411 #000B	3003926601	BI ANCO MV	12N	31N	06M,	BGT	HDPE SECONDARY LINER
ROSA UNIT #030C	100000000000	D) 6416 6\44\4	41.50	0.41		0.01	TO LEAD OFF
ROSA UNIT #030C	3003929842	BLANCO MV	12P	31N	06W		DBL WALL STEEL
DOCA HANT HOSE	04400440620		4 51 63				FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #031	3003926279	BLANCO MV	17C	31N	05Vv		HDPE SECONDARY LINER
5.66							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #031A	3003926346	BLANCO MV	171	31N	05W		HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w.BANDED 20-mil
ROSA UNIT #0316	3003926579	BLANCO MV	170	31N	05W		HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #031C	3003926578	BLANCO MV	17N	3114	05W	BGT	HDPE SECONDARY LINER
		BLANCO MV /					
ROSA UNIT #032	3003925389	ROSA PC	21H	31N	06W	BG1	DBL WALL STEEL
		BLANCO MV /					
ROSA UNIT #032A	3003925417	ROSA PC	21F	31N	06W	BG1	DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #032B	3003926771	BLANCO MV	21G	31N	06W	BGT	HDPE SECONDARY LINER
		BASIN DK /		-			FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #032C	3003927240	BLANCO MV	21F	31N	06W		HDPE SECONDARY LINER
1	SUSSIE LETV		~	U 111	**** Y		FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #034	3003907984	BLANCO MV	36B	3211	06W		HDPE SECONDARY LINER
	5003507804	DI MIYO O MIY	SOD	0214	COVV	וטטו	TIEFE OF COMPANY FINER
ROSA UNIT #034A	2002002440	DI ANICO MI	201	2011	()CIA:	DCI	DDI MALI CIETI
NOSA UNIT #U34A	3003926119	BI ANCO MV	361	32N	06W	BGI	DBL WALL STEEL
DOCA THAT HOSE	20000000000	DI ANIZO NO	***		416.14.	0.03	COLUMNIA CIESI
ROSA UNIT #034A	3003926119	BI ANCO MV	361	32N	06W		DBL WALL STEEL
EVAL A LIKE HAVE I							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #034E	3003926629	BLANCO MV	36J	32N	06W	BG1	HDPE SECONDARY LINER

.

WELLS W/FEDERAL							
SURF MG1	API	FMT	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL FIBERGLASS TANK W/BANDED 20-pul
ROSA UNIT #034C	3003926969	BLANCO MV	36H	32N	OGW	PG1	HDPE SECONDARY LINER
ROSA UNIT #035X	3004510996	EL ANCO MV	5K	3114	vV80	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #036	3003907977	ELANCO MV	1111	31N	06W	EGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #036C	3003930182	BLANCO MV	11G	3111	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #041	3003907981	BLANCO MV BASIN DK /	5K	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #041B	3003927014	BLANCO MV	6P	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #044	3003925873	BI ANCO MV	35K	32N	W80	BGT	DBL WALL STEEL
ROSA UNIT #044A	3003926161	BI ANCO MV	35E	32N	06W	SGT	SINGLE WALL STEEL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	OGVV	SGI	DBI, WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #045	3003923013	BLANCO MV BASIN DK /	Me	3111	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #046A	3003926986	BLANCO MV	80	3111	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #053	3003920293	BASIN DK	8B	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #055	3003920923	BASIN DK	341	31N	()£W	BG1	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #059 DK	3003923270	BASIN DK	25N	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06Vv	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #060	3004529798	BLANCO MV	41	31N	06Vv	BG1	HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05W	BGT	DBL WALL STEEL
ROSA UNIT #064	3003921703	BASIN DK BASIN DK /	29A	31N	05W	SGI	DBI WALL STEEL
ROSA UNIT #064M	3003925563	BLANCO MV	29F	31N	05W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #065	3003921702	BASIN DK	17A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #066	3003921758	BASIN DK	13[31N	06VV	BGI	HDPE SECONDARY LINER
ROSA UNIT #066M	3003925747	BASIN DK / BLANGO MV	13F	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #072	3003925509	BŁ ANCO MV	61	31N	05W	BGT	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #072A	3003925795	BLANCO MV	6K	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #075	3004529895	BLANCO MV	101	31N	06W	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #075A	3004529854	BLANCO MV	40	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #07 [†]	3003922538	DK/UNDES GL/BLANCO	331	31N	05W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER

• , •

WELLS W/FEDERAL							
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
ROSA UNIT #079	3003922539	BASIN DK / BLANCO MV BASIN DK /	22K	3111	06W	BGI	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV BLANCO MV /	22K	3114	06W	SG1	DBL WALL STEEL
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	22E	3111	06W	BG1	DBI WALL STEEL
ROSA UNIT #079B	3003926920	BLANCO MV	22C	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #079C	3003929902	BLANCO MV BASIN DK /	31P	3111	05W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #080	3003922537	BLANCO MV	вĸ	31N	05Vv	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #080A	3003926413	BLANCO MV	8f	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	051/7	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #085A	3003926314	BLANCO MV	20C	3111	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #085E	3003930130	BLANCO MV	20D	3111	05W	BG1	DBL WALL STEEL
ROSA UNIT #086	3003922766	UNDES GI BLANCO MV /	12W	31N	04W	\$G1	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	ROSA PC	8F	31N	W80	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #089	3003922782	BLANCO MV	34A	32N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w'BANDED 20 mil
ROSA UNIT #089A	3003925512	BLANCO MV	34O	32N	06W	KG1	HDPE SECONDARY LINER
ROSA UNIT #089B	3003926851	PLANCO MV	341	32N	06W	BGI	DBI WALI STEEL
ROSA UNIT #089C	3003926674	BLANCO MV	34G	3214	W3()	SGI	SINGLE WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #090 COM	3004525370	BLANCO MV	33G	32N	0674	BGT	HDPE SECONDARY LINER
ROSA UNIT #090A COM	3004529259	BLANCO MV	33G	3211	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #091	3003922780	BLANCO MV	35H	32N	06W	BGI	HDPE SECONDARY LINER
ROSA UNIT #091A	3003925790	BLANCO MV	35O	32N	06W	SG1	DBI WALI STEEL
ROSA UNIT #091B	3003926684	BLANCO MV	35P	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #091C	3003926991	BI ANCO MV	35G	3211	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDEL) 20-mil
ROSA UNIT #098	3003923265	BASIN DK / GL BASIN DK /	23L	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #100B	3003929547	BLANCO MV	210	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #100C	3003929851	BLANCO MV BLANCO MV /	21K	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #100E	3003925135	ROSA PC	211	31N	W80	SG1	SINGLE WALL STEEL
1011 #1011.1	3003925577	BLANCO MV	24F	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
OSA UNIT #10E	3003923506	BASIN DK / GL	7G	3111	U5W	BG1	HDPE SECONDARY LINER

F ...

WELLS WIFEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #119	3003925143	BASIN DK	18N	31N	051/0	BG1	DBI WALL STEEL
ROSA UNIT #125	3003925144	BLANCO MV	13B	31N	06W	BGT	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #1250	3003929843	BLANCO MV	13G	31N	06\/V	BGT	DEL WALL STEEL
ROSA UNIT #125E	3003925526	BASIN DK / BLANCO MV	13.	31N	06W	BGT	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	34F	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #129A	3003926297	BLANCO MV	34K	3211	06W	BGT	DBL WALL STEEL
ROSA UNIT #137	3003925410	BLANCO MV	31K	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	BLANCO MV / ROSA PC	311	31N	U5W	BG1	DBI WALL STEEL
ROSA UNIT #137B	3003927002	BLANCO MV	31P	3111	05W	BG1	FIBERGLASS TANK WBANDED 20-mil HDFF SECONDARY LINER
ROSA UNIT #138	3004529147	BLANCO MV / ROSA PC	171	31N	06VV	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #138A	3004529134	BLANCO MV / ROSA PC	1711	3111	W80	BG1	DBI WALL STEFI
ROSA UNIT #138B	3004532168	BLANCO MV	1/14	3111	W80	BGT	DBI WALL STEFI
ROSA UNIT #139A	3004529600	BLANCO MV	17 M	3111	06W	BGT	DPI WALL STEEL
ROSA UNIT #140	3003925435	ROSA PC	22K	31N	W30	BGT	DBL WALL STEEL
ROSA UNIT #144	3003925421	ROSAFC	26A	31N	0617	BG1	DBI WALL STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	16F	31N	06W	-	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #146A	3003925513	BLANCO MV	28N	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #146C	3003930187	BLANCO MV	28B	31N	05W	BG1	DBI WALL STEFI
ROSA UNIT #148	3003925493	BASIN DK	20	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #148A	3003925776	BLANCO MV	2N	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA LINIT #148B	3003926985	, BI ANCOMV	2P	-31N	~06W	BG1 -	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	06VV		HDPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV BASIN DK /	12F	3111	06W		DBI, WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #149B	3003926599	BLANCO MV	12F	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #150	3004529229	BLANCO MV	32F	32N	06W		HDPE SECONDARY LINER
ROSA UNIT #150A	3004529592	BLANCO MV BASIN DK /	32M	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #150B	3004530874	BLANCO MV	32D	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #150C	3004532157	BLANCO MV	32K	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #15.	3004529267	BLANCO MV	33C	32N	06W	BG1	DBL WALL STEEL

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	33L	32N	06Vv	BGI	DBI WALL STEEL
ROSA UNIT #151C	3004532190	BLANCO MV	33N	32N	061/v	EGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #152	3003925494	BLANCO MV	36E	32N	06\V	RG1	HDPE SECONDARY LINER
ROSA UNIT #152A	3003925695	BLANCO MV	36N	3214	06W	BGT	DBL WALL STEEL
ROSA UNIT #152B	3003926631	BLANCO MV	36C	32N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #152C	3003927635	BLANCO MV	361	32N	06W	EG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #153	3003925524	BLANCO MV	170	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #153A	3003926329	BLANCO MV BASIN DK /	17A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #153B	3003927603	BLANCO MV	171	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	7N	31N	05VV	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #154A	3003926274	PLANCO MV	7P	3111	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #150	3004529661	BLANCO MV	9A	3111	Wau	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
RUSA UNIT #156A	3004529640	BLANCO MV BASIN DK /	91	31N	Wau	BG1	HDPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BLANCO MV	190	31N	05W	BGT	DBI WALL STEFI FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3110	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #15C	3003930111	BLANCO MV /	29G	31N	05W	BGT	HOPE SECONDARY LINER
ROSA UNIT #160	3003925890	ROSA PC	250	31N	06V7	BG1	DBL WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV BASIN DK /	25N	31N	Wan	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #160B	3003926962	BLANCO MV	25L	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	06W	BGI	DBI, WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #162	3003926069	BI ANCO MV	30K	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BLANCO MV	30P	31N	05W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #163	3003926345	BLANCO MV	24G	31N	06W	BGI	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #163A	3003926336	BLANCO MV	240	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BLANCO MV	24B	31N	06W	SGT	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV	24J	31N	06W		SINGLE WALL STEEL
ROSA UNIT #164	3003926151	BASIN DK / BLANCO MV	1J	31N	06W	BG1	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #164A	3003926080	BLANCO MV	1J	31N	06W	BGT	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #164E	3003927242	BASIN DK / BLANCO MV	1J	31N	06VV		FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER

ì

WELLS W/FEDERAL							
SURF MG1	API	FM1 BLANCO MV /	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #165	3003926070	ROSA PC	251	31N	06W	B61	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-r
ROSA UNIT #165A	3003926150	BLANCO MV BASIN DK /	25B	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #165B	3003926557	BLANCO MV BASIN DK /	25E	31N	06VV	BG1	DBI WALL STEEL
ROSA UNIT #165C	3003926961	BLANCO MV	25G	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-0
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	05W	BG1	HOPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 r
ROSA UNIT #166A	3003926282	BLANCO MV	30F	31N	05W	BGT	HDFE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-1
ROSA UNIT #167A	3004529886	BLANCO MV	8A	31N	06Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #169	3003926130	BLANCO MV	3J	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #169A	3003926149	BLANCO MV	31	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-n
ROSA UNIT #169C	3003927717	BLANCO MV	2M	3111	0674	BGI	HDPE SECONDARY LINER
ROSA UNIT #170	3003925851	BLANCO MV	21N	31N	06 V V	BGT	DBI WALL STEEL
ROSA UNIT #171	3003926286	BLANCO MV	7G	3111	05W		DBL WALL STEEL FIBERGLASS TANK WBANDED 20-r
ROSA UNIT #171A	3003926389	BLANCO MV	7G	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 r
ROSA UNIT #171B	3003927013	BLANCO MV	69	31N	05W	BG1	HDFE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-7
ROSA UNIT #180	3004529898	BLANCO MV	9N	31N	06VV		HDPE SECONDARY LINER
ROSA UNIT #180B	3004533134	BLANCO MV	91	311/	06Vv	BGT	DBI WALL STEEL
ROSA UNIT #180C	3004533191	BLANCO MV	9E	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #181	3003926463	BLANCO MV	11k	31N	06W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 n
ROSA UNIT #181A ROSA UNIT #1810 (shared	3003926312	BLANCO MV	15A	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 n
v/169C)	3003927714	BLANCO MV	2M	31N	06W	BGT	HIDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #182	3003926283	BLANCO MV	18N	31N	05W		HDFE SECONDARY LINER
ROSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05W	BGT	DBL WALL STEFL
ROSA UNIT #1820	3003930180	BLANCO MV	18F′	31N	05W		SINGLE WALL STEEL FIBERGLASS TANK w.BANDED 20-n
ROSA UNIT #183	3003926387	BLANCO MV	19G	31N	05W	BGT I	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-n
OSA UNIT #183A	3003926386	BLANCO MV	19F	31N	05W		HDPE SECONDARY LINER
OSA UNIT #183B	3003930087	BLANCO MV BASIN DK /	19B	31N	05W	BGT (DBI WALI STEEL
OSA UNIT #185B	3004532734	BLANCO MV	16F	31N	W80	BG1 (DBI WALL STEFL
OSA UNIT #185C	3004534484	BI ANCO MV	16F	31N	06W	BG1 (OBL WALL STEEL
:0SA UNII #18È	3003930186	BLANCO MV	21G	31N	05W	BGT (OBL WALL STEEL

WELLS W/FEDERAL SURF MG1	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #231	3003924441	BASINTIC	31N	,3114	05V/	561	SINGLE WALL SILEL
ROSA UNIT #335A	3003930222	BASINFIC	05.1	31N	05Vv	SG1	SINGLE WALL STEEL

Fields, Vanessa

From:

Meador, Tasha

Sent:

Monday, August 16, 2010 2 09 PM

To:

Fields, Vanessa

Subject:

FW: Request for Review of Closure Plan - Rosa 148B, 30, 9B, and 36B

Tasha Meador

EH&S Coordinator Williams Exploration & Production 721 S Main Aztec, NM

Office: 505-634-4200 Direct:505-634-4241 Fax: 505-634-4205

tasha.meador@williams.com

From: Lane, Myke

Sent: Wednesday, February 24, 2010 3:40 PM

To: Jones, Brad A., EMNRD

Cc: Powell, Brandon, EMNRD; Meador, Tasha; Basye, Matt

Subject: Request for Review of Closure Plan - Rosa 148B, 30, 9B, and 36B

Brad.

We need to take the following below grade tanks out of service, and we would like to close this existing BGTs We request your review to allow closure.

_	WELLSITE	API	FMT	SEC	TWN	RNG
I	Rosa #030	3003925570	BLANCO MV	120	31N	06W
a	Rosa #148B	_3003926985_	BLANCO MV	2P	31N	06W
í	Rosa #009B	3003927042	BLANCO MV	11E	31N	06W
f	Rosa #036B	3003926600	BLANCO MV	11J	31N '	06W
F	Rosa #009	3003907975	BLANCO MV	11K	31N	06W

Please contact me if there are any problems or you request additional information. Thanks for your consideration

Michael K. (Myke) Lane, PE EH&S Team Leader - San Juan Basın Operations District I
1625 N French Dr , Hobbs, NM 88240
District II
1301 W Grand Avenue, Artesia, NM 88210
District III
1000 Rio Biazos Road, Aztec, NM 87410
District IV District IV 1220 S St Francis Dr , Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

Form C-141

Revised October 10, 2003

Santa Fe, NM 87505

			Rele	ease Notific	ation	and Co	rrective A	ction				
						OPERA	ΓOR		Initia	al Report		Final Report
Name of Co				CTION, LLC			Vanessa Fields					
Address		P.O. BOX 6- Rosa Unit#		EC, NM 87410		Telephone No. (505) 634-4209						
Facility Nan	ie	Rosa Unit#	148B			Facility Type Well Site						
Surface Own	ner: Fede	ral		Mineral C)wner:				Lease N	No.		
				LOCA	TION	OF REI	LEASE					
Unit Letter	Section	Township	Range	Feet from the	North/	South Line	Feet from the	East/W	est Line	County		
P	02	31N	06W									
		Lati	tude	36.9221502N	Ţ	ongitude	-107 426820)1W				
		2411		_		_						
Type of Pales	sa Na Pal	ease Occurred		NAT	URE	OF REL			Volume I	Recovered		
Source of Rel		ease Occurred					lour of Occurrence			Hour of Dis	covery	
Was Immedia	ite Notice					If YES, To	Whom?	'	•			
			Yes _	No 🛛 Not Ro	equired							
By Whom?		1 10				Date and H		1 117 .				
Was a Watero	course Rea		Yes 🗵	No		If YES, VO	olume Impacting t	ine water	course			
If a Watercou	rse was In					L						
ii a watereou	ise was in	ipacica, Desci	ioe i uniy	14/1								
		lem and Reme	dial Action	n Taken *	,					-		
No action req	uıred											
D 11 4	A CC 1	1.01	A	<u> </u>								
Describe Area	a Affected	and Cleanup	Action Tak	ten *								
N/A												
I hereby certi	fy that the	information g	ven above	is true and comp	lete to th	ne best of my	knowledge and u	ınderstand	d that pur	suant to NM	OCD ru	iles and
				nd/or file certain r								
				ce of a C-141 report reporting and report investigate and report and report in the contract of								
or the environ	iment In	addition, NMC	CD accep	tance of a C-141								
federal, state,	or local la	ws and/or regi	ilations					~===				
/)		Y_)			OIL CON	SERV	ATION	DIVISIO	<u>)N</u>	
Signature \	$-\infty$	2020	<u> </u>	_عو	<u>ر</u>							
Printed Name	· Vaneco	a Fields			4	Approved by District Supervisor						
T Tillica Ivallic	vaness.	a i icias										
Title: EH&S	Coordinat	or				Approval Date			Expiration Date			
E-mail Addre	ss Vanes	sa fields@will	iams com		,	Conditions of Approval			A 1 *			
*		- 0 .7					11			Attached	Ш	
Date 10-21	-10		Phon	e· (505) 634-420	19							

^{*} Attach Additional Sheets If Necessary

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Testing Wethods	Closure Limits (mg//kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

⁽¹⁾ Method modified for solid waste.

- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.I NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

⁽²⁾ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Fiberglass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

Operations and Maintenance Plan

- 1. WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin-Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
 - a. All discharges will be shut off to the pit.
 - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
 - c. WPX will notify and report to NMOCD as follows:
 - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
 - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15.3.116.B (1)(d).
 - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3. Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Below-Grade Tank Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

General Plan Requirements:


- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed. of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.


Table 1: Closure Criteria for BGTs

Components	Jesting Wethods! 21	Closure/limits (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 8015 M(Full Range)*	100
	or Method 418.1	
Chlorides	EPA SW-846 Method 300.1	250


^{*} Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-approved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

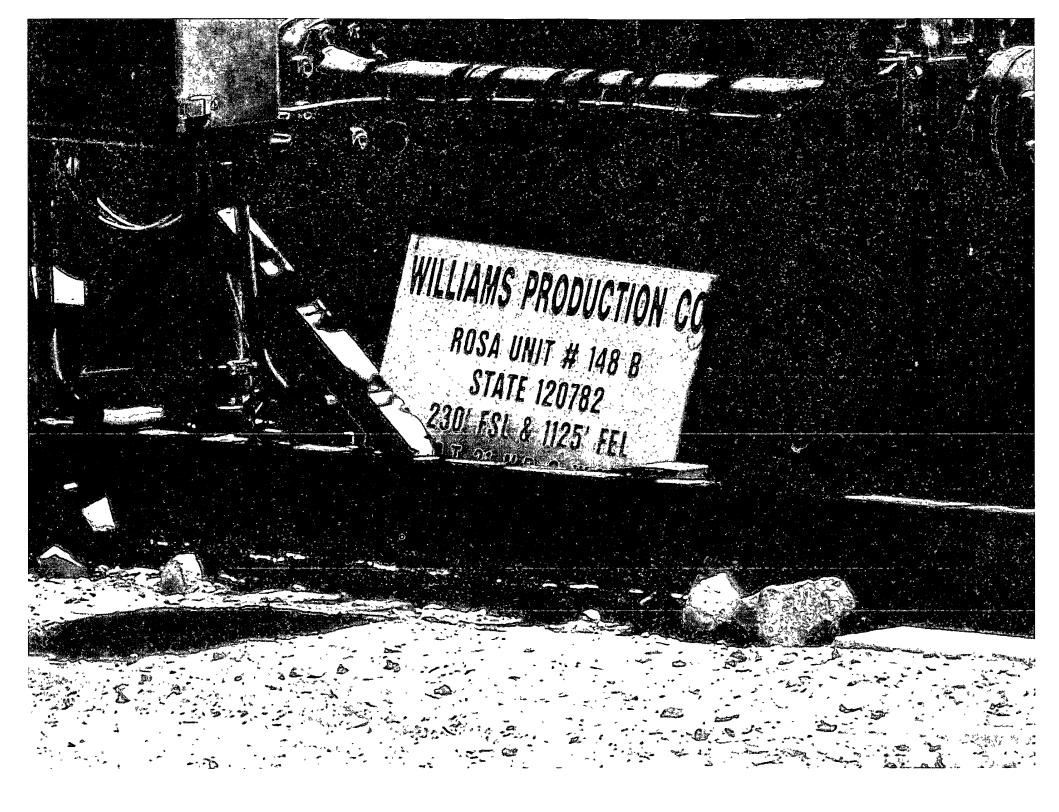

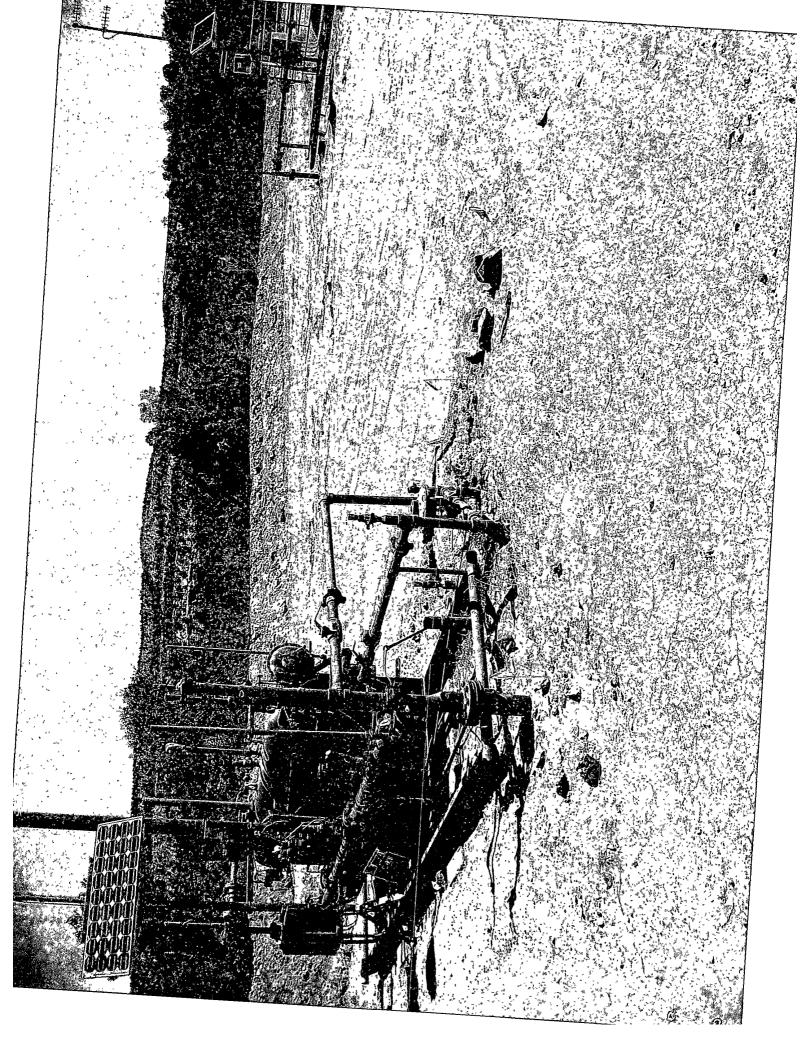

Williams Production Rosa 148 B Mesa Verde Sec 2 T 31 N R 6 W

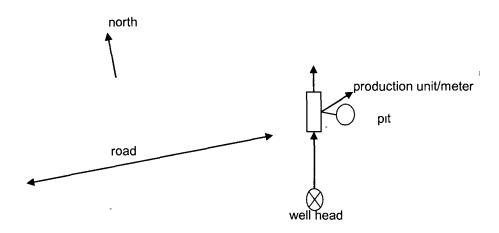

						Liner	eak detec	k Detection	Pit	
Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Banded Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs needed
	ROSA UNIT					Banded				
Aug-08	#148B COM	04-65	MV / DK	FIBERGLASS	BGT	Plastic Liner	Yes	.25"	9"	
Sep-08	ROSA UNIT #148B COM	04-65	MV / DK	FIBERGLASS	BGT	Banded Plastic Liner	Yes	0"	16"	
Oct-08	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes	0"	7"	
Nov-08	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	yes	0"	15"	
Dec-08	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes	0"	23"	
Jan-09	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes	0	30.5	
Feb-09	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes	0	47.5	
Mar-09	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes			
Apr-09	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes	0	14	
6/8/2009	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes	Oin	20in	48in Pit
7/6/2009	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes	Oin	35in	
8/26/2009	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes		30"	

						Liner	eak detec	k Detection	Pit	
Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Banded Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs needed
Date	ROSA UNIT	10011				Banded				
9/1/2009	#148B	04-65	Mesa Verde	FIBERGLASS	BGT	Plastic Liner	Yes			
10/5/2009	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes		38"	
11/12/2009	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes		46"	
12/28/2009	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes		60"	
1/12/2010	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes		62"	
2/17/2010	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes		15"	
3/18/2010	ROSA UNIT #148B	04-65	Mesa Verde	FIBERGLASS	BGT	Banded Plastic Liner	Yes	0"	37"	



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	Williams	Drainet #	04108-0136
Cilent.	vviiilams	Project #:	04106-0136
Sample ID:	R 148B	Date Reported:	05-03-10
Laboratory Number:	53910	Date Sampled:	04-23-10
Chain of Custody No:	9191	Date Received:	04-28-10
Sample Matrix:	Soil	Date Extracted:	04-29-10
Preservative:		Date Analyzed:	04-30-10
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	0.2

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Rosa 148B

Amalyst Juli

Mostre Mice ter



EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Quality Assurance Report

Client:	QA/QC		Project #:		N/A
Sample ID:	04-30-10 QA/	QC	Date Reported:		05-03-10
Laboratory Number:	53882		Date Sampled:		N/A
Sample Matrix:	Methylene Chlo	ride	Date Received:		N/A
Preservative:	N/A		Date Analyzed:		04-30-10
Condition:	N/A		Analysis Requested:		TPH
	. Jegali Date	E LECAL RIF	G-ICALIRIES	% Ofference)⊫ ≪Accept⊪Rårige
Gasoline Range C5 - C10	05-07-07	1.1089E+003	1.1093E+003	0.04%	0 - 15%
Dienal Pango C10 - C28	05-07-07	1.02/6E±003	1 0250E±003	0.04%	0 - 15%

Diesel Range 010 020	00-07-07	1.02-102-000	1.02002.000	0.0470	•
	2008 - 000 / 2011 to be with the Line 10 / 2011 10 / 2011	Production of the Control of the Control			d12
Blank@one/(mg/l=_mg/kg))		(So)(GeinlieliOr		Detection Limit	
Gasoline Range C5 - C10		ND		0.2	
Dional Pages C10 C20		AUD		0.4	

Gasoline Range C5 - C10	ND	0.2
Diesel Range C10 - C28	ND	0.1
Total Petroleum Hydrocarbons	ND	0.2

Duolicate Conc. (molkle)	Sample	Digollea(e)	% Eliterence	Accept Fange
Gasoline Range C5 - C10	ND	ND	0.0%	0 - 30%
Diesel Range C10 - C28	ND	ND	0.0%	0 - 30%

Sjalke Conc. (mc/k(g))	Sample	Spike Added	Spiké Result	% Recovery	Accept Range
Gasoline Range C5 - C10	ND	250	246	98.4%	75 - 125%
Diesel Range C10 - C28	ND	250	251	100%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 53882 and 53908 - 53912.

Analyst

Review



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Williams	Project #:	04108-0136
Sample ID:	R 148B	Date Reported:	05-03-10
Laboratory Number:	53910	Date Sampled:	04-23-10
Chain of Custody:	9191	Date Received:	04-28-10
Sample Matrix:	Soil	Date Analyzed:	04-30-10
Preservative:		Date Extracted:	04-29-10
Condition:	Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Benzene	ND	0.9	
Toluene	ND	1.0	
Ethylbenzene	ND	1.0	
p,m-Xylene	ND	1.2	
o-Xylene	ND	0.9	
Total BTEX	ND		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	99.0 %
	1,4-difluorobenzene	95.0 %
	Bromochlorobenzene	97.2 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Rosa 148B

Marda Juli.
Ahalyst

Review Chicotas



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A	Project #:	N/A
Sample ID:	04-30-BTX QA/QC	Date Reported:	05-03-10
Laboratory Number:	53882	Date Sampled:	N/A
Sample Matrix:	Soil	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	04-30-10
Condition:	N/A	Analysis:	BTEX

Callbration and Patection Limits (Ug/L)	UGHREG	O GaliRF	#WDIffs.co 16 (0.2 1/5)%	rce Blenk al@one	Oetect
Benzene	1.9068E+006	1,9107E+006	0.2%	ND	0.1
Toluene	1.2828E+006	1.2854E+006	0.2%	ND	0.1
Ethylbenzene	1.0373E+006	1.0394E+006	0.2%	ND	0.1
p,m-Xylene	2.1884E+006	2.1928E+006	0.2%	ND	0.1
o-Xylene	8.6369E+005	8.6542E+005	0.2%	ND	0.1

Duplicate Conos (ug/kg)	Sample - Di	ijica (e 👬	9/6DIff	AGGETEN REINIGE	ableter allmit
Benzene	ND	ND	0.0%	0 - 30%	0.9
Toluene	ND	ND	0.0%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	ND	ND	0.0%	0 - 30%	1.2
o-Xylene	ND	ND	0.0%	0 - 30%	0.9

Spike@onc (ug/kg)	Sample Amo	unt Spiked - Spik	ed Sample	% Recovery	Accept Range
Benzene	ND	50.0	50.3	101%	39 - 150
Toluene	ND	50.0	48.1	96.1%	46 - 148
Ethylbenzene	ND	50.0	49.1	98.1%	32 - 160
p,m-Xylene	ND	100	99.7	99.7%	46 - 148
o-Xylene	ND	50.0	50.9	102%	46 - 148

ND - Parameter not detected at the stated detection limit.

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

QA/QC for Samples 53826 - 53829, 53882 and 53908 - 53912. Comments:

EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	Williams	Project #:	04108-0136
Sample ID:	Rosa 148B	Date Reported:	05-03-10
Laboratory Number:	53910	Date Sampled:	04-23-10
Chain of Custody No:	9191	Date Received:	04-28-10
Sample Matrix:	Soil	Date Extracted:	04-30-10
Preservative:		Date Analyzed:	04-30-10
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

54.1

13.5

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Rosa 148B



EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Client:

QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

04-30-10

Laboratory Number:

04-30-TPH,QA/QC 53877 Freon-113

Date Sampled:

N/A 04-30-10

Sample Matrix: Preservative:

N/A

Date Analyzed: **Date Extracted:**

Condition:

N/A

Analysis Needed:

04-30-10 TPH

Calibration I-Cal Date C-Cal Date

I-Cal RF: C-Cal RF: % Difference Accept Range

04/22/2010 04-30-10

1,690

1,790

5.9%

+/- 10%

Blank Conc. (mg/Kg)

Concentration

Defection Limit

TPH

TPH

ND

13.5

Duplicate Conc. (mg/Kg)

*Sample

Duplicate % Difference Accept Range

TPH

15.6

18.9

21.2%

+/- 30%

Spike Conc. (mg/Kg) Sample Spike Added Spike Result % Recovery Accept Range

15.6

2,000

1,890

93.8%

80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 53906 - 53912 and 53877 - 53878.

Ph /505\632-0615 Fr /800\362-1879 Fy /505\ 632-1865

lah@envirotech-inc.com envirotech-inc.com



Chloride

Client:

Williams

Project #:

04108-0136

Sample ID: Lab ID#:

R 148B 53910

Date Reported:

05-05-10

Sample Matrix:

Soil

Date Sampled:

04-23-10

Preservative:

Date Received:

04-28-10

Condition:

Intact

Date Analyzed: Chain of Custody: 05-05-10 9191

Parameter

Concentration (mg/Kg)

Total Chloride

15

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

Rosa 148B

CHAIN OF CUSTODY RECORD

Client: Project Name / Location: Vosa)						3	- ,,	ANALYSIS / PARAMETERS															
Client Address:	Cin	<u>. </u>	Sampler Name:	Bas	ye				TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	als	۵		ē.								**
Client Phone No.: 134-4219			Client No.: 04						etpoc	/lethc	ethoc	RCRA 8 Metals	Cation / Anion		TCLP with H/P		TPH (418.1)	필				Sample Cool	Sample Intact
Sample No./	Sample	Sample	0006		ample	No./Volume	Preser	vative	Š	×	3	3A 8	ر ا		d. ⊗	_	4	CHLORIDE				ple	eldi
Identification	Date	Time	Lab No.	1	Matrix	of Containers		_	臣	BTE	Š	R 2	Cati	쮼	1 1 2	PAH	효	동				San	San
RILB	HB3110	1500	53910	Soil Solid	Sludge Aqueous	1-402			X	X							X	r				N	4
				Soil Solid	Sludge Aqueous	0													•				
				Soil Solid	Sludge Aqueous	:																	
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous					·													
				Soil Solid	Sludge Aqueous																		
Relinquished by: (Signature)	ature)				Date H2010	Time 2:30	Re	ceive	d by:	(Sign	at ure)	\supseteq								1 /	ate B/U	1	me ろり)
Relinquished by: (Signi	ature)		***			(2):	Re	ceive	d by:	(Sign	ature)									112	gu.		<u></u>
Relinquished by: (Signa	ature)						Re	ceive	d by:	(Signa	ature)	ı											
							•															<u> </u>	



5796 US Highway 64 • Farmington, NM 87401 • 505-632-0615 • lab@envirotech-inc.com

TM: 06 10 2 Sem Nuan Caunt 78 Caunty Chad 3140 3 Astron ING: 67410 Ph: 1505 133-1181 Organia. Trekerksiczeren

Costomen Name WilliamsPPC WICKIAMS PRODUCTI Carrier "AUGIL VACOHM DILFIELD SERVICES, Troket Date 05/21/2010 Talment Type Seredit Account Manual Micketts Véhicle# Çòngairer Hauding Ticket Checht RECEIVED Billing # Gen EPA (D Kaut e State Waste Bode Manufest JUN 0 1 2010 Destination 🕄 PP ... gintiles. WPX 05/21/2010/07:05:46 38920 16 ไก้ยอยก่อ 301 Tare - MHORGAN - . Dut .05/21/2010:07:43:37 ... Dut Bound 302 MHORGAN! 6720 96 Mèt

Comments - 9 115

, '	Product		we go o	LDY	, UON S	Rate Vij		"Amuunt	Origin 🦠
, "	JI. MLY	/-//5W/Cobs	e-yyde:	ivo se	00 Yeiros	5.51.2	15, jg. 55	11,746,28	PIOARRIEP
,									

Mavitis Cheneej Halio 17-12 Jahlia us Producijus

10/11/a 3 production fosc 22,22A,36B,36, 9,9B(148 B)149B,1816

Total 133. Total Dicket

Tons

\$9.55

Driver's Siznation

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Report

Well: (Rosa Unit# 148B)
API No: 30-03926985

Location: P-S02-T31N-R06W, NMPM



In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A) (5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure
 under these conditions will be initiated within 60 days of cessation of the BGT's
 operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current landowner of record. The landowner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the landowner of record will be notified as soon as practical.

Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated 5/4/09.

- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)

<u>Aztec District office was notified of Williams E&P intent to close on (02/24/2010). Email</u> attached.

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shut-in until the rerouting is completed.

<u>Williams closed the BGT used by the Rosa Unit#148B separator and piped all liquids to the Produced Water Storage Tank.</u>

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled to the Rosa Unit disposal wells listed.</u>

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberalass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.

 The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Testing Methods	Closure Limits (mg/Kg)	Sample Results (mg/Kg)
Benzene -	EPA SW-846 Method 8021B or 8260B	0.2	ND
BTEX	EPA SW-846 Method 8021B or 8260B	50	ND
TPH	EPA SW-846 Method 418.1(1)	100	ND
Chlorides	EPA SW-846 Method 300.1(1)	250(2)	15

⁽¹⁾ Method modified for solid waste.

9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

No release detected.

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pit area backfilled with clean earthen material following sample results. No contaminated soil taken off site.</u> Backfill compacted to avoid settling and pit area remains in use for production operations.

 $^{^{(2)}}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that does not meet the revegetation requirements of 19.15.17.13., I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.

<u>Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.</u>

12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

See above notes.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical
 Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation