<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 District II 811 S. First St., Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-144 Revised June 6, 2013

For temporary pits, below-grade tanks, and multi-well fluid management pits, submit to the appropriate NMOCD District Office.

For permanent pits submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

Pit Below-Grade Tank or

Proposed Alternative Method Permit or Closure Plan Application
All Colle Bull miles of
Type of action: Below grade tank registration OIL CONS. DIV DIST. 3
39-26704 Permit of a pit or proposed alternative method Closure of a pit below-grade tank or proposed alternative method
Sclosure of a pit, below-grade tank, or proposed alternative method ☐ Modification to an existing permit/or registration ☐ Modification to an existing permit/or registration
Closure plan only submitted for an existing permitted or non-permitted pit, below-grade tank,
or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
1.
Operator: ConocoPhillips Company OGRID #: 217817
Address: PO BOX 4289, Farmington, NM 87499
Facility or well name: San Juan 29-6 Unit 15C
API Number:OCD Permit Number:
U/L or Qtr/Qtr M (SWSW) Section 02 Township 29N Range 06W County: Rio Arriba
Center of Proposed Design: Latitude 36.7507286°N Longitude -107.4399033 °W NAD: ⊠1927 □ 1983
Surface Owner: Federal State Private Tribal Trust or Indian Allotment
2.
Pit: Subsection F, G or J of 19.15.17.11 NMAC
Temporary: Drilling Workover
☐ Permanent ☐ Emergency ☐ Cavitation ☐ P&A ☐ Multi-Well Fluid Management Low Chloride Drilling Fluid ☐ yes ☐ no
Lined Unlined Liner type: Thicknessmil LLDPE HDPE PVC Other
String Dainforced
String-Reinforced Liner Searner Wolded Featon: Other
☐ String-Reinforced Liner Seams: ☐ Welded ☐ Factory ☐ Other Volume:bbl Dimensions: L x W x D
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3.
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3.
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40 bbl Type of fluid: Produced Water
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40 bbl Type of fluid: Produced Water Tank Construction material: Metal
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40 bbl Type of fluid: Produced Water Tank Construction material: Metal Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off
Liner Seams:
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40 bbl Type of fluid: Produced Water Tank Construction material: Metal Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off Visible sidewalls and liner Visible sidewalls only Other Liner type: Thickness 45 mil HDPE PVC Other LLDPE
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40 bbl Type of fluid: Produced Water Tank Construction material: Metal Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off Visible sidewalls and liner Visible sidewalls only Other Liner type: Thickness 45 mil HDPE PVC Other LLDPE
Liner Seams:
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L_x W_x D_ 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40 bbl Type of fluid: Produced Water Tank Construction material: Metal Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off Visible sidewalls and liner Visible sidewalls only Other Liner type: Thickness 45 mil HDPE PVC Other LLDPE 4. Alternative Method: Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40 bbl Type of fluid: Produced Water Tank Construction material: Metal Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off Visible sidewalls and liner Visible sidewalls only Other Liner type: Thickness 45 mil HDPE PVC Other LLDPE 4. Alternative Method: Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval. 5. Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40 bbl Type of fluid: Produced Water Tank Construction material: Metal Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off Visible sidewalls and liner Visible sidewalls only Other Liner type: Thickness 45 mil HDPE PVC Other LLDPE 4. Alternative Method: Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval. 5. Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks) Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institution or church)
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D 3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 40

6.	
Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks)	
Screen Netting Other_	
☐ Monthly inspections (If netting or screening is not physically feasible)	
7.	
Signs: Subsection C of 19.15.17.11 NMAC	
12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
☐ Signed in compliance with 19.15.16.8 NMAC	
8. Variances and Exceptions: Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance. Please check a box if one or more of the following is requested, if not leave blank: Variance(s): Requests must be submitted to the appropriate division district for consideration of approval. Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	
Siting Criteria (regarding permitting): 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accommaterial are provided below. Siting criteria does not apply to drying pads or above-grade tanks.	eptable source
General siting	
Ground water is less than 25 feet below the bottom of a low chloride temporary pit or below-grade tank. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☑ NA
Ground water is less than 50 feet below the bottom of a Temporary pit, permanent pit, or Multi-Well Fluid Management pit. NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended. (Does not apply to below grade tanks) - Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within the area overlying a subsurface mine. (Does not apply to below grade tanks) - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
 Within an unstable area. (Does not apply to below grade tanks) Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map 	☐ Yes ☐ No
Within a 100-year floodplain. (Does not apply to below grade tanks) - FEMA map	☐ Yes ☐ No
Below Grade Tanks	
Within 100 feet of a continuously flowing watercourse, significant watercourse, lake bed, sinkhole, wetland or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ⊠ No
Within 200 horizontal feet of a spring or a fresh water well used for public or livestock consumption;. - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ⊠ No
Temporary Pit using Low Chloride Drilling Fluid (maximum chloride content 15,000 mg/liter)	
Within 100 feet of a continuously flowing watercourse, or any other significant watercourse or within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). (Applies to low chloride temporary pits.) - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a occupied permanent residence, school, hospital, institution, or church in existence at the time of initial application. Visual inspection (certification) of the proposed site: Aerial photo: Satellite image.	☐ Yes ☐ No
 Visual inspection (certification) of the proposed site; Aerial photo; Satellite image Within 200 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes, or 300feet of any other fresh water well or spring, in existence at the time of the initial application. NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site 	☐ Yes ☐ No

Within 100 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Temporary Pit Non-low chloride drilling fluid	
Within 300 feet of a continuously flowing watercourse, or any other significant watercourse, or within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 500 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes, or 1000 feet of any other fresh water well or spring, in the existence at the time of the initial application; - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Permanent Pit or Multi-Well Fluid Management Pit	
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 500 horizontal feet of a spring or a fresh water well used for domestic or stock watering purposes, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 Natructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the do attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19. and 19.15.17.13 NMAC	NMAC 15.17.9 NMAC
Previously Approved Design (attach copy of design) API Number: or Permit Number:	
Multi-Well Fluid Management Pit Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the docattached. Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC A List of wells with approved application for permit to drill associated with the pit. Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 and 19.15.17.13 NMAC Hydrogeologic Data - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Previously Approved Design (attach copy of design) API Number:	

12.	
THE STATE OF THE S	documents are
attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC	
Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC	
Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC	Each of the following items must be attached to the application. Please Indicate, by a check mark in the box, that the documents are eologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.19 NMAC Differia Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.11 NMAC Differia Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.11 NMAC Detection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Designations and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC Designations and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC Designations and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.12 NMAC Designations and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.12 NMAC Designation of the Designation of the Designation of 19.15.17.13 NMAC Designation of the Designation of the Designation of 19.15.17.13 NMAC Designation of the Designation of 19.15.17.13 NMAC Designation of the Designation of 19.15.17.13 NMAC and 19.15.17.13 NMAC Designation of the Designation of 19.15.17.13 NMAC and 19.15.17.13 NMAC Designation of the Designation of 19.15.17.13 NMAC and 19.15.17.13 NMAC Designation of the Designation of 19.15.17.13 NMAC and 19.15.17.
Quality Control/Quality Assurance Construction and Installation Plan	
Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC	
Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC	
☐ Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan	
Emergency Response Plan	
Erosion Control Plan	
Constitution and appropriate requirements of Subsection Configuration and 19719-17719 Titule	
Proposed Closure: 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan. Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Multi-well F	luid Management Pit
Proposed Closure Method: Waste Excavation and Removal	
☐ In-place Burial ☐ On-site Trench Burial	
Alternative Closure Method	
14.	
Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.13 NMAC Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC	
15.	
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable sour provided below. Requests regarding changes to certain siting criteria require justifications and/or demonstrations of equivalency. I 19.15.17.10 NMAC for guidance.	
Ground water is less than 25 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	
Ground water is between 25-50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	
Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	
Within 100 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	Yes No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 300 horizontal feet of a private, domestic fresh water well or spring used for domestic or stock watering purposes, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database; Visual inspection (certification) of the proposed site	Yes No
Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within 300 feet of a wetland. US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	Yes No

adopted pursuant to NMSA 1978, Section 3-27-3, as amended. Written confirmation or verification from the municipality; Written approval obtaine	ed from the municipality Yes No
Within the area overlying a subsurface mine. Written confirmation or verification or map from the NM EMNRD-Mining and Min	eral Division Yes No
Within an unstable area. Engineering measures incorporated into the design; NM Bureau of Geology & Mine	
Society; Topographic map	☐ Yes ☐ No
Within a 100-year floodplain. FEMA map	☐ Yes ☐ No
o. On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following the contractions of the following the contraction of the contraction of the following the contraction of the contraction of the following the contraction of the contract	ng items must be attached to the closure plan. Please indicate
by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements	of 19 15 17 10 NMAC
Proof of Surface Owner Notice - based upon the appropriate requirements of Subsecti	
Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate	e requirements of Subsection K of 19.15.17.11 NMAC
Construction/Design Plan of Temporary Plt (for in-place burial of a drying pad) - base Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 N	
Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements	s of 19.15.17.13 NMAC
Waste Material Sampling Plan - based upon the appropriate requirements of 19.15.17.	.13 NMAC
☐ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttin☐ Soil Cover Design - based upon the appropriate requirements of Subsection H of 19.1	
Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.1	15.17.13 NMAC
Site Reclamation Plan - based upon the appropriate requirements of Subsection H of	19,15,17,13 NMAC
17. Operator Application Certification:	
I hereby certify that the information submitted with this application is true, accurate and cor	mplete to the best of my knowledge and belief.
Name (Print): Titl	le:
Signature:	Date:
GI ELIMAN W.	5-PM
e-mail address:	ephone:
18. OCD Approval: Permit Application (including closure plan) Closure Plan (only)	T con c City
OCD Approval: Permit Application (including closure plan) In Closure man (analy)	~ / /
OCD Representative Signature:	Approved Bate: 12/8/15
- Telia multo	
Title: ENV. 10 Mental Spec (OCD Pe	rmit Number:
19. Closure Report (required within 60 days of closure completion): 19.15.17.13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to impleme The closure report is required to be submitted to the division within 60 days of the comple section of the form until an approved closure plan has been obtained and the closure active.	tion of the closure activities. Please do not complete this vities have been completed.
⊠ Cio	osure Completion Date: 7/10/15
20. Closure Method:	
	re Method Waste Removal (Closed-loop systems only)
21. Closure Report Attachment Checklist: Instructions: Each of the following items must	he attached to the closure report. Please indicate by a check
mark in the box, that the documents are attached.	na mounting on our produces a collection is serious sessionesses als to present
□ Proof of Closure Notice (surface owner and division)	
Proof of Deed Notice (required for on-site closure for private land only)	
☐ Plot Plan (for on-site closures and temporary pits) ☐ Confirmation Sampling Analytical Results (if applicable)	
Waste Material Sampling Analytical Results (required for on-site closure)	
☐ Disposal Facility Name and Permit Number	
57 0 21 D 4 200 - 4 C - Y - 11 - 12 - 1	
Soil Backfilling and Cover Installation	
Re-vegetation Application Rates and Seeding Technique	
	•W NAD: □1927 □ 1983

Operator Closure Certification:

I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.

Name (Print): Crystal Walker Title: Regulatory Coordinator

Signature: Date: 10/14/2015

e-mail address: crystal.walker@cop.com Telephone: (505) 326-9837

ConocoPhillips Company BGT Size Clarification

ConocoPhillips requests to clarify the approved C-144 BGT permit for the San Juan 29-6 Unit 15C indicated the BGT is 120bbls. Upon closure it was discovered the actual size of the BGT is 40bbls.

Burlington Resources Oil Gas Company, LP San Juan Basin Below Grade Tank Closure Report (Without Reclamation)

Lease Name: San Juan 29-6 Unit 15C

API No.: 30-039-26704

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure of the below-grade tank referenced above. All proper documentation regarding closure activities is being included with the C-144.

General Plan:

- 1. BR shall close a below-grade tank within 60 days of cessation of operations per Subsection G.4 of 19.15.17.13 NMAC. This will include a) below-grade tanks that do not meet the requirements of Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC or is not included in Paragraph (5) of Subsection I of 19.15.17.11 NMAC within five years, if not retrofitted to comply with Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC; b) an earlier date that the division requires because of imminent danger to fresh water, public health or the environment. For any closure, BR will file the C144 Closure Report as required.
- 2. The below-grade tank referenced above was permitted and closed within 60 days of cessation of the below-grade tanks operation.
- 3. BR shall remove liquids and sludge from a below-grade tank prior to implementing a closure method and shall dispose of the liquids and sludge in a division-approved facility. The facilities to be used will be Basin Disposal (Permit #NM-01-005), JFJ Landfarm % Industrial Ecosystem Inc. (Permit #NM-01-0010B) and Envirotech Land Farm (Permit #NM-01-011). The liner after being cleaned well (Subsection D, Paragraph 1, Subparagraph (m) of 19.15.9.712 NMAC) will be disposed of at the San Juan County Regional Landfill located on CR 3100.
 - All recovered liquids were disposed of at Basin Disposal (Permit #NM-01-005) and any sludge or soil required to be removed to facilitate closure was hauled to Envirotech Land Farm (Permit #NM-01-011) and JFJ Landfarm % IEI (Permit #NM-01-0010B). The liner was cleaned per Subsection D, Paragraph 1, Subparagraph (m) of 19.15.9.712 NMAC was disposed of at the San Juan County Regional Landfill located on CR 3100.
- BR Will receive prior approval to remove the below-grade tank and dispose of it in a division-approved facility or recycle, reuse, or reclaim it in a manner that the appropriate division district office approves.

The below-grade tank was disposed of in a division-approved manner.

5. If there is any on-site equipment associated with a below-grade tank, then BR shall remove the equipment, unless the equipment is required for some other purpose.

All on-site equipment associated with the below-grade tank was removed.

6. BR will test the soils beneath the below-grade tank to determine whether a release has occurred. COPC shall collect, at a minimum, a five point, composite sample; collect individual grab samples from any area that is wet, discolored or showing other evidence of a release; and analyzed for the constituents listed in Table I of 19.15.17.13 NMAC. COPC shall notify the division of its results on form C-141.

7. A five point composite sample was taken of the below-grade tank using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached).

Components	Tests Method	Limit (mg/kg) 0.2		
Benzene	EPA SW-846 8021B or 8260B			
BTEX	EPA SW-846 8021B or 8260B	50		
TPH	EPA SW-846 418.1	100		
Chlorides	EPA 300.1	250		

8. If BR or the division determines that a release has occurred, then BR shall comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC, as appropriate.

A release was not determined for the above referenced well.

If the sampling program demonstrates that a release has not occurred or that any release does not exceed the
concentrations specified in Table I of 19.15.17.13 NMAC, then BR shall backfill the excavation with compacted,
non-waste containing, earthen material; construct a division-prescribed soil cover; recontour and re-vegetate the
site.

The below-grade tank area passed all requirements of Paragraph (4) of Subsection E of 19.15.17.13 NMAC and was backfilled with compacted, non-waste containing, earthen material.

- 10. Notice of Closure will be given prior to closure to the Aztec Division office between 72 hours and one week via email or verbally. The notification of closure will include the following:
 - i. Operator's name
 - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.

Closure notification attached.

11. The surface owner shall be notified of BR's closing of the below-grade tank 72 hours, but not more than one week, prior to closure as per the approved closure plan via certified mail, return receipt requested.

The closure process notification to the landowner was sent via email. (See Attached) (Well located on Federal Land, certified mail is not required for Federal Land per BLM/OCD MOU.)

12. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final re-contour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The below-grade tank was removed due to integrity issues and replaced. No reclamation work will be done on this location.

The below-grade tank area will be re-contoured to match fit, shape, line, form and texture of the surrounding area. Re-shaping, including drainage control, to prevent ponding and erosion. Natural drainages were unimpeded and water bars and/or silt traps were placed in areas where needed to prevent erosion on a large scale. Final recontour has a uniform appearance with smooth surface, fitting the natural landscape.

13. BR Shall seed the disturbed areas the first favorable growing season following closure of a below-grade tank. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM stipulated seed mixes will used on federally regulated lands and division-approved seed mixtures (administratively approved if required) will be utilized on all State or private lands. A uniform vegetative cover has

been established that reflects a life-form ratio of plus or minus fifty percent (50%) of pre- disturbance levels and a total percent plant cover of at least seventy percent (70%) of pre-disturbance levels, excluding noxious weeds. If alternate seed mix is required by the state, private owner or tribe, it will be implemented with administrative approval if needed. COPC will repeat seeding or planting will be continued until successful vegetative growth occurs.

The below-grade tank was removed due to integrity issues and replaced. No reclamation work will be done on this location.

Provision 13 will be accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

14. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material, with chloride concentrations less than 600 mg/kg as analyzed by EPA Method 300.0, to establish vegetation at the site, or the background thickness of topsoil, whichever is greater.

The below-grade tank was removed due to integrity issues and replaced. No reclamation work will be done on this location.

The below-grade tank area was backfilled and more than four feet of cover was achieved and the cover included one foot of suitable material to establish vegetation at the site.

- 15. All closure activities will include proper documentation and be available for review upon request and will be submitted to OCD within 60 days of closure of the below-grade tank. Closure report will be filed on C-144 and incorporate the following:
 - Soil Backfilling and Cover Installation (See Report)
 - Re-vegetation application rates and seeding techniques (See Report)
 - Photo documentation of the site reclamation (Included as an attachment)
 - Confirmation Sampling Results (Included as an attachment)
 - Proof of closure notice (Included as an attachment)

Walker, Crystal

From: White, Arleen R

Sent: Wednesday, July 01, 2015 9:17 AM

To: Cory Smith

Cc: Brandon Powell; 'Mark Kelly'; Marquez, Michael P; SJBU E-Team; GRP:SJBU Regulatory

Subject: San Juan 29-6 Unit 15C - 72 Hour Notice of BGT Closure

Subject: 72 Hour notice of BGT Closure for the San Juan 29-6 Unit 15C

Anticipated Start Date: Monday, July 06, 2015 @ approximately 10:00am - 3rd parties environmental will be on location between 12:00noon - 1:00 pm to sample.

The subject well has a below-grade tank that will begin the closure process between 72 hours and one week from this notification. Please contact me at any time if you have any questions or concerns.

Well Name: San Juan 29-6 Unit 15C

API#: 30-039-26704

Location: UL M, Sec.02, T29N, R6W

Footages: 1200' FSL & 246' FWL

Operator: COP Surface Owner: BLM

We have received the approved Closure Plan from Santa Fe and it is posted on OCD online.

ConocoPhillips

Arleen White Staff Regulatory Technician San Juan Business Unit Ph: (505)326-9517

Cell: (505) 215-3985

arleen.r.white@conocophillips.com

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 District II 1301 W. Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Submit 1 Copy to appropriate District Office to accordance with 19.15.29 NMAC.

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-141 Revised August 8, 2011

						OPERA'	LOB	Г	Initi	al Report	\boxtimes	Final Rep
Name of Co	omnany Co	nocoPhillins	Compan	v			ystal Walker			ai Keport		rillai Kep
Address 3401 East 30 th St, Farmington, NM Facility Name: San Juan 29-6 Unit 15C						Telephone No.(505) 326-9837						
						Facility Type: Gas Well						
Surface Owner State Mineral Owner LOCATIO						API No.30-039-26704						
Facility Name: San Juan 29-6 Unit 15C Surface Owner State LOC Unit Letter Section Township Range Feet from the M 2 29N 6W 1200 Latitude 36. NA Type of Release Source of Release Was Immediate Notice Given? Yes No Not By Whom? Was a Watercourse Reached? Yes No If a Watercourse was Impacted, Describe Fully.*						NOFDE	FASE		11			
Unit Letter	Section	Township	Range			South Line	Feet from the	East/W	est Line	County		
						South	246		est	Rio Arri	ba	
							e <u>-107.4399033</u>	3				
Type of Rele	ease			INA	TURE	Volume of			Volume l	Recovered		
							Hour of Occurren			Hour of Di	scovery	
									1.04			
Was Immedi	ate Notice G		Yes [No Not	Required	If YES, To	Whom?					
						Date and I			200			
Was a Water	course Reac		Yes 🛛 1	No		If YES, Vo	olume Impacting	the Water	rcourse.			
N/A		pacted, Descr	ibe Fully.	*								
N/A Describe Can No release v	use of Proble	pacted, Descr	dial Action	* n Taken.* Closure.								
Describe Car No release v Describe Arc N/A hereby cert egulations a public health hould their or the environ	ea Affected a	em and Remered during to and Cleanup A	dial Action the BGT Action Take iven above to report and adequately DCD accept	n Taken.* Closure. Ken.* e is true and cond/or file certaice of a C-141 reviewestigate and	n release report by the diremedian	otifications as te NMOCD m te contaminati	knowledge and and perform correlarked as "Final Fion that pose a three the operator of	ctive action Report" do reat to gro	ons for rel oes not rel ound wate	leases which lieve the ope er, surface w	n may er erator of ater, hu	danger liability man health
Describe Car No release v	ea Affected a	em and Remered during and Cleanup And Clea	dial Action the BGT of Action Take acceptance adequately DCD acceptantions.	n Taken.* Closure. Ken.* e is true and cond/or file certaice of a C-141 revinvestigate anotance of a C-14	n release report by the dremedian 41 report of	otifications as te NMOCD m te contaminati	nd perform corre arked as "Final F ion that pose a th	ctive action Report" do reat to gro responsib	ons for rel oes not rel ound wate oility for c	leases which lieve the ope er, surface we compliance	n may er erator of eater, hu with any	danger liability man health
Describe Car No release v	ea Affected a	em and Remered during to and Cleanup A mand Cleanup	dial Action the BGT of Action Take acceptance adequately DCD acceptantions.	n Taken.* Closure. Ken.* e is true and cond/or file certaice of a C-141 reviewestigate and	n release report by the dremedian 41 report of	notifications are NMOCD made contamination and the contamination and the contamination are not relieved.	nd perform corre larked as "Final Fion that pose a the re the operator of	ctive action Report" do reat to gro responsib	ons for rel bes not rel bound wate bility for c	leases which lieve the ope er, surface we compliance	n may er erator of eater, hu with any	ndanger liability man health
Describe Car No release v Describe Arc N/A Thereby cert regulations a public health should their or the environ rederal, state	ify that the in operations had not local law	em and Remered during and Cleanup And Clea	dial Action the BGT of Action Take acceptance adequately DCD acceptantions.	n Taken.* Closure. Ken.* e is true and cond/or file certaice of a C-141 revinvestigate anotance of a C-14	n release report by the dremedian 41 report of	notifications are NMOCD made contamination and the contamination and the contamination are not relieved.	nd perform correlarked as "Final Fion that pose a three the operator of OIL CON Environmental S	ctive action Report" do reat to gro responsib SERVA Specialist:	ons for rel bes not rel bound wate bility for c	leases which lieve the ope or, surface we compliance	n may er erator of eater, hu with any	ndanger liability man health

Animas Environmental Services, LLC



August 3, 2015

Lisa Hunter ConocoPhillips San Juan Business Unit (505) 326-9786

Via electronic mail to: SJBUE-Team@ConocoPhillips.com

RE: Below Grade Tank Closure Report

San Juan 29-6 #15C

Rio Arriba County, New Mexico

Dear Ms. Hunter:

Animas Environmental Services, LLC (AES) is pleased to provide the final report associated with the below grade tank (BGT) closure at ConocoPhillips (COPC) San Juan 29-6 #15C, located in Rio Arriba County, New Mexico. Tank removal had been completed by COPC contractors prior to AES' arrival at the location.

1.0 Site Information

1.1 Location

Site Name – San Juan 29-6 #15C
Legal Description – SW¼ SW¼, Section 2, T29N, R6W, Rio Arriba County, New Mexico
Well Latitude/Longitude – N36.75076 and W107.44043, respectively
BGT Latitude/Longitude – N36.75084 and W107.44025, respectively
Land Jurisdiction – State of New Mexico
Figure 1. Topographic Site Location Map
Figure 2. Aerial Site Map, July 2015

1.2 Depth to Groundwater Determination (NMAC 19.15.17.13 Table 1)

Prior to site work, the New Mexico Oil Conservation Division (NMOCD) database was reviewed, and a below grade tank permit application (C-144) form dated June 2015 for the San Juan 29-6 #15C reported the depth to groundwater as 145 feet below ground

604 W. Piñon St. Farmington, NM 87401 505-564-2281

> 1911 Main, Ste 280 Durango, CO 81301 970-403-3084

www.animasenvironmental.com

surface (bgs). AES personnel further assessed the depth to water determination using topographical interpretation, Global Positioning System (GPS) elevation readings, and visual reconnaissance. AES personnel concluded that depth to groundwater at the site was greater than 100 feet bgs.

1.3 BGT Closure Assessment

AES was initially contacted by Lisa Hunter of COPC on July 6, 2015, and on July 10, 2015, Dylan Davis of AES mobilized to the location. AES personnel collected one 5-point soil sample composited from four perimeter samples and one center sample of the BGT footprint below the BGT liner.

2.0 Soil Sampling

On July 10, 2015, AES personnel conducted field sampling and collected one 5-point composite (SC-1) from below the BGT. Soil was collected from approximately 0.5 feet below the former BGT. Soil sample SC-1 was field screened for volatile organic compounds (VOCs), total petroleum hydrocarbon (TPH), and chloride, and was submitted for confirmation laboratory analysis. Soil sample locations are included on Figure 2.

2.1 Field Sampling

2.1.1 Volatile Organic Compounds

A portion of SC-1 was utilized for field screening of VOC vapors with a photo-ionization detector (PID) organic vapor meter (OVM). Before beginning field screening, the PID-OVM was first calibrated with 100 parts per million (ppm) isobutylene gas.

2.1.2 Total Petroleum Hydrocarbons

Soil sample SC-1 was also analyzed in the field for TPH per U.S. Environmental Protection Agency (USEPA) Method 418.1 using a Buck Scientific Model HC-404 Total Hydrocarbon Analyzer Infrared Spectrometer (Buck). A 3-point calibration was completed prior to conducting soil analyses. Field analytical protocol followed AES's Standard Operating Procedure: Field Analysis Total Petroleum Hydrocarbons per EPA Method 418.1.

2.1.3 Chlorides

Soil sample SC-1 was field screened for chlorides using Chloride Drop Count Titration with silver nitrate. Sampling and analysis methods followed procedures provided by Hach Company.

2.2 Laboratory Analyses

The composite soil sample SC-1 collected for laboratory analysis was placed into a new, clean, laboratory-supplied container, which was then labeled, placed on ice, and logged onto a sample chain of custody record. The sample was maintained on ice until delivery to the analytical laboratory, Hall Environmental Analysis Laboratory (Hall), in Albuquerque, New Mexico. Soil sample SC-1 was laboratory analyzed for:

- Benzene, toluene, ethylbenzene, and xylene (BTEX) per USEPA Method 8021B;
- TPH (as gasoline range organics (GRO) and diesel range organics (DRO)) per USEPA Method 8015M;
- TPH per USEPA Method 418.1; and
- Chloride per USEPA Method 300.0.

2.3 Field and Laboratory Analytical Results

Field screening readings for VOCs via OVM were measured at 0.0 ppm in SC-1. Field TPH concentrations were reported at 61.1 mg/kg. The field chloride concentration was 60 mg/kg. Field sampling results are summarized in Table 1 and presented on Figure 2. The AES Field Sampling Report is attached.

Table 1. Soil Field VOCs, TPH, and Chloride Results
San Juan 29-6 #15C BGT Closure. July 2015

Sample ID	Date Sampled	Depth below BGT (ft)	VOCs via OVM (ppm)	Field TPH* (mg/kg)	Field Chlorides (mg/kg)
	NMOCD (NMAC 19.15.17	Action Level 7.13 Table 1)	-	2,500	20,000
SC-1	7/10/15	0.5	0.0	61.1	60

^{*}Analyzed per USEPA Method 418.1.

Laboratory analytical results reported benzene and total BTEX concentrations in SC-1 as less than 0.048 mg/kg and 0.240 mg/kg, respectively. TPH (as GRO and DRO were reported at less than 4.8 mg/kg and 10 mg/kg, respectively. Total TPH concentrations were reported at less than 20 mg/kg. The laboratory chloride concentration was reported below the laboratory detection limit of 30 mg/kg. Laboratory analytical results are summarized in Table 2 and included on Figure 2. The laboratory analytical report is attached.

Table 2. Soil Laboratory Analytical Results San Juan 29-6 #15C BGT Closure, July 2015

Sample ID	Date Sampled	Depth (ft)	Benzene (mg/kg)	Total BTEX (mg/kg)	TPH - GRO (mg/kg)	TPH - DRO (mg/kg)	Total TPH (mg/kg)	Chlorides (mg/kg)
	NMOCD Action 19.15.17.13		10	50	1,000		2,500	20,000
SC-1	7/10/15	0.5	<0.048	<0.240	<4.8	<10	<20	<30

3.0 Conclusions and Recommendations

NMOCD action levels for BGT closures are specified in New Mexico Administrative Code (NMAC) 19.15.17.13 Table 1. Field TPH concentrations were below the NMOCD action level of 2,500 mg/kg, with a reported concentration of 61.1 mg/kg. Laboratory analytical results in SC-1 for TPH as GRO and DRO were reported below the NMOCD action level of 1,000 mg/kg, and total TPH results were reported below the NMOCD action level of 2,500 mg/kg. Benzene and total BTEX concentrations were below the NMOCD action levels of 10 mg/kg and 50 mg/kg, respectively. Chloride concentrations in SC-1 were below the NMOCD action level of 20,000 mg/kg. Based on field sampling and laboratory analytical results for benzene, total BTEX, TPH, and chlorides, no further work is recommended at San Juan 29-6 #15C.

If you have any questions about this report or site conditions, please do not hesitate to contact Emilee Skyles at (505) 564-2281.

Sincerely,

David J. Reese

Environmental Scientist

Elizabeth V MiNdly

David & Reve


Elizabeth McNally, P.E.


Lisa Hunter San Juan 29-6 #15C BGT Closure Report August 3, 2015 Page 5 of 5

Attachments:

Figure 1. Topographic Site Location Map Figure 2. Aerial Site Map, July 2015 AES Field Sampling Report 071015 Hall Analytical Report 1507484

C:\Users\emcnally\Dropbox (Animas Environmental)\0000 Animas Server Dropbox EM\2015 Projects\ConocoPhillips\SJ 29-6 #15C\San Juan 29-6 #15C BGT Closure Report 080315.docx

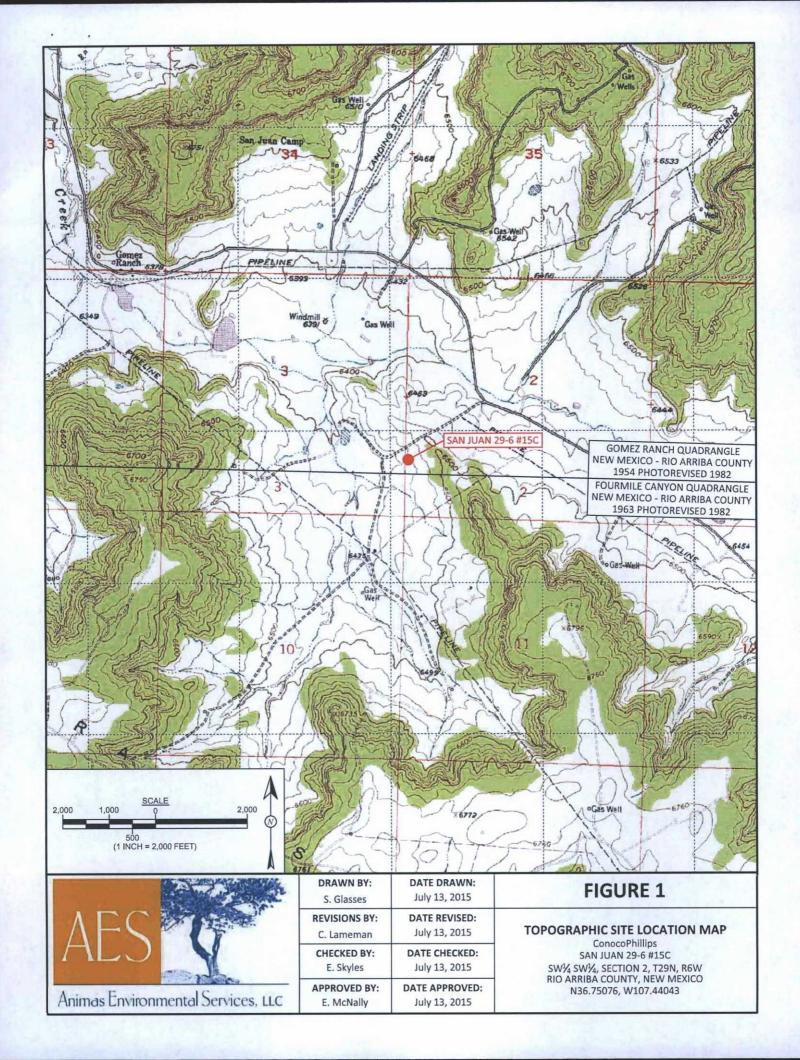

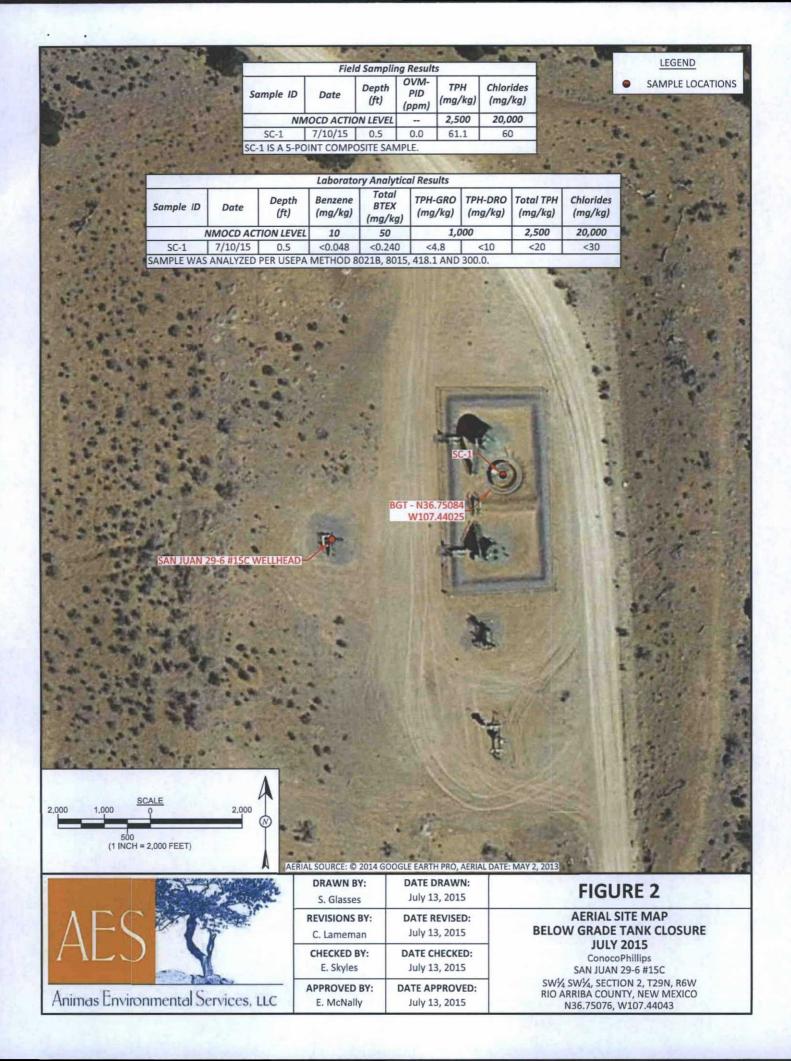

AES Field Sampling Report

Animas Environmental Services, LLC



Client: ConocoPhillips

Project Location: San Juan 29-6 #15C

Date: 7/10/2015

Matrix: Soil

Sample ID	Collection Date	Collection Time	Sample Location	OVM (ppm)	Field Chloride (mg/kg)	Field TPH* (mg/kg)	Field TPH Analysis Time	TPH PQL (mg/kg)	DF	TPH Analysts Initials
SC-1	7/10/2015	12:30	Composite	0.0	60	61.1	12:44	20.0	1	DD

DF NA **Dilution Factor**

Not Analyzed

PQL

Practical Quantitation Limit

Field Chloride - Quantab Chloride Titrators or Drop Count

Titration with Silver Nitrate

Total Petroleum Hydrocarbons - USEPA 418.1

Analyst: Dyla Daw

^{*}Field TPH concentrations recorded may be below PQL.



Hall Environmental Analysis Laboratory 4901 Hawkins NE Albuquerque, NM 87109 TEL: 505-345-3975 FAX: 505-345-4107 Website: www.hallenvironmental.com

July 21, 2015

Emilee Skyles
Animas Environmental Services
604 Pinon Street
Farmington, NM 87401
TEL: (505) 564-2281

-- ----

FAX (505) 324-2022

RE: SJ 29-6 # 15C OrderNo.: 1507484

Dear Emilee Skyles:

Hall Environmental Analysis Laboratory received 1 sample(s) on 7/11/2015 for the analyses presented in the following report.

These were analyzed according to EPA procedures or equivalent. To access our accredited tests please go to www.hallenvironmental.com or the state specific web sites. In order to properly interpret your results it is imperative that you review this report in its entirety. See the sample checklist and/or the Chain of Custody for information regarding the sample receipt temperature and preservation. Data qualifiers or a narrative will be provided if the sample analysis or analytical quality control parameters require a flag. When necessary, data qualifers are provided on both the sample analysis report and the QC summary report, both sections should be reviewed. All samples are reported, as received, unless otherwise indicated. Lab measurement of analytes considered field parameters that require analysis within 15 minutes of sampling such as pH and residual chlorine are qualified as being analyzed outside of the recommended holding time.

Please don't hesitate to contact HEAL for any additional information or clarifications.

ADHS Cert #AZ0682 -- NMED-DWB Cert #NM9425 -- NMED-Micro Cert #NM0190

Sincerely,

Andy Freeman

Laboratory Manager

andyl

4901 Hawkins NE

Albuquerque, NM 87109

Analytical Report

Lab Order 1507484

Date Reported: 7/21/2015

Hall Environmental Analysis Laboratory, Inc.

CLIENT: Animas Environmental Services

Project: SJ 29-6 # 15C

Lab ID: 1507484-001

Client Sample ID: SC-1

Collection Date: 7/10/2015 12:30:00 PM

Received Date: 7/11/2015 7:00:00 AM

Analyses	Result	RL Qu	al Units	DF	Date Analyzed	Batch
EPA METHOD 418.1: TPH			*		Analyst	том
Petroleum Hydrocarbons, TR	ND	20	mg/Kg	1	7/13/2015	20221
EPA METHOD 300.0: ANIONS					Analyst	LGT
Chloride	ND	30	mg/Kg	20	7/16/2015 10:46:25 AM	20289
EPA METHOD 8015M/D: DIESEL RAN	GE ORGANIC	S			Analyst	KJH
Diesel Range Organics (DRO)	ND	10	mg/Kg	1	7/14/2015 3:14:58 PM	20214
Surr: DNOP	98.8	57.9-140	%REC	1	7/14/2015 3:14:58 PM	20214
EPA METHOD 8015D: GASOLINE RAM	NGE				Analyst	NSB
Gasoline Range Organics (GRO)	ND	4.8	mg/Kg	1	7/14/2015 11:24:52 PM	20225
Surr: BFB	91.4	75.4-113	%REC	1	7/14/2015 11:24:52 PM	20225
EPA METHOD 8021B: VOLATILES					Analyst	NSB
Benzene	ND	0.048	mg/Kg	1	7/14/2015 11:24:52 PM	20225
Toluene	ND	0.048	mg/Kg	1	7/14/2015 11:24:52 PM	20225
Ethylbenzene	ND	0.048	mg/Kg	1	7/14/2015 11:24:52 PM	20225
Xylenes, Total	ND	0.096	mg/Kg	1	7/14/2015 11:24:52 PM	20225
Surr: 4-Bromofluorobenzene	100	80-120	%REC	1	7/14/2015 11:24:52 PM	20225

Matrix: SOIL

Refer to the QC Summary report and sample login checklist for flagged QC data and preservation information.

Qualifiers:

- Value exceeds Maximum Contaminant Level.
- E Value above quantitation range
- J Analyte detected below quantitation limits
- O RSD is greater than RSDlimit
- R RPD outside accepted recovery limits
- S Spike Recovery outside accepted recovery limits
- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit

Page 1 of 6

- P Sample pH Not In Range
- RL Reporting Detection Limit

OC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#: 1507484

21-Jul-15

Client:

Animas Environmental Services

Result

Project:

SJ 29-6 # 15C

Sample ID MB-20289

SampType: mblk

TestCode: EPA Method 300.0: Anions

Client ID: PBS

Batch ID: 20289

RunNo: 27581

Prep Date: 7/16/2015

SeqNo: 827975

Units: mg/Kg

Analyte

Analysis Date: 7/16/2015

SPK value SPK Ref Val %REC LowLimit

HighLimit

%RPD **RPDLimit** Qual

Chloride

ND

Sample ID LCS-20289

SampType: Ics

TestCode: EPA Method 300.0: Anions

Client ID: LCSS Prep Date: 7/16/2015 Batch ID: 20289

RunNo: 27581

SeqNo: 827976

Units: mg/Kg

Analyte

Analysis Date: 7/16/2015

PQL

SPK value SPK Ref Val %REC

LowLimit

HighLimit

RPDLimit

Chloride

15.00

97.5

90

%RPD

Qual

110

15

1.5

Qualifiers:

Value exceeds Maximum Contaminant Level.

Value above quantitation range E

Analyte detected below quantitation limits

Spike Recovery outside accepted recovery limits

RSD is greater than RSDlimit 0

RPD outside accepted recovery limits R

Analyte detected in the associated Method Blank

Not Detected at the Reporting Limit ND

RL Reporting Detection Limit

Sample pH Not In Range P

Holding times for preparation or analysis exceeded Page 2 of 6

OC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#:

1507484

21-Jul-15

Client:

Animas Environmental Services

Project:

Analyte

Analyte

SJ 29-6 # 15C

Sample ID MB-20221

SampType: MBLK

TestCode: EPA Method 418.1: TPH

Client ID:

PBS

Batch ID: 20221

RunNo: 27456

Prep Date: 7/13/2015

Analysis Date: 7/13/2015

SeqNo: 823655

Units: mg/Kg HighLimit

Petroleum Hydrocarbons, TR

Result

PQL SPK value SPK Ref Val %REC LowLimit 20

%RPD

RPDLimit

Sample ID LCS-20221

ND

SampType: LCS

TestCode: EPA Method 418.1: TPH RunNo: 27456

Client ID: LCSS Prep Date: 7/13/2015

Batch ID: 20221 Analysis Date: 7/13/2015

SeqNo: 823656

Units: mg/Kg

Petroleum Hydrocarbons, TR

Result 100

SPK value SPK Ref Val 20 100.0

%REC 0 101

LowLimit 83.6

HighLimit 116 **RPDLimit**

Qual

Sample ID LCSD-20221

SampType: LCSD Batch ID: 20221

PQL

20

RunNo: 27456

SeqNo: 823657

TestCode: EPA Method 418.1: TPH

Units: mg/Kg

%RPD

Qual

Analyte Petroleum Hydrocarbons, TR

Client ID:

Prep Date: 7/13/2015

LCSS02

Analysis Date: 7/13/2015

Result

100

100.0

SPK value SPK Ref Val %REC

103

83.6

HighLimit

%RPD 1.35

RPDLimit 20

Value exceeds Maximum Contaminant Level.

Value above quantitation range E

Analyte detected below quantitation limits

RSD is greater than RSDlimit 0

R RPD outside accepted recovery limits

Spike Recovery outside accepted recovery limits

Holding times for preparation or analysis exceeded H

Analyte detected in the associated Method Blank

Not Detected at the Reporting Limit ND

Reporting Detection Limit

Qualifiers:

P Sample pH Not In Range Page 3 of 6

OC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#: 1507484

21-Jul-15

Client:

Animas Environmental Services

Project:

SJ 29-6 # 15C

Sample ID MB-20214 TestCode: EPA Method 8015M/D: Diesel Range Organics SampType: MBLK Batch ID: 20214 RunNo: 27479 Client ID: PBS Prep Date: 7/13/2015 Analysis Date: 7/14/2015 SegNo: 824917 Units: mg/Kg SPK value SPK Ref Val %REC LowLimit HighLimit %RPD **RPDLimit** Result PQL Qual Diesel Range Organics (DRO) ND 10 Sur: DNOP 140 9.8 10.00 97.5 57.9

Surr: DNOP 9.8 10.00 97.5 57.9 140

Sample ID LCS-20214 SampType: LCS TestCode: EPA Method 8015M/D: Diesel Range Organics Client ID: LCSS Batch ID: 20214 RunNo: 27509 Prep Date: 7/13/2015 Analysis Date: 7/15/2015 SeqNo: 826589 Units: mg/Kg Analyte Result PQL SPK value SPK Ref Val %REC LowLimit HighLimit %RPD **RPDLimit** Qual Diesel Range Organics (DRO) 50 10 50.00 101 57.4 139 Surr: DNOP 4.9 5.000 98.5 57.9 140

Qualifiers:

- * Value exceeds Maximum Contaminant Level.
- E Value above quantitation range
- J Analyte detected below quantitation limits
- O RSD is greater than RSDlimit
- R RPD outside accepted recovery limits
- S Spike Recovery outside accepted recovery limits
- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit
- P Sample pH Not In Range
- RL Reporting Detection Limit

Page 4 of 6

QC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#: 1507484

21-Jul-15

Client:

Animas Environmental Services

Project:

SJ 29-6 # 15C

Sample ID MB-20225	SampType: I	TestCode: EPA Method 8015D: Gasoline Range							
Client ID: PBS	Batch ID: 2	20225	F	RunNo: 2	7497				
Prep Date: 7/13/2015	Analysis Date:	7/14/2015	5	SeqNo: 8	25115	Units: mg/K	(g		
Analyte	Result PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Gasoline Range Organics (GRO) Surr: BFB	ND 5.	0 1000		90.8	75.4	113			
Sample ID LCS-20225	SampType: I	_cs	Tes	tCode: El	PA Method	8015D: Gaso	line Rang	е	
Client ID: LCSS	Batch ID: 2	20225	F	RunNo: 2	7497				
Prep Date: 7/13/2015	Analysis Date:	7/14/2015	5	SeqNo: 8	25116	Units: mg/K	(g		
Analyte	Result PQI	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Gasoline Range Organics (GRO)	26 5.	0 25.00	0	106	64	130			
Surr: BFB	1000	1000	1 100	99.8	75.4	113	1.00		
Sample ID 1507484-001AMS	SampType: I	VIS	Tes	tCode: El	PA Method	8015D: Gaso	line Rang	е	
Client ID: SC-1	Batch ID: 2	20225	F	RunNo: 2	7497				
Prep Date: 7/13/2015	Analysis Date:	7/14/2015	5	SeqNo: 8	25118	Units: mg/k	(g		
Analyte	Result PQI	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Gasoline Range Organics (GRO)	27 4.	8 23.81	0	112	62.5	151			
Surr: BFB	930	952.4		97.8	75.4	113			

0 1 10 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		Scanson Committee		-					SALL LIVE				
Sample ID 1507484-001AMS	SD SampTy	/pe: MS	SD	TestCode: EPA Method 8015D: Gasoline Range									
Client ID: SC-1	Batch	ID: 20	225	F	RunNo: 2	7497							
Prep Date: 7/13/2015	Analysis Da	Analysis Date: 7/15/2015			SeqNo: 8	25119	Units: mg/k						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qua			
Gasoline Range Organics (GRO)	27	4.8	23.83	0	112	62.5	151	0.0836	22.1				
Surr BFB	930		953.3		98.0	75.4	113	0	0				

Qualifiers:

- * Value exceeds Maximum Contaminant Level.
- E Value above quantitation range
- J Analyte detected below quantitation limits
- O RSD is greater than RSDlimit
- R RPD outside accepted recovery limits
- S Spike Recovery outside accepted recovery limits
- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit
- P Sample pH Not In Range RL Reporting Detection Limit

Page 5 of 6

QC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#:

1507484

21-Jul-15

Client:

Animas Environmental Services

Project:

SJ 29-6 # 15C

Sample ID MB-20225 SampType: MBLI				TestCode: EPA Method 8021B: Volatiles										
Client ID: PBS Batch II			225	F	RunNo: 2	7497								
Prep Date: 7/13/2015	Analysis Date: 7/14/2015		SeqNo: 825158			Units: mg/K	(g							
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual				
Benzene	ND	0.050							1 1					
Toluene	ND	0.050												
Ethylbenzene	ND	0.050												
Xylenes, Total	ND	0.10												
Surr: 4-Bromofluorobenzene	0.98		1.000		97.9	80	120							
Sample ID I CS 20225	Samn	Type: LC	9	Tes	tCode: E	PA Method	8021B: Volat	tilos						

Sample ID LCS-20225	Samp	Type: LC	S	Tes						
Client ID: LCSS Batch ID: 20225				F						
Prep Date: 7/13/2015	Analysis Date: 7/14/2015			SeqNo: 825159			Units: mg/h	⟨ g		
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Benzene	1.0	0.050	1.000	0	101	76.6	128		7 3 4	
Toluene	0.98	0.050	1.000	0	98.5	75	124			
Ethylbenzene	1.0	0.050	1.000	0	103	79.5	126			
Xylenes, Total	3.1	0.10	3.000	0	102	78.8	124			
Surr: 4-Bromofluorobenzene	1.1		1 000		106	80	120			

Qualifiers:

- Value exceeds Maximum Contaminant Level.
- E Value above quantitation range
- Analyte detected below quantitation limits
- 0 RSD is greater than RSDlimit
- R RPD outside accepted recovery limits
- Spike Recovery outside accepted recovery limits
- Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit

Page 6 of 6

Sample pH Not In Range RL Reporting Detection Limit



Hall Environmental Analysis Laboratory 4901 Hawkins NE Albuquerque, NM 87109

TEL: 505-345-3975 FAX: 505-345-4107 Website: www.hallenvironmental.com

Sample Log-In Check List

Received by/date: Logged By: Lindsay Mangin 7/11/2015 7:00:00 / 7/11/2015 8:23:58 / 7		of 4 Mgo		
Completed By: Lindsay Mangin 7/11/2015 8:23:58 / Reviewed By: (S 01/3/15 Chain of Custody	Yes 🗆	000		
Reviewed By: (S 01 3 15	Yes 🗆	000		
Reviewed By: (S 01 3 15		000		
Chain of Custody		No 🗔		
		No 🗌		
	Yes 🗸		Not Present	
2. Is Chain of Custody complete?		No _	Not Present	
3. How was the sample delivered?	Courier			
Log In				
4. Was an attempt made to cool the samples?	Yes 🗸	No 🗆	NA 🗆	
5. Were all samples received at a temperature of >0° C to 6.0°C	Yes 🗹	No 🗆	NA 🗆	
6. Sample(s) in proper container(s)?	Yes 🗸	No 🗆		
7. Sufficient sample volume for indicated test(s)?	Yes 🗹	No 🗆		
8. Are samples (except VOA and ONG) properly preserved?	Yes 🗸	No 🗌		
9. Was preservalive added to bottles?	Yes	No 🗹	NA 🗆	
10. VOA vials have zero headspace?	Yes 🗆	No 🗆	No VOA Viais	
11. Were any sample containers received broken?	Yes	No 🗸	# of preserved	
		8. 🖂	bottles checked	
12. Does paperwork match bottle labels? (Note discrepancies on chain of custody)	Yes 🗸	No L	for pH: (<2 or	>12 unless noted
13. Are matrices correctly identified on Chain of Custody?	Yes V	No 🗆	Adjusted?	
14. Is it clear what analyses were requested?	Yes 🗸	No 🗆		
15. Were all holding times able to be met? (If no, notify customer for authorization.)	Yes 🗸	No 🗆	Checked by:	
Special Handling (if applicable)				
16. Was client notified of all discrepancies with this order?	Yes	No 🗌	NA 🗹	
Person Notified: Date	е			
By Whom: Via:	eMail I	Phone Fax	☐ In Person	
Regarding:	2			
Client Instructions:				
17. Additional remarks:				
18. Cooler Information				
Cooler No Temp °C Condition Seal Intact Seal No	Seal Date	Signed By		

Client: Animas Environmental Services			Turn-Around Time: X Standarc □ Rush Project Name: SJ 29-6 # 15C				HALL ENVIRONMENTAL ANALYSIS LABORATORY											
							www.hallenvironmental.com 4901 Hawkins NE - Albuquerque, NM 87109											
Farmingto	n, NM 874			Project #:							5-3975	5 1	Fax 5	05-34	5-410			
Phone #: 5	505-564-2	281							_			Anal	ysis f	Reque	st		-	_
Email or F QA/QC Pac X Standa	ckage:	les@anin	nasenvironmental.com Level 4 (Full Validation)	Project Mana	ager: E. Skyle:	s			DRO)								- 6	
Accreditat		□ Other		Sampler: Dy On Ice:		in Na Francisco		-	+	300.0								:
□ EDD (T	ype)			Sample Tep	perature:	ga X nameni	18	418.	M (G	EPA	1						1 1	:
Date	Time	Matrix	Sample Request ID	Container Type and #	Preservative Type	HEAL NO.	BTEX - 8021	TPH - EPA	TPH - 8015M (GRO	Chlorides - E								:
10/15	1730	Soil	5(-1	2 - 4 oz.	(00	-001	х	X	X	Х		*						
													1					
Date:	Time:	Relinquish	N	Received by:	haete						38191 Ordered				nael Ma	arquez (JSERI	D:
Date:	Time: 2204	Relinquish	ed by:	Received by:	L AT	7 11 15 0 700												Ĺ