


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 077112
Unit Warren

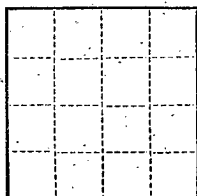

SUNDRY NOTICES AND REPORTS ON WELLS RECEIVED

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 6, 1960

Well No. 3-A is located 1800 ft. from [N] line and 1800 ft. from [E] line of sec. 25


NE 1/4 Sec. 25 (1/4 Sec. and Sec. No.) 24N (Twp.) 9E (Range) T.12N.R.14E (Meridian)
South Platte P. Co. (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 5997 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

2-26-60 Total Depth 2369'. C.O.F.D. 2305.5'. Water fractured fractured Clinton perf. int. 2245-23; 2252-70; 2265-92 (2 holes side-saddle sh/ft) v/21,510 gallons water and 15,000 sand. ID pr. 3100', max. pr. 4500', avg. tr. pr. 3140'. I.B. 21.3 BHM. Flush 2100 gallons. 25 Gallons Chloride in all water. 1.2 gallons Kerosene per 1,000 gallons water.

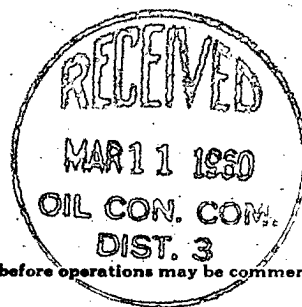

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company
Address Box 997
Farmington, New Mexico
By ORIGINAL SIGNED J.J. TILLERSON
Title Petroleum Engineer