

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

30 039 24493

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company Williams Production	Contact Michael K. Lane <input type="checkbox"/>
Address 999 Goddard Ave, Ignacio, CO 81137	Telephone No. 970/563-3319 <input type="checkbox"/>
Facility Name Rosa 220	Facility Type Well Site <input type="checkbox"/>

Surface Owner BLM	Mineral Owner BLM	Lease No. SF-078767 <input type="checkbox"/>
--------------------------	--------------------------	---

LOCATION OF RELEASE

Unit Letter B	Section 13	Township 31 N	Range 06W	Feet from the	North/South Line	Feet from the	East/West Line	County Rio Arriba <input type="checkbox"/>
-------------------------	----------------------	-------------------------	---------------------	---------------	------------------	---------------	----------------	--

Latitude _____ Longitude _____

NATURE OF RELEASE

Type of Release Produced Water in Drilling Fluid	Volume of Release <50bbl	Volume Recovered None
Source of Release Reserve Pit	Date and Hour of Occurrence 2/21/05 8:00 AM MST	Date and Hour of Discovery Same
Was Immediate Notice Given? X Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Denny Foust, NMOCD	
By Whom? Michael Lane	Date and Hour 2/21/05 12:45PM	
Was a Watercourse Reached? <input type="checkbox"/> Yes X No	If YES, Volume Impacting the Watercourse	

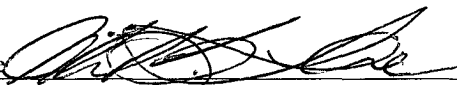
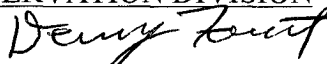
If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken

Heavy rain and snow over weekend filled reserve pit to capacity. Water level has reached small tear at top of liner and is backing into unlined flare/vent pit area thru the backflow. No water has left reserve or flare pit area at time of report. Prior to weekend >400 bbl removed from pit and stored in temporary frac tanks on site. Backhoe crew mobilized to reinforce pit berms and construct berms to prevent migration of a spill from leaving pit or location. Water trucks have been called out but extremely poor road conditions preventing trucks from responding quickly.

Describe Area Affected and Cleanup Action Taken. **Remediation of pit area to be completed once workover is finished and rig(s) move off ***

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature 	OIL CONSERVATION DIVISION	
Printed Name: Michael K. Lane	Approved by District Supervisor  for Charlie Perrin acty	
Title: FCA Environmental Specialist	Approval Date: 3/21/05	Expiration Date:
E-mail Address: Myke.Lane@Williams.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 2/22/05 Phone: (505) 330-3198		

* Attach Additional Sheets If Necessary

n DGF 0508042359