

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE\*  
(Other instructions on reverse side)Form approved.  
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.

NM 052931

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Hanson

9. WELL NO.

15

10. FIELD AND POOL, OR WILDCAT

South Hospah-Upper Sand

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 6, T17N, R8W, NMPM

14. PERMIT NO.

?

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6908' GL

6920' RKB

12. COUNTY OR PARISH

McKinley

13. STATE

New Mexico

16.

## Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON\*

CHANGE PLANS

## SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

Commence drilling & casing settings  
(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*


Spudded 2:00 PM 4-12-70. Drilled 12-1/4" hole to 73' RKB. Set 2 joints 8-5/8" 24# H-40 ST&C surface casing at 73' RKB with 60 sacks common cement plus 2% CaCl. Cement circulated to surface.

Drilled 7-7/8" hole to 270' RKB. Cored 270-327' RKB (Seven Lakes Sand). 100% recovery. No show. No analysis. Top of Seven Lakes Sand at 272' RKB.

Drilled to 1517' (Schl. measurement) and ran Schlumberger IES Log.

Ran 48 joints 5-1/2" 14# J-55 casing with Larkin float shoe and Larkin coupling insert float in top of bottom joint, 4 short bow latch-on centralizers, and 100' rotating scratchers. Set at 1517' RKB with 100 sacks common cement. Plug down at 10:00 AM 4-15-70.

Preparing to drill in with power swivel for open hole completion.

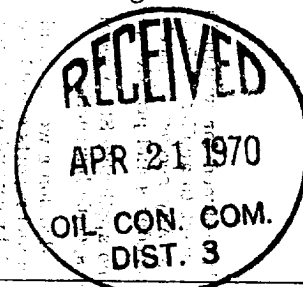

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Petroleum Engineer

DATE

April 16, 1970

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

DATE

APR 20 1970

\*See Instructions on Reverse Side

U. S. GEOLOGICAL SURVEY  
FARMINGTON, N. M.