

NO. OF COPIES RECEIVED	4
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	2

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
L-1451

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P & A	7. Unit Agreement Name
2. Name of Operator Northern Minerals, Inc.,	8. Farm or Lease Name State
3. Address of Operator P. O. Box 2182, Santa Fe, New Mexico 87501	9. Well No. 1
4. Location of Well UNIT LETTER D 660 FEET FROM THE North LINE AND 660 FEET FROM THE West 16 - 16N TOWNSHIP 7W RANGE NMPM NMPM.	10. Field and Pool, or Wildcat Wildcat
15. Elevation (Show whether DF, RT, GR, etc.) 6716' G. L.	12. County McKinley

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>


17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This well was plugged and abandoned on June 20, 1973 with cement plugs set at the following depths:

100' plug across top of Dakota "D" - 2735' to 2835'
100' plug across top of Massive Gallup - 1750' to 1850'
100' plug across base of Point Lookout - 860' to 960'
Surface plug - 5 sacks

A dry hole marker has been erected, pits filled and the location cleared.

The location is now ready for your inspection.

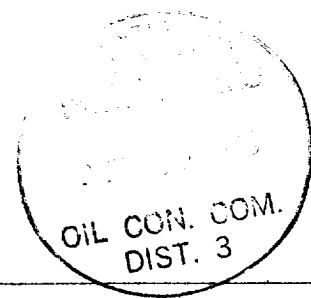

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Ernest Davidson TITLE President DATE 10-5-73

Original Signed by Emery G. Arnold TITLE SUPERVISOR DIST. #3 DATE NOV 2 1973

CONDITIONS OF APPROVAL, IF ANY:

NEW MEXICO OIL CONSERVATION COMMISSION
1000 RIO BRAZOS ROAD
AZTEC, NEW MEXICO

Northern Minerals Inc
PO Box 2182
Santa Fe, New Mex 87501

Re: Plugging Reports



Gentlemen:

Form C-103, Notice of Intention to Plug, your State 1
Lease Well No.

D-16-16N-7W was approved 6-28-73. Your
Unit S-T-R

subsequent notice of plugging cannot be approved until a commission representa-
tive has made an inspection of the location to see:

- (1) all pits have been filled and leveled;
- (2) a steel marker, 4" in diameter and approximately 4' above mean ground level, must be set in concrete, this marker must have the quarter-quarter section or unit designation, section, township and range numbers, which shall be permanently stenciled or welded on the marker;
- (3) the location shall be cleared and cleaned of all junk;
- (4) the dead man wires must be cut.

The above are the minimum requirements.

Please notify us by filling in the blank form below when this work has been done so that our representative will not have to make more than one trip to the location.

OIL CONSERVATION COMMISSION

By *Emmy Howard*

Fill in below and return:

STATE 1 - D-16-16N-7W is ready for your inspection and
Lease Well No. Unit S-T-R
approval.

for completed 11-2-73

Northern Minerals Inc.
Operator
Joseph Davidson, President
Name and title

10-5-73