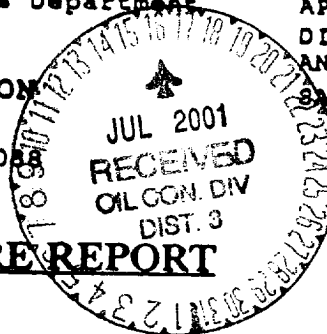


District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
1000 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE



PIT REMEDIATION AND CLOSURE REPORT

Operator: NERDLHC Company INC, NMOC Telephone: 505-334-6178

Address: 1000 Rio Brazos Rd, AZTEC, NM 87410

Facility Or: BULLSEYE 5/6
Well Name

Location: Unit or Qtr/Qtr sec K sec 18 T 16N R 9W County McKINLEY

Pit Type: Separator Dehydrator Other RESERVE

Land Type: BLM , State , Fee X, Other

Pit Location: Pit dimensions: length 10, width 10, depth 6
(Attach diagram)

Reference: wellhead X, other

Footage from reference: 110'

Direction from reference: ESE Degrees X East North X
100° of
 West South

Depth To Ground Water:

(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)

50 feet to 99 feet (10 points)

Greater than 100 feet (0 Points) 0

Wellhead Protection Area:

(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)

No (0 points) 0

Distance To Surface Water:

(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)

200 feet to 1000 feet (10 points)

Greater than 1000 feet (0 points) 0

RANKING SCORE (TOTAL POINTS):

0

Date Remediation Started: 01-15-01 Dated Completed: 3-13-01

Remediation Method: Excavation Approx. cubic yards
(Check all appropriate sections) Landfarmed Insitu Bioremediation
Other Sample & close

Remediation Location: Onsite Offsite
(ie. landfarmed onsite, name and location of offsite facility)

General Description Of Remedial Action: 5 point composite sample from
4 SIDEWALLS & Bottom $\pm$ 4 1/2 below existing surface

Ground Water Encountered: No X Yes Depth

Final Pit: Sample location 4 SIDEWALLS & Bottom @ $\pm$ 4.5' Below
Closure Sampling: existing surface
(if multiple samples, attach sample results and diagram of sample locations and depths) Sample depth 4.5'

Sample date 1-15-01 Sample time 17:25

Sample Results

Benzene(ppm) 0.0091 ppm

Total BTEX(ppm) 0.249 ppm

Field headspace(ppm)

TPH 333 ppm

Ground Water Sample: Yes No X (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 03-16-01

SIGNATURE Harlan W. Brown PRINTED NAME HARLAN W. Brown
AND TITLE GEOLOGIST / HYDROGEOLOGIST

TRAVEL NOTES:

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

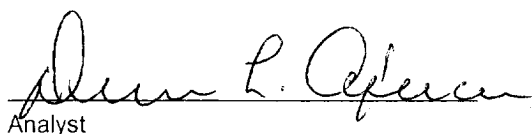
Client:	A Plus Well Service - NMOCD	Project #:	99042-002
Sample ID:	Nerdlihc Bullseye 5 & 6	Date Reported:	01-17-01
Laboratory Number:	19090	Date Sampled:	01-15-01
Chain of Custody No:	8459	Date Received:	01-15-01
Sample Matrix:	Soil	Date Extracted:	01-17-01
Preservative:	Cool	Date Analyzed:	01-17-01
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	2.5	0.2
Diesel Range (C10 - C28)	330	0.1
Total Petroleum Hydrocarbons	333	0.1

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: A.P.A. Woosley, Hospah. 5 Pt.; Trash Pit.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	A Plus Well Service - NMOCD	Project #:	99042-002
Sample ID:	Nerdlihc Bullseye 5 & 6	Date Reported:	01-17-01
Laboratory Number:	19090	Date Sampled:	01-15-01
Chain of Custody:	8459	Date Received:	01-15-01
Sample Matrix:	Soil	Date Analyzed:	01-17-01
Preservative:	Cool	Date Extracted:	01-17-01
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	9.2	1.8
Toluene	17.1	1.7
Ethylbenzene	11.2	1.5
p,m-Xylene	108	2.2
o-Xylene	103	1.0
Total BTEX	249	

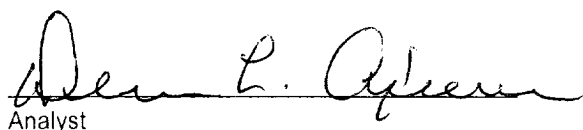
ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	100 %
	Bromofluorobenzene	100 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: A.P.A. Woosley, Hospah. 5 Pt.; Trash Pit.


Analyst


Review

CHAIN OF CUSTODY RECORD

08459

Client / Project Name		Project Location		ANALYSIS / PARAMETERS													
A Plus Well Service - NMOC		A.P.A. Woosley, Hospatt															
Sampler: Harold M. Brown				Client No. 99042-002		904202		No. of Containers		8015		8021		Remarks			
Sample No./ Identification	Sample Date	Sample Time	Lab Number	Sample Matrix													
SANTA FE LEGS #1	01.15.01	10:40	19082	Soil											5 Pt.; Produced water Pit.		
Nordlich																	
Bullseye #10	01.15.04	12:35	19083	Soil											5 Pt.; Reserve Pit.		
Nordlich																	
Bullseye #3	01.15	13:00	19084	Soil											5 Pt.; East Pit @ Separator		
Nordlich																	
Bullseye #7	01.15	14:10	19085	Soil											5 Pt.; Pit.		
Nordlich																	
Bullseye #8	01.15	14:30	19086	Soil											5 Pt.; Pit.		
Nordlich																	
Bullseye #11	01.15	15:05	19087	Soil											5 Pt.; Produced water Pit.		
Nordlich																	
Marcelina No 5	01.15	15:45	19088	Soil											5 Pt.; Truss Pit 16 of W.H.		
Nordlich																	
Marcelina No 1	01.15	16:20	19089	Soil											5 Pt.; W produced water Pit		
Nordlich																	
Bullseye #6	01.15	17:25	19090	Soil											5 Pt.; Truss Pit.		
Relinquished by: (Signature)		Date		Time		Received by: (Signature)		Date		Time							
Harold M. Brown		01.15.01		20:15		P. Cyhura		1-15-01		20:15							
Relinquished by: (Signature)						Received by: (Signature)											
Relinquished by: (Signature)						Received by: (Signature)											
												Sample Receipt					
												Y		N		N/A	
												Received Intact		✓			
												Cool - Ice/Blue Ice		✓			

ENVIROTECH INC.

5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615