

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells

1. Type of Well Oil 2. Name of Operator Capital Oil & Gas 3. Address & Phone No. of Operator c/o NMOCD, 1000 Rio Brazos Road, Aztec, NM 87410 4. Location of Well, Footage, Sec., T, R, M Unit A, Sec. 4, T-15-N, R-6-W, NMPM, McKinley County	API # (assigned by OCD) 30-031-20542 5. Lease Number Fee 6. State Oil&Gas Lease # 7. Lease Name/Unit Name Thomas Drought 8. Well No. #1 9. Pool Name or Wildcat Gallup 10. Elevation:
--	--

Type of Submission	Type of Action
☐ Notice of Intent	☒ Abandonment
☒ Subsequent Report	☐ Recompletion
☐ Final Abandonment	☐ Plugging Back
	☐ Casing Repair
	☐ Altering Casing
	☐ Other -

13. Describe Proposed or Completed Operations

Plugging Summary:

8-20-99 Safety Meeting. Road rig and equipment to location, RU. Well pressures: casing 20#, bleed well down. Pressure test tubing to 300#, held OK. Unseat pump and LD 1" polish rod, 1' 8-3/4" sub and 2' 4" subs with 28 3/4" rods and 1 bottom hold down pump. Layout relief line from casing to metal pit and blow down casing. Pump 10 bbls down tubing and circulate clean. ND wellhead and NU BOP, test. Unseat donut; had a lock on top. PU 8 joints tubing and tag bottom at 951'. Circulate hole clean with 15 bbls water. Plug #1 mix and pump 35 sxs Class B cement from 951' to 550'. TOH with tubing and WOC. SI well, SDFD.

8-23-99 Safety Meeting. Open up well, no pressure. Pressure test 4-1/2" casing to 300#, held OOK. TIH with tubing and tag cement at 859', cement had fallen back. Plug #1b with 24 sxs Class B cement from 859' to 550'. RU A-Plus wireline truck. Perforate 2 1-11/16" squeeze holes at 100'. Establish circulation with 8 bbls at 0# outside 4-1/2" casing. TIH to 257'. Plug #2 with 56 sxs Class B cement with 2% CaCl2 from 257' to surface, circulate 1 bbl good cement out casing. TOH and LD tubing. Shut in well and WOC. TIH and tag cement at 30'. ND BOP, dig out and cut off wellhead. Mix 18 sxs Class B cement and top off 4-1/2" casing with 16 sxs; install P&A marker with 2 sxs.

8-24-99 Drive to location. RD rig and equipment; move off location.

8-25-99 Load rods onto float at location. H. Villanueva, NMOCD was on location and approved all procedures.

SIGNATURE William F. Clark Contractor

September 29, 1999

(This space for State Use)

Approved by H. Villanueva

Title DEPUTY OIL & GAS INSPECTOR, DIST. 3

Date SEP 29 2000

Daily Report

A - PLUS WELL SERVICE

15459

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211Rig No 6Date Mon 8-23-99Well No THOMAS DROUGHT # Location Sec 4, T15, R6W Company NIMOXID

FROM	TO	DESCRIPTION OF OPERATION
5:00	8:30	DRIVE TO LOC. from Farmington
8:30	9:00	Fuel-up & service equip. HSM (working w/wireline)
9:00		Open well up $\varnothing$
	9:15	Plg 4 1/2 csg w/1 BBL to 300' Held OK.
9:15		Pick-up 4' plugging sub, T1H w/ 9 STANS, pick-up 10jts
	10:00	Tag w/10' stick-up TOC AT 859'
10:00		Load hole Pump Plug #1B w/24SXS B-cement 15-6
	10:30	(859-550) TOC 550
10:30	11:00	lay down 20jts standback 4 STAN (257')
11:00	11:15	Perf. AT 100' w/2 shots 2-1" 16 B1-wire
11:15	11:30	est. circulation out squeeze hole w/2 BBLs AT OPST
		outside 4 1/2 csg
11:30	11:45	T1H w/ 8jts to 257'
11:45		Pump Plug #2 (surface) w/56SXS B-cement 15-6 #
		from 257 to surface, circulate 1 BBL gravel cement
	12:15	outside 4 1/2 csg used 220 calc.
12:15	12:30	lay down 8jts shut-in well
12:30	3:00	WOC (R.U. wireline at # 72 & tag at 738'
		R.U. wire at # 55 & tag at 770')
3:00		RD Bop's Pick-up 1jt & tag cement at 30'
		filled 4 1/2 csg & outside w/16SXS B-cement 15-6 #
		RD Bop's, Sig out & cut-off wellhead install dry hole
4:00		marker & top off well w/2SXS cement
		Cost. #7300.96

Fuel & Motor Oil

Water Hauled

ALL procedures approved by
Henry Villanueva w/NIMOXID on hoc

Rental Equipment

Cement Retainers

Cementing Plug #1B 24SXS Plug #2 56SXS Plug #3 18SXS

Wireline

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	Bill Randall	12		
Operator	Sam Stuart	16		11
Helper	Robert Velasquez			11
Helper	Victor Pelis			11
Helper				

Date W100/ #15459

Daily Report

A - PLUS WELL SERVICE

15461

P.O. BOX 1979 • FARMINGTON, NM 87499

505-325-2627 • FAX (505) 325-1211

Rig No 6

Date Tues. 8.24.99

Well No. THOMAS DRAUGHT # Location _____ Company NIMCO

[illegible]

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing

Wireline _____

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	Bill Randall	12		
Operator	Sam Stuart	20		3
Helper	Robert Velazquez			3
Helper	Victor Celis			3
Helper				

15469


Well No _____ Location _____ Company NMOC

[illegible]


Wireline

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	Bill Randall	12		
Operator	Sam Stuart	20		3
Helper	Robert Velasquez			3
Helper	Victor Celis			3
Helper	Chuck Huezzi			3


Data

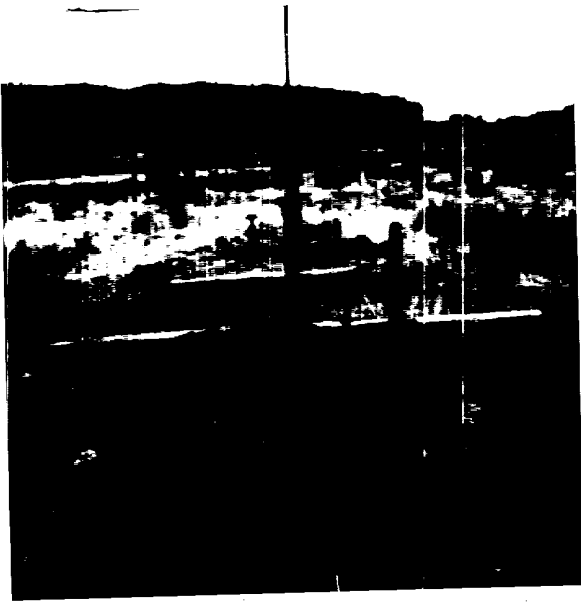

Capital B&G Thomas Drought #1
6-4-60

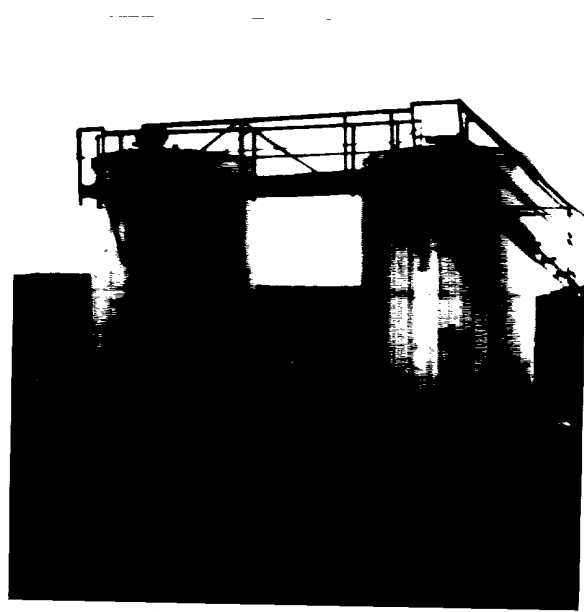

Capital B&G Thomas Drought #1
6-4-60

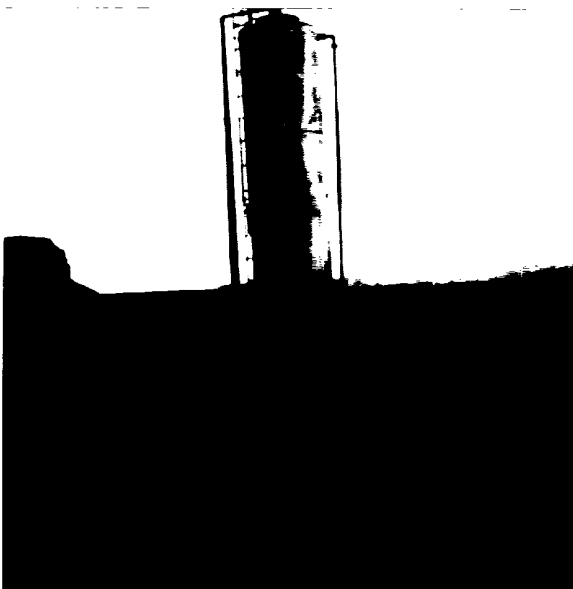

Capital B&G Thomas Drought #1
6-4-60

