

# Walsh

ENGINEERING & PRODUCTION CORP.

PETROLEUM ENGINEERING  
RESERVOIR STUDIES  
EVALUATIONS  
GEOLOGICAL STUDIES  
LEASE MANAGEMENT  
CONTRACT PUMPING  
DRILLING SUPERVISION  
WORKOVER SUPERVISION

EWELL N. WALSH, P.E.  
President

RECEIVED

OCT 21 1982

WORKOVER REPORT U. S. GEOLOGICAL SURVEY  
FARMINGTON, N.M.

DAVE M. THOMAS, JR.  
CHACON JICARILLA NO. 2  
790'FSL, 1850'FEL, SEC. 15-T23N-R3W  
Rio Arriba County, New Mexico

November 21, 1980

*Jicarilla Contract 413*



Ewell N. Walsh, P.E.  
State of New Mexico  
Registration No. 4324

ACCEPTED FOR RECORD

OCT 22 1982

FARMINGTON, N.M.

BY

*JK*

NMOCC

WORKOVER REPORT

DAVE M. THOMAS, JR.  
CHACON JICARILLA NO. 2  
790'FSL, 1850'FEL, SEC. 15-T23N-R3W  
Rio Arriba County, New Mexico

11/4/80 Aztec Well Service Rig No. 89 moved on location and rigged up. Pulled 95 joints 1-1/2" tubing. Tagged up with tubing and had 21' of fill. Bottom part of perforations covered. Ran Fullbore Packer one half of way in hole with 2-3/8" tubing. Shut down.

11/5/80 Located hole in casing between 191'-224'. Preparing to cut off casing and repair with casing bowl. Casing tested okay 224'-3028'. Shut down.

11/6/80 Tried to cut casing with chemical cutter at 271' and 278'. Could not get cut off. Preparing to cut casing with mechanical cuttle. Shut down.

11/7/80 Went in hole with mechanical cutter. Hole had fallen in and bridged off 4 feet above casing stub. Shut down to wait on orders.

11/8 & 11/9/80 Shut down. Waiting on orders concerning doing further work.

11/10/80 Ran 6 joints of 4-1/2" casing. Landed at 180 feet. Laid down 95 joints of 1-1/2" tubing and 95 joints 2-3/8" tubing. Shut well in and released rig.

# Walsh

ENGINEERING & PRODUCTION CORP.

PETROLEUM ENGINEERING  
RESERVOIR STUDIES  
EVALUATIONS  
GEOLOGICAL STUDIES  
LEASE MANAGEMENT  
CONTRACT PUMPING  
DRILLING SUPERVISION  
WORKOVER SUPERVISION

RECEIVED

EWELL N. WALSH, P.E.  
President

OCT 22 1982


U. S. GEOLOGICAL SURVEY  
FARMINGTON, NEW MEXICO

## WORKOVER REPORT

DAVE M. THOMAS, JR.  
CHACON JICARILLA NO. 2  
790'FSL, 1850'FEL, SEC. 15-T23N-R3W  
Rio Arriba County, New Mexico

November 21, 1980

Jicarilla Contract 413

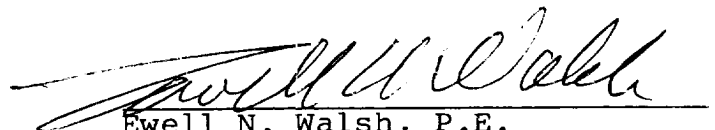

Ewell N. Walsh, P.E.  
State of New Mexico  
Registration No. 4324

ACCEPTED FOR RECORD

OCT 22 1982

NMOCC

FARMINGTON, NEW MEXICO  
BY 

WORKOVER REPORT

DAVE M. THOMAS, JR.  
CHACON JICARILLA NO. 2  
790'FSL, 1850'FEL, SEC. 15-T23N-R3W  
Rio Arriba County, New Mexico

11/4/80 Aztec Well Service Rig No. 89 moved on location and rigged up. Pulled 95 joints 1-1/2" tubing. Tagged up with tubing and had 21' of fill. Bottom part of perforations covered. Ran Fullbore Packer one half of way in hole with 2-3/8" tubing. Shut down.

11/5/80 Located hole in casing between 191'-224'. Preparing to cut off casing and repair with casing bowl. Casing tested okay 224'-3028'. Shut down.

11/6/80 Tried to cut casing with chemical cutter at 271' and 278'. Could not get cut off. Preparing to cut casing with mechanical cuttle. Shut down.

11/7/80 Went in hole with mechanical cutter. Hole had fallen in and bridged off 4 feet above casing stub. Shut down to wait on orders.

11/8 &  
11/9/80 Shut down. Waiting on orders concerning doing further work.

11/10/80 Ran 6 joints of 4-1/2" casing. Landed at 180 feet. Laid down 95 joints of 1-1/2" tubing and 95 joints 2-3/8" tubing. Shut well in and released rig.