


SANTA FE

U. S. LAND OFFICE

SERIAL NUMBER

LEASE OR PERMIT TO PROSPECT

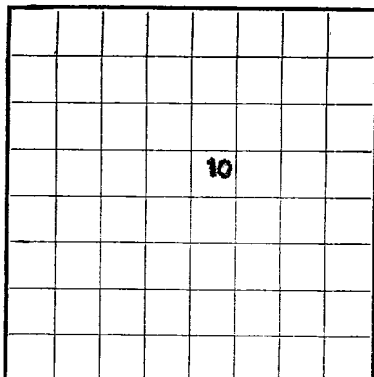

LOCATE WELL CORRECTLY

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

LOG OF OIL OR GAS WELL

Company **DAVIS OIL COMPANY** Address **1020 MIDLAND SAVINGS BUILDING**
Lessor or Tract **LOOKS** Field **WILCOAT** State **NEW MEXICO**
Well No. **1-8** Sec. **10** T. **21N** R. **6W** Meridian **NMPN** County **NEW MEXICO**
Location **660** ft. **NXX** of **S** Line and **660** ft. **E** of **W** Line of **SECTION 10** Elevation **6755**
(Derrick floor relative to sea level)

The information given herewith is a complete and correct record of the well and all work done thereon so far as can be determined from all available records.

Signed **Harrell Budd** Title **HARRELL BUDD-CONSULTING GEOLOG**Date **MAY 5, 1958**

The summary on this page is for the condition of the well at above date.

Commenced drilling **APRIL 9**, 19**58** Finished drilling **APRIL 30**, 19**58**

OIL OR GAS SANDS OR ZONES

(Denote gas by G)

No. 1, from **NONE** to _____ No. 4, from _____ to _____
No. 2, from _____ to _____ No. 5, from _____ to _____
No. 3, from _____ to _____ No. 6, from _____ to _____

IMPORTANT WATER SANDS

No. 1, from **NONE** to _____ No. 3, from _____ to _____
No. 2, from _____ to _____ No. 4, from _____ to _____

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated	Purpose
8 5/8					205			SURFACE PIPE

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
8 5/8	205	200 SACKS	CIRCULATED		

PLUGS AND ADAPTERS

Heaving plug—Material **NONE** Length _____ Depth set _____
Adapters—Material **NONE** Size _____

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out
NONE						

TOOLS USED

Rotary tools were used from **0** feet to **500** feet, and from _____ feet to _____ feet
Cable tools were used from _____ feet to _____ feet, and from _____ feet to _____ feet

PLUGGED AND ABANDONED**APRIL 30,****58**

DATES

Put to producing _____, 19____

The production for the first 24 hours was _____ barrels of fluid of which _____% was oil; _____% emulsion; _____% water; and _____% sediment. Gravity, °Bé. _____

If gas well, cu. ft. per 24 hours _____ Gallons gasoline per 1,000 cu. ft. of gas _____

Rock pressure, lbs. per sq. in. _____

EMPLOYEES

_____, Driller _____, Driller
_____, Driller _____, Driller

FORMATION RECORD

FROM—	TO—	TOTAL FEET	FORMATION
0	825	825	TERTIARY
825	975	150	KIRTLAND
975	1092	117	FRUITLAND
1092	1283	191	PICTURED CLIFFS
1283	1830	547	LEWIS
1830	3434	1604	CLIFF HOUSE - MENEFEE
3434	3582	148	POINT LOOKOUT
3582	4520	938	UPPER MANGOS
4520	4712	192	GALLUP
4712	5008	296	MIDDLE MANGOS
5008	5127	119	SANABEE
5127	5346	219	LOWER MANGOS
5346	5400	64	GREENHORN
5400	5448	48	GRANEROS
5448	5745	297	DAKOTA
5745	5801	56	MORRISON

{OVER}

16-43094-4

FOLD MARK

BTW RAB 94-100-70-111

THE LOOKS 3-B WAS SPUN ON BETWEEN 9, 1957 WITH A SMALL RIG
WAS MOVED ONTO THE LOCATION AND AFTER SETTING SURFACE PIPE COMMENCED DRILLING ON
APRIL 9, 1958. THE HOLE WAS DRILLED TO 5801 FEET ON APRIL 29, 1958. THERE
WERE NO SIGNS OF TREES. THE HOLE WAS LOGGED BY FORTUNESENER WELL SURVEYING
CORPORATION AND PLUGGED AND ABANDONED ON APRIL 30, 1958.

It is of the greatest importance to have a complete history of the well. Please state in detail the dates of redrilling, together with the reasons for the work and its results. If there were any changes made in the casing, state fully, and if any casing was "sidetracked" or left in the well, give its size and location. If the well has been dynamited, give date, size, position, and number of shots. If plugs or bridges were put in to test for water, state kind of material used, position, and results of pumping or bailing.

HISTORY OF OIL OR GAS WELL

16-48094-Z U. S. GOVERNMENT PRINTING OFFICE

[illegible]