

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. S. F. 079335
Unit R. C. White

SUNDRY NOTICES AND REPORTS ON WELLS

RECEIVED

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

R. C. White

November 30, 1956

Well No. 1 is located 1900 ft. from N line and 1900 ft. from W line of sec. 7

N 1/4 Section 7
(1/4 Sec. and Sec. No.)

21N
(Twp.)

4N
(Range)

R. M. P. M.
(Meridian)

Wilcox
(Field)

Sandoval
(County or Subdivision)

NEW MEXICO
(State or Territory)


The elevation of the derrick floor above sea level is ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Cut off 5-1/2" casing at 855'. Pumped cement through 5-1/2" casing and set cement plug from 755' to 855'. Pulled 5-1/2" casing to 369' and set cement plug from 329' to 369'. Finished pulling 5-1/2" casing and set 25' cement plug in top of 10-3/4" surface casing.

Set permanent marker - 4" pipe 4' above ground level - cemented.

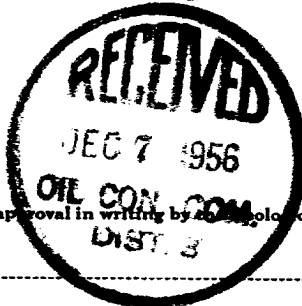

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shelly Oil Company

Address Box 426

Farmington, New Mexico

By

P. E. Cooper

Title

District Foreman

[illegible]