

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

Tribal #422

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Jicarilla

7. UNIT AGREEMENT NAME

-

8. FARM OR LEASE NAME

Jicarilla

9. WELL NO.

N-1

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLE. AND
SURVEY OR AREA

Section 11-22N-5W

12. COUNTY OR PARISH

Sandoval

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☐ GAS WELL ☐ OTHER Dryhole

2. NAME OF OPERATOR

Woods Petroleum Corporation

3. ADDRESS OF OPERATOR

P. O. Box 18667, Oklahoma City, Oklahoma, 73118

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

660' FWL & 660' FSL (SW SW)

14. PERMIT NO.

-

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6832' KB, 6818' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*


(Other)

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

We drilled a 13-3/4" hole to 270', set 269' 9-5/8" surface casing, and cemented to surface. We reached a total depth of 6,365', driller's measurement, on 12-11-71. Evaluation using Compensated Formation Density Log, Dual Induction-Laterolog, Gamma Ray-Neutron, and drill stem tests showed an absence of prospective pay sands. Permission to plug and abandon was obtained from U.S.G.S. Plugs were placed as follows:

43 sack plug	6370-6150'
39 sack plug	4700-4600'
27 sack plug	5750-5650'
10 sack plug	3200-3250
Bridge plug at	1450'
220 sack plug	1420 - surface.

Welded on steel plate and marked.

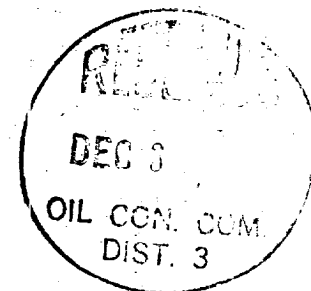

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Vice President

DATE December 23, 1971

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side