

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE\*  
(Other instructions on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> Wildcat		5. LEASE DESIGNATION AND SERIAL NO. NM 9519
2. NAME OF OPERATOR Rijan Oil Company, Inc.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME N/A
3. ADDRESS OF OPERATOR 20 First Plaza, Suite 402, Albuquerque, NM 87102		7. UNIT AGREEMENT NAME N/A
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface  1980' fnl, 660' fel		8. FARM OR LEASE NAME Fed. 26 Rijan Oil Company, Inc.
14. PERMIT NO. U.S.G.S.		9. WELL NO. Federal No. 1-26
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6795' GR		10. FIELD AND POOL, OR WILDCAT Wildcat
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA T19N, R3W, Sec. 26
		12. COUNTY OR PARISH Sandoval
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON\* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) Supplemental ☒

REPAIRING WELL ☐


ALTERING CASING ☐

ABANDONMENT\* ☐

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) \*

Spudded 12 $\frac{1}{4}$ " hole at 11:00 PM, 1-15-79.  
Drilled to 200'. Ran 4 joints of 9 5/8"  
32# H-40 casing. T.E. 170', set @182'.  
Cemented with 190 sacks Class A 3% CaCl<sub>2</sub>.  
POB 9:00 AM 1-16-79. Cement circulated.  
Tested BOP with 1000 PSI for 30 min. and  
held ok.

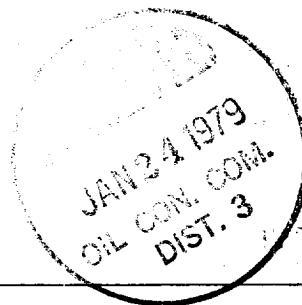

RECEIVED

JAN 22 1979

18. I hereby certify that the foregoing is true and correct

SIGNED

*W. R. Davis*

TITLE Petroleum Engineer

DATE 1-17-79

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: