

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐

2. NAME OF OPERATOR
Northwest Exploration Company

3. ADDRESS OF OPERATOR
P.O. Box 90, Farmington, N.M. 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 2035 FNL & 1105 FEL
AT TOP PROD. INTERVAL: 2035 FNL & 1105 FEL
AT TOTAL DEPTH: 2035 FNL & 1105 FEL

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) 4-1/2" csg set

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐
☐
☐

5. LEASE
NM 1682, NM 27163, NM 25308

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Natani

9. WELL NO.
#20

10. FIELD OR WILDCAT NAME
Rusty Chacra

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec 34, T22N, R6W

12. COUNTY OR PARISH
Sandoval

13. STATE
N.M.

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
**7018' KB

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

JUN 22 1982

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*
6-9-82 Drilling ahead

6-10-82 & 6-11-82 Reached TD of 2180'. RU Gearhart to run logs. Ran DIL/SP & CNL/FDC/GR Logs. TIH & LDDP & DC. Ran 51 jts of 4-1/2", 10.5#, K-55, ST&C seamless csg & set @ 2144' KB. Howco cmt'ed w/ 195 sx 65/35 poz w/ 12% gel & 12-1/2# gils/sx (476 cu.ft). Tailed w/ 100 sx 65/35 poz w/ 6% gel & 12-1/2# gils/sx (198 cu.ft). Plug displaced w/ 33.5 bbls wtr & down at 0500 hrs 6-11-82. Circ out 46 bbls cmt. Rig released 0900 hrs 6-11-82.

NOW WAITING ON COMPLETION.

**NOTE: Elevation was incorrectly stated on all previous Sundry Notices. The correct KB Elevation should be 7018' KB instead of 7020' KB as reported.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Donna J. Brace TITLE Production Clerk DATE June 17, 1982
Donna J. Brace


(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY

TITLE _____

DATE _____

djb/ 3

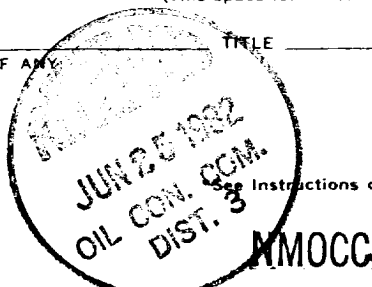

Instructions on Reverse Side

ACCEPTED FOR RECORD

JUN 21 1982

FARMINGTON DISTRICT

BY SM