

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office 07886
Lease Canyon Largo Unit
Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

X

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 5

59

Well No. 75 is located 1000 ft. from XXX line and 1550 ft. from XXX line of sec. 21
N.W. Sec. 21 S.W. N.M.P.M.


Otero P.C. (Field) (Twp. Rio Arriba) (Meridian) New Mexico
6081 (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 3-2-59. Total Depth 2463'.
Run 59 joints 5 1/2", J-55, 15.50#, casing (2452') set at 2462' with 15 sacks regular cement, 15 sacks Pozmix, 25 Gel, 7 cu. ft. Stratacrete followed with 50 sacks regular cement.
Held 1000# for 30 minutes.
Top of cement by temperature survey at 1930'.

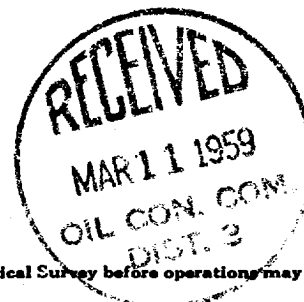

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company
Address Box 797
Farmington, New Mexico
By ORIGINAL SIGNED J.J. TILLERSON
Petroleum Engineer
Title _____

1000

1000

1000

1000

1000

1000

1000