

(SUBMIT IN TRIPLICATE)

Indian Agency **Jicarilla**
Dulce, New Mexico

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee _____
Lease No. **Jicarilla Tribal**
Contract 37-A
Tract 82

X			

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

May 15, 1957, 19

Well No. **1-13** is located **990** ft. from **S** line and **990** ft. from **W** line of sec. **13**
SW/4 Section 13 **T-24-N** **R-5-W** **NMPM**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Otero PC (Ext) **Rio Arriba** **New Mexico**
(Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is **6611** ft. (**6604 GL**)

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Total Depth 2518'. Ran Schlumberger Survey. Set 2506' of 5 1/2" 14# J-55 casing at 2512' and cemented with 100 sax. Plug down at 3 P.M. Friday May 10th, W-O-C.

Ran Welox Log. Perforated casing 2462 - 2456 and 2432 - 2410. Water frac with 40,000# sand. Well flowing at 11:45 AM Monday May 13th. Shut well in for tests at 7 P.M.

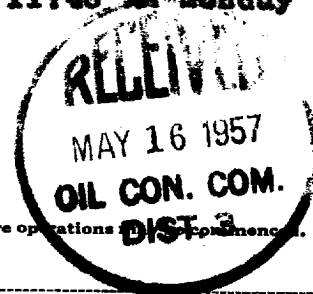

I understand that this plan of work must receive approval in writing by the Geological Survey before operations are commenced.

Company **Ken Blackford**
P. O. Box 1537
Address **Farmington, New Mexico**

By *Ken Blackford*
Title **Operator**

