


(SUBMIT IN TRIPPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **SF**
Lease No. **078886**
Unit **Canyon Largo**
14-08-001-1059

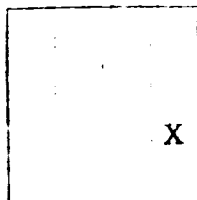

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	REPORT OF WATER SHUT OFF
NOTICE OF INTENTION TO CHANGE PLANS	REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT OFF	REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	REPORT OF RE-PIPING OR REPAIR
NOTICE OF INTENTION TO FLOOD OR ACIDIZE	SUMMARY REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PUMP OR WATER FLOOD	SUMMARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

RECEIVED
APR 25 1963

INDICATE ABOVE BY CHECK MARKS DATE RECEIVED NOTICE FOR OTHER DATA

U.S. GEOLOGICAL SURVEY
ALBUQUERQUE, NEW MEXICO
APR 19 63

April 23

Well No. **124** is located **1650** ft. from **xx** and **835** ft. from **E** line of sec. **17**
NE/4 SE/4 Section 17 **24N** **6W** **NMPM**
Devils Fork Gallup **Rio Arriba** **New Mexico**

The elevation of the derrick floor above sea level is **6606** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

April 13, 1963 Total Depth 5620'.

Ran 177 joints, 4-1/2", 10.50#, J-55 Casing (5608.73') set at 5619.73' with 75 sacks regular cement, 75 sacks Pozmix, 2% gel, 25# Gilsonite/sack--1st stage.
2nd stage--50 sacks regular, 50 sacks Pozmix, 2% gel.

Held 1000#/30 Minutes.
Two-stage collar at 2275'.

Second Stage top of cement by temperature survey at 1800'.
First Stage top of cement by calculation at 4450'.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **El Paso Natural Gas Products Company**
Address **Post Office Box 1560**
Farmington, New Mexico

ORIGINAL SIGNED BY: **JOHN J. STROJEK**

By
Title **Petroleum Engineer**