

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Budget Bureau No. 42-R358.4.  
Approval expires 12-31-60.

Land Office **SF**  
Lease No. **078877**  
Unit **Canyon Largo**  
**14-08-001-1059**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	<b>X</b>
NOTICE OF INTENTION TO ABANDON WELL.....	<b>Sandoli Frec.</b>	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 29, 1963

Well No. **122** is located **790** ft. from **S** line and **1630** ft. from **E** line of sec. **8**  
**SW/4 SE/4 Section 8** **24N** **6W** **NMPM**  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
**Devils Fork Gallup** **Rio Arriba** **New Mexico**  
(Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is **6507** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

March 27, 1963 Total Depth **5575'**. Clean Out Total Depth **5545'**.

**Sandoli fractured Gallup through perforated interval 5514'-5532' (4 Sh./Ft.)**  
**with 39,483 gals. lease crude and 40,000 sand with 0.050/Gal. Adomite Mark II and**  
**8 Gals./1000 Gals. J-105 Friction Reducing Agent. Breakdown pressure 3300 psi; Maximum**  
**treating pressure 3100 psi; Average treating pressure 3000 psi. Injection Rate: 28.50 BPM.**  
**Flush with 3906 gals. lease crude. Spotted 250 Gals. 7-1/2% BDA before fracture.**

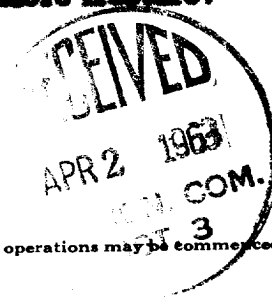

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **El Paso Natural Gas Products Company**

Address **Post Office Box 1560**  
**Farmington, New Mexico**

ORIGINAL SIGNED BY: JOHN J. STROJEK

By \_\_\_\_\_  
 Title **Petroleum Engineer**