

(SUBMIT IN TRIPLICATE)

Indian Agency Alcarilla

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee Alcarilla Tribal

Lease No. Contract 111

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

April 23rd, 1957

Well No. 2-K is located 990 ft. from [N] line and 1600 ft. from [W] line of sec. 5

NE/4 NW/4 Sec. 5
(1/4 Sec. and Sec. No.)


24W
(Twp.)

4W
(Range)

N.H.P.M.
(Meridian)

S. Blanco PC Ent.
(Field)

Rio Arriba
(County or Subdivision)

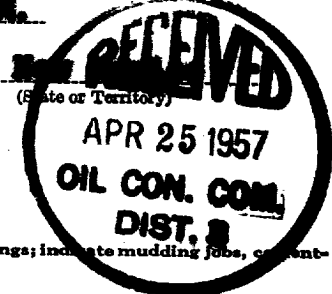

The elevation of the derrick floor above sea level is 6705 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

3-28-57 TD 101' NMB. Set 3 joints 92' of 8-5/8" CD 24# 1-55 casing at 101' NMB with 70 sacks cement, circulated to surface.

4- 3-57 Cement washed out around surface casing. 12 hours after cementing 5-1/2" casing, recomputed 8-5/8" casing with 87 sacks cement. Hold 5-1/2" casing in elevators for 20 hours after cementing.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company EL PASO NATURAL GAS COMPANY

Address Box 997

Farmington, New Mexico

By

Title Senior Petroleum Engineer