

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐		5. CASE DESIGNATION AND SERIAL NO. CONTRACT No. 121	
2. NAME OF OPERATOR CONTINENTAL Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME JICARILLA APACHE	
3. ADDRESS OF OPERATOR Box 460, Hobbs, N.M. 88240		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1700' FSL & 1190' FWL OF SEC. 2		8. FARM OR LEASE NAME AXI APACHE "N"	
14. PERMIT NO.		9. WELL NO. 10	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 7288' GR		10. FIELD AND POOL, OR WILDCAT AXI APACHE - S. BLANCO MESA VERDE	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 2, T-25N, R-4W	
		12. COUNTY OR PARISH RIO ARriba	
		13. STATE N.M.	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANS ☐
(Other) ☐	



SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
(Other) ☒ INTERIM REPORT	

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

SEE ATTACHED

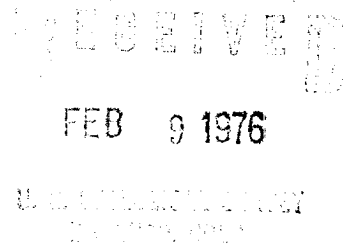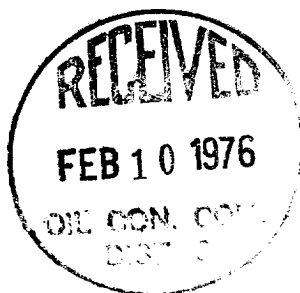

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

DATE

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

USGS (Dunsmuir) - 5, To Rio, Dunsmuir, Fred

After installation of 5 1/2" csg. on 12-1-75, operating
temp. suspended pending completion. On 10-30-75, perf.
5 1/2" csg w/1 JSPE @ 5502', 06', 10', 14', 18', 22', 26', 30', 34'
5611', 65', 72', 82', 91', 92', 5730', 36', 5831', 38', 72',
78', 5902', 10', 50', 6009' & 6016'. Broke down parts
w/1000 gals. 7 1/2% acid. Flow in 3 stages: 1st stage,
4000 E-2 Flow w/50#/1000 gals T-160 & 50#/1000 "ADONITE
AQUA", followed w/25000 gals E-2 Flow w/25#/1000 gals
"ADONITE AQUA" & 50,000# 20/40 sd. w/ply set @
5777'; 2nd stage, spot 500 gals 7 1/2% acid
across perfs 5611' - 5736'. Broke down parts w/1000
gals 7 1/2% acid; 3rd stage, Broke down parts
5502' - 34' w/1000 gals 7 1/2% acid. Pump 610 bbls
fluid & 40,000# sd. Suspended for clean up &
suspended operations on 11-3-75 until testing.
On 1-19-76, well was logged off. Set RBP @
5578' & squeezed perfs 5502' - 5534' w/50
sk. cnt. wcc 18 hrs. Drilled out cnt & tested
w/850#, held ok. Removed RBP & re-run
 tubing. Open temp. suspended pending further
testing.

FEB 9 1976

U.S. DEPT. OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

