

6 - USGS

1 - McHugh

1 - File

Form 9-331
Dec. 1973Form Approved.
Budget Bureau No. 42-R1424

**UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY**

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☒ well other ☐

2. NAME OF OPERATOR
Jerome P. McHugh

3. ADDRESS OF OPERATOR
Box 208, Farmington, NM 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 970' FNL - 1850' FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☐

(other) _____


SUBSEQUENT REPORT OF:

☒ 4½" csg & cementing

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Laid down 86 jts. 4½" O.D., 10.5#, 8 Rd, ST&C csg. T.E. 3590.41' set at 3590' GL. Cemented by Howco w/ 10 bbls mud flush followed by 150 sx 50-50 pos w/ 4% gel & 12½# Gilsonite per sx followed by 75 sx class "B" w/ 12½# Gilsonite per sx. Good mud returns through-out job. P.O.B. @ 4:00 a.m. 12-1-80.

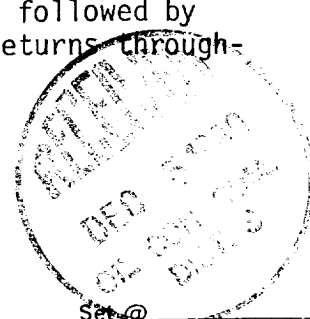

Subsurface Safety Valve: Manu. and Type _____

Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED _____

ACCEPTED FOR RECORD

TITLE _____

Agent

DATE

12-2-80

(This space for Federal or State office use)

APPROVED BY _____

CONDITIONS OF APPROVAL, IF ANY:

FARMINGTON DISTRICT

NMOC