

X			

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 078628 - A
Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	X
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

SKELLY-TEEL-GOVERNMENT #1-15: January 28, 1957

Well No. 1-15 is located 990 ft. from N line and 990 ft. from W line of sec. 15

NW/4 Section 15 24N 6W NMPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

WC (Canyon Largo) Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6710' KB ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1-24-57 PERFORATED: 2317-2332 w/8 Bullets/ft.

1-25-57 SAND-WATER FRAC'D PERFS: Mixed 30,000# Sand w/24,250 gallons water and flushed w/6300 gallons water. Max pressure 1800#, min pressure 1250#, FP 750#. Injection rate 44 BPM. Complete @12:00 Noon.

1-25-57 Swabbing and cleaning out after frac job.


I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company The Superior Oil Company

Address Midland, Texas

By W. J. Mathis (Wm. J. Mathis)

Title Petroleum Engineer

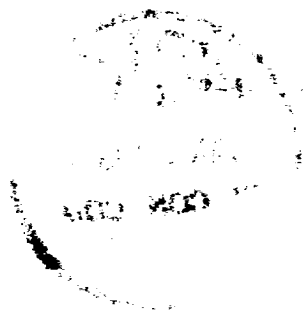

1.6 .)