


STATE OF NEW MEXICO
OIL CONSERVATION
COMMISSION
DISTRICT NO. 3
Phone 99 P. O. Box 697
AZTEC, NEW MEXICO

(SUBMIT IN TRIPLICATE)
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office ST 079035-1
Lease No. NE 03381
Unit 114/114/

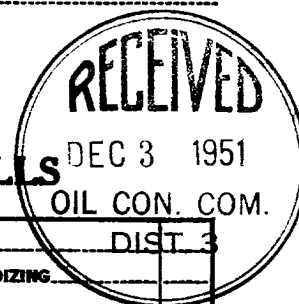

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	DIST 3
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	1
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

(Formerly No. 1)

November 29, 19 51

Well No. 1-134 is located 660 ft. from [N] line and 1980 ft. from [W] line of sec. 10
NE 1/4 S. 1/4 26N 6W RMPX
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Alibon Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6550 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Plugged back to 6900. Cut tubing at 5815. Milled tubing and cleaned cement off casing. Set lane wells bridge plug at 6980. Ran Gamma Ray Neutron Survey. Perforated 7" casing with 2 holes at 6714. Ran water shut off test 6704 to 6900. Tested o.k. Perforated 12 holes per foot 6728 to 6746 and 6752-6770. Total 360 shots. Ran 2 3/8"-4.20# tubing and displaced mud with oil. Swabbing to test. Swabbed 5 bbls. per hour. Milled well and treated with 500 gals. acid. Swabbed with no results. Loaded hole with oil. Waiting on cutting tool to remove section of casing.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.


Company Lovry et al Operating Account

Address Room 213 616 East Central Avenue

Albuquerque, New Mexico

By W. F. Richardson

Title Business Manager

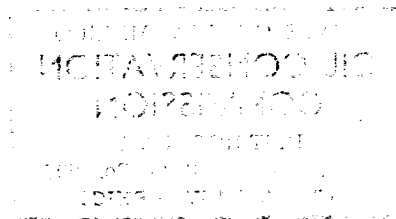

DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
UNITED STATES
(SUBMIT IN TRIPlicate)

Land Office _____
Lease No. _____
Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	
NOTICE OF INTENTION TO CHANGE PLANS	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	
NOTICE OF INTENTION TO PULL OR ALTER CASING	
NOTICE OF INTENTION TO ABANDON WELL	
SUPPLEMENTARY WELL HISTORY	
SUBSEQUENT REPORT OF ABANDONMENT	
SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
SUBSEQUENT REPORT OF ALTERING CASING	
SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
SUBSEQUENT REPORT OF WATER SHUT-OFF	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. _____ is located _____ ft. from _____ line and _____ ft. from _____ line of sec. _____
(Twp.) (Range) (Meridian)
(State or Territory) (County or Subdivision) (Twp.)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective as well as flow sizes, weights, and lengths of proposed casing; indicate mudlogging jobs, cementing points, and all other important proposed work)

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company _____
Address _____
By _____
Title _____