

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 0051
Unit Breach "E"

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 28, 1963

Well No. D-50 is located 990 ft. from N line and 990 ft. from E line of sec. 5
NE, NE, Section 5 26 N 6 W N M P M
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Basin Dakota Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is 6561 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

TD 7624. Cemented 4 1/2" OD 11.6# J-55 Casing at 7610' as follows:
Thru shoe with 150 sacks 12% gel cement containing 12 1/2# gilsonite per sack followed by 100 sacks latex cement.
Thru stage collar at 5502' with 350 sacks 12% gel cement containing 12 1/2# gilsonite per sack followed by 50 sacks cement neat. Closed stage collar with 3000# pressure. Finished cementing 11-14-62.

12-15-62 tested casing with 4000# pressure. No decrease in 30 minutes.

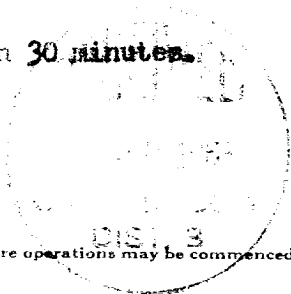

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Caulkins Oil Company
Address Box 780
Farmington, New Mexico

By Franklin Sney
Title Superintendent