

Form 100-1
(Rev. 1-5-60)

(SUBMIT IN TRIPlicate)

Indian Agency Jicarillo Apache

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee Socony Mobil

Lease No. Contract 9-7

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 25, 1962, 19

Well No. 5 is located 990 ft. from N line and 990 ft. from W line of sec. 5

5 26N 3W NMPM
(Section No.) (Twp.) (Range) (Meridian)

Tapicito Pictured Cliffs Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)


Basin Dakota

The elevation of the derrick floor above sea level is 7211 ft. KB

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding points, and all other important proposed work)

Pulled wire gas to 8,500'. Ran 5-1/2" 15.5 & 17# liner. from 4063 to 8498'. Cemented with 230 sx Diacel cement followed by 100 sx 50-50- posmix cement. Bumped plug with 1000 psi, held OK. Plug down 11:20 AM, 8-10-62. 9-10-62 set squeeze tool at 3930'. Squeezed with 150 sx. Drilled out to 8487. Pressure test to 2,000 psi 15 minutes - held OK.

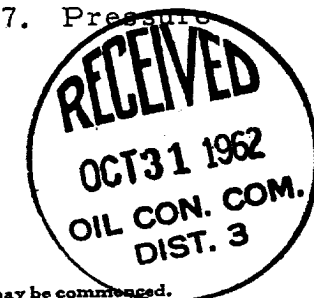

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Consolidated Oil & Gas, Inc.

Address 4126 East Mexico Avenue

Denver 22, Colorado

By W. Sullivan

Title Chief Engineer