

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079161
Unit Candado

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Subsequent Report of Sandfrac Treatment</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

November 30th, 19 56

Well No. 12 is located 1650 ft. from N line and 290 ft. from E line of sec. 3


NE/4 SE/4 Sec. 3 26N 7W N.M.P.M.
($\frac{1}{4}$ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
South Blanco Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6525 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

11-20-56 TD 2800'. Flowing 197 MCF/day. Sand-oil treated from 2730' to 2800' with 17,000 gallons diesel oil and 30,000# sand, flushed with 3,000 gallons diesel oil. Breakdown pressure 1100#, treating pressure 1000#, average injection rate 36.5 barrels per minute. After 16 hours flowing 3,476 MCF/day.

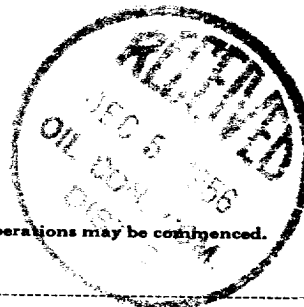

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company CANDADO PRODUCTION COMPANY

Address 716 First National Bank Bldg.

Phoenix, Arizona

By George D. Hodge

Title President