

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☒ well other

2. NAME OF OPERATOR
Tenneco Oil Company

3. ADDRESS OF OPERATOR
P.O. Box 3249, Englewood, CO 80155

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1640'FSL, 1502'FEL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:


16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐

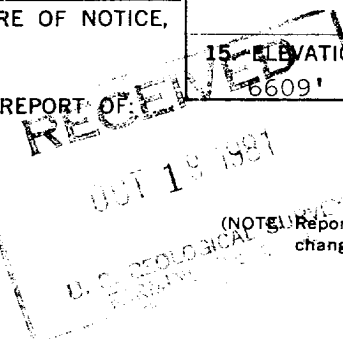

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

9/9/81 - Fishing
9/10/81- POOH w/ tbg, fish, and fishing tools. RIH w/ tbg and bullplug to check pkr clearance ok. POOH w/ tbg and bull plug.
9/11/81- Set model D pkr on wire line @ 4185'. Hydrottested, RIH w/ tbg, mule shoe, F nipple, seal assy, and blast joint. Found 5 bad ft. RDH landed 2 3/8" tbg @ 7352 and 1 1/4" tbg @ 4103.
RDMOSU



Subsurface Safety Valve: Manu. and Type _____ Set @ _____

18. I hereby certify that the foregoing is true and correct

SIGNED David M. Lane TITLE Production Analyst DATE October 12, 1981

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE OCT 22 1981
CONDITIONS OF APPROVAL, IF ANY: