

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANGEMENT

FORM APPROVED
OMB No. 1004-0135
Expires November 30, 2000

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an Abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.
CONTRACT 110

6. If Indian, Allottee or tribe Name
JICARILLA

7. If Unit or CA/Agreement, Name and/or No.


8. Well Name and No.
JICARILLA A 2E

9. API Well No.
30-039-22581

10. Field and Pool, or Exploratory Area
TAPACITO-GALLUP & Basin Dakota

11. County or Parish, State
RIO ARRIBA, NM

MIT IN TRIPLICATE - Other instructions on reverse side

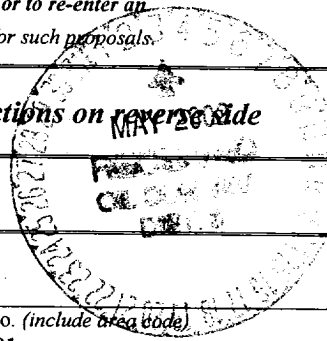

1. Type of Well
 Oil Well Gas Well Other

2. Name of Operator
BP AMERICA PRODUCTION COMPANY

3a. Address ATTN: C. HLAVA
P.O. BOX 3092 HOUSTON, TX 77253-3092

3b. Phone No. (include area code)
281-366-4081

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
SECT 18 T26N R5W 1120' FSL 1520' FEL Unit letter O

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OR NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION		
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Water Disposal
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water shut-Off
			<input type="checkbox"/> Well Integrity
			<input type="checkbox"/> Other <u>Re-enter DA; DHC</u>

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomple horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recomple in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.

BP America Production Company requests permission to re-enter the Basin Dakota (71599) and downhole commingle production with the existing Tapacito Gallup (58090) per the attached procedure. Production is proposed to be allocated based on the subtraction method using the projected future decline for production from the Tapacito Gallup. That production shall serve as a base for production subtracted from the total production for the commingled well. The balance of the production will be attributed to the Basin Dakota. Commingling Production Downhole in the subject well from the propped pools with not reduce the value of the total remaining production.

DHC 999 on April 20, 1994

14. I hereby certify that the foregoing is true and correct
Name (Printed/typed)
Cherry Hlava Title **Regulatory Analyst**

Signature Cherry Hlava Date **April 16, 2002**

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by **/s/ Patricia M. Hester** Title **Lands and Mineral Resources** Date **APR 26 2002**

Conditions of approval, if any, are attached. Approval of this notice does not warrant or Certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Office

Jicarilla A 2E
Unit O Sec 18 T26N-R5W
Rio Arriba County, NM
API 30-039-22581

April 8, 2002

Reason for work

Unable to swab well back to production after casing leak repair.

Description

Downhole commingle the GP and DK. Install rod pump.

Procedure:

1. MIRU SU. Record TP and CP. ND tree, NU BOP.
2. Tag for fill. RU air package. C/O sand to RBP at 7061'.
POOH with tbg.
3. RIH with retrieving tool and pull RBP.
4. RIH with bit and C/O to 7548' PBSD.
5. RIH rabbiting following production string to API drift:
a)
6. Land EOT at 7530'. Set TAC. Hang off tbg in tension.
7. ND BOP, NU tree.
8. RIH with following rod string:
a)
9. Seat pump and test tbg to 500 psi. Check pump action.
10. RDMO SU.

Allen Kutch

281-366-7955 office
281-366-0700 fax
888-788-6522 pager

30-039-22581

Jicarilla A 2E Forecast

Tapacito Gallup Future Decline

Date	(Mcf/d)	Date	(Mcf/d)	Date	(Mcf/d)
5/1/2002	346	5/1/2006	179	5/1/2010	93
6/1/2002	341	6/1/2006	177	6/1/2010	92
7/1/2002	337	7/1/2006	174	7/1/2010	90
8/1/2002	332	8/1/2006	172	8/1/2010	89
9/1/2002	327	9/1/2006	170	9/1/2010	88
10/1/2002	323	10/1/2006	167	10/1/2010	87
11/1/2002	318	11/1/2006	165	11/1/2010	85
12/1/2002	314	12/1/2006	163	12/1/2010	84
1/1/2003	310	1/1/2007	161	1/1/2011	83
2/1/2003	306	2/1/2007	158	2/1/2011	82
3/1/2003	302	3/1/2007	156	3/1/2011	81
4/1/2003	297	4/1/2007	154	4/1/2011	80
5/1/2003	294	5/1/2007	152	5/1/2011	79
6/1/2003	289	6/1/2007	150	6/1/2011	78
7/1/2003	286	7/1/2007	148	7/1/2011	77
8/1/2003	282	8/1/2007	146	8/1/2011	76
9/1/2003	278	9/1/2007	144	9/1/2011	75
10/1/2003	274	10/1/2007	142	10/1/2011	74
11/1/2003	270	11/1/2007	140	11/1/2011	73
12/1/2003	267	12/1/2007	138	12/1/2011	72
1/1/2004	263	1/1/2008	136	1/1/2012	71
2/1/2004	259	2/1/2008	134	2/1/2012	70
3/1/2004	256	3/1/2008	133	3/1/2012	69
4/1/2004	252	4/1/2008	131	4/1/2012	68
5/1/2004	249	5/1/2008	129	5/1/2012	67
6/1/2004	245	6/1/2008	127	6/1/2012	66
7/1/2004	242	7/1/2008	125	7/1/2012	65
8/1/2004	239	8/1/2008	124	8/1/2012	64
9/1/2004	236	9/1/2008	122	9/1/2012	63
10/1/2004	232	10/1/2008	120	10/1/2012	62
11/1/2004	229	11/1/2008	119	11/1/2012	62
12/1/2004	226	12/1/2008	117		
1/1/2005	223	1/1/2009	116		
2/1/2005	220	2/1/2009	114		
3/1/2005	217	3/1/2009	112		
4/1/2005	214	4/1/2009	111		
5/1/2005	211	5/1/2009	109		
6/1/2005	208	6/1/2009	108		
7/1/2005	206	7/1/2009	106		
8/1/2005	203	8/1/2009	105		
9/1/2005	200	9/1/2009	104		
10/1/2005	197	10/1/2009	102		
11/1/2005	194	11/1/2009	101		
12/1/2005	192	12/1/2009	99		
1/1/2006	189	1/1/2010	98		
2/1/2006	187	2/1/2010	97		
3/1/2006	184	3/1/2010	95		
4/1/2006	182	4/1/2010	94		

Jicarilla A 2E
 Rio Arriba County, NM
 Unit O Sec 18 T26N-R5W
 Run 54

4-10-2002
 ATK

KB:

