

CASE

Contract 154

INDIAN, ALLOTTEE OR TRIBE NAME

Jicarilla Apache

UNIT AGREEMENT NAME

FARM OR LEASE NAME

Jicarilla Apache

WELL NO.

14E

FIELD OR WILDCAT NAME

Basin Dakota *Blanco m*

SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 34, T26N, R5W

COUNTY OR PARISH

Rio Arriba

STATE

New Mexico

API NO.

30-039-22591

ELEVATIONS (SHOW DF, KDB, AND WD)


6,566' GL, 6,579' KB

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

State all pertinent details, and give pertinent dates, if directionally drilled, give subsurface locations and pertinent to this work.)\*

COMPLETION REPORT

Attachments

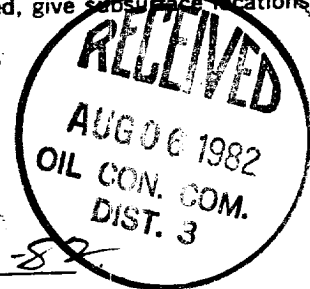

*7-23-82*

Set @ \_\_\_\_\_ Ft.

endent

DATE

*7-27-82*

(state office use)

DATE

ACCEPTED FOR RECORD

AUG 5 1982

Reverse Side

FARMINGTON DISTRICT

BY

*SMH*

JICARILLA APACHE #14E

7-19-82 SI. STATIC.

7-20-82 MOVED IN DRAKE WORKOVER UNIT, FRAC TANK ON LOCATION. RIGGED UP UNIT. MIXED KCL WTR, UNABLE TO KILL WELL W/RIG PUMP. SDFN.

7-21-82 RU WESTERN RODMASTER. PMPD 40 BBLS 2% KCL WTR DOWN TBG. INSTALLED BOP. TBG STRING WT = 35,000#, PKR SHEAR RELEASE = 20,000#. PULLED 65,000#, PKR DID NOT SHEAR. PULLED 69,000# WAS ABLE TO MOVE PKR UPHOLE APPROX 6'. REMOVED TBG HANGER & INSTALLED 10 SUB & BEGAN WORKING PKR. PKR WILL MOVE DOWNHOLE EASILY, BUT NOT UP. WORKED PKR UNTIL 5:00 PM. SDFN.

7-22-82 PRESS ON BOTH TBG & CSG. PMPD 40 BBLS KCL WTR DOWN TBG. PULLED 65,000# ON TBG. PKR WOULD NOT PULL UPHOLE. PMPD 35 BBL KCL WTR DOWN CSG. WORKED PKR UP & DOWNHOLE. PKR PULLED FREE, HAD TO KILL WELL W/KCL WTR SEVERAL TIMES WHILE PULLING OUT OF HOLE.

7-23-82 BAKER UNABLE TO REPAIR PKR. HAD NEW PKR BROUGHT TO FARM. RIH W/EXPENDABLE CHECK, HYDROD-TRIP SUB, "R" NIPPLE, MODEL "FH" PKR, "F" NIPPLE BLAST JTS, SLIDING SLEEVE & TBG STRING. SET PKR IN COMPRESSION (9,000#), INSTALLED TREE. PMPD 10 BBL KCL WTR DOWN TBG. DROPPED TRIP BALL & FINISHED LANDING TBG W/KCL WTR. SET PKR WITH 1,550# PUMP PRESS & 1,650# HYDROSTATIC (DOWNHOLE). RU SWAB LUBRICATOR TO SWAB TBG. SWABBED APPROX 40 BF WHEN SWIVEL BELOW ROPE SOCKET ON TOP OF SINKER BARS CAME LOOSE. SINKER BARS & SWAB MANDREL & CUPS FELL DOWNHOLE.