

DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other ☐

2. NAME OF OPERATOR
Curtis J. Little

3. ADDRESS OF OPERATOR
P. O. Box 2487
Farmington NM 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 790'FSL & 1670'FEL
AT TOP PROD. INTERVAL: same
AT TOTAL DEPTH: same

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

8. FARM OR LEASE NAME
Salazar

9. WELL NO.
#7

10. FIELD OR WILDCAT NAME
Ballard PC

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 27-T25N-R6W

12. COUNTY OR PARISH
Rio Arriba

13. STATE
N.M.

14. API NO.
30-039-23064

15. ELEVATIONS (SHOW DF, KDB, AND WD)
6359'GR

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☐

(other) ☐

☒

☐

☐

☐

☐

☐


☐

☐

☐

(NOTE: Report results of completion or zone change on Form 9-331-C)

U. S. GEOLOGICAL SURVEY

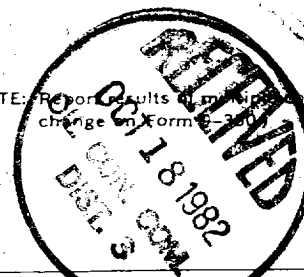

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

SPUD 5:00 pm 10-6-82.

DRLD 130'GR of 9-7/8" hole. Ran 126'GR 7" 23# csg & set at 127'GR & cemented w/ 65 sx Class B w/2% CaCl (77 cf slurry). Plug down 7:00 pm 10-6-82. Good cement circulation. Pressure tested 600 psi. Held OK. Drld out 7:00 am 10-7-82.

LOG TD 2329'GR at 11:00 pm 10-9-82. Dev. 1°@ 2345'.

LOG TOPS: Ojo Alamo	1686
Kirtland	1740
Fruitland	2012
Pictured Cliffs	2173
Lewis	2278

RAN 75 jts 2-7/8" 6.5# J-55 csg to 2322' Howco cemented w/300 sx 50-50 pos, 6% ge 6 1/2# gilsonite & 50 sx Class B Neat. Total slurry 590cf. Circulated 22 cf cement to pits: Plug down 2:00 pm 10-10-82. Pressured to 3500 psi. Held OK.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Curtis J. Little TITLE Operator DATE October 11, 1982

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

ACCEPTED FOR RECORD

*See Instructions on Reverse Side

OCT 15 1982

NMOCC

FARMINGTON

BY Jmm