

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE\*  
(Other instructions on re-  
verse side)Form approved.  
Budget Bureau No. 42-R1424.

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> <b>Water Injector</b>		5. LEASE DESIGNATION AND SERIAL NO. <b>Mims No. 1 SF 078067</b>	
2. NAME OF OPERATOR <b>Shell Oil Company</b>		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR <b>1700 Broadway, Denver, Colorado</b>		7. UNIT AGREEMENT NAME <b>Carson Unit</b>	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) <b>At surface</b> <b>660' FNL &amp; 1977.7' FWL Section 23</b>		8. FARM OR LEASE NAME	
14. PERMIT NO.		9. WELL NO. <b>21-23</b>	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) <b>6410.5' KB</b>		10. FIELD AND POOL, OR WILDCAT <b>Bisti</b>	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA <b>Section 23-T25N-R12W</b>	
		12. COUNTY OR PARISH <b>San Juan</b>	
		13. STATE <b>New Mexico</b>	

## 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	


## SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

See attachment

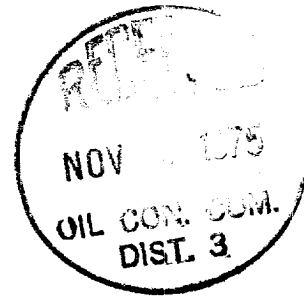

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE **Div. Opers. Engr.**DATE **11/4/75**

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

WELL PLUGGED AND ABANDONED

BISTI

SHELL OIL COMPANY

LEASE CARSON UNIT

WELL NO. 21-23 WI

DIVISION WESTERN

ELEV 6410.5 KB

FROM: 10/1 - 10/21/75

COUNTY SAN JUAN

STATE NEW MEXICO

NEW MEXICOBISTI FIELD

Carson Unit 21-23 WI

"FR" TD 4980. Removed pkr from tbg string to prep well for plug'g. MI&RU Farmington Well Serv & unseated pkr. Pulled 2-3/8 tbg & removed Bkr Model E pkr. SD for night.

OCT 01 1975

Carson Unit 21-23 WI

TD 4980. Ran in hole w/2-3/8 tbg. Tagged btm @ 4890. Pulled & LD 2 jts tbg. SI well & RD Farmington. (RDUFA)

OCT 02 1975

Carson Unit 21-23 WI

TD 4980. (RRD 10/2/75) 10/13 MI&RU csg pulling unit. Tagged btm w/tbg & pulled up to 4880' & circ'd hole w/wtr. Spt'd 20 sx cmt plug from 4880' to 4639'. Pulled tbg. Setting csg jacks to PU on 4-1/2" csg. 10/15 Attempted to break circ @ 1000'; could not circ. Attempted to break circ every 80' while pulling 4-1/2" csg; unable to break circ until POOH to 450'. Pulled out to 370'. Spt'd 100 sx plug (theoretical fill 295'). Pulled remaining 4-1/2" csg. Spt'd 10 sx plug @ surface & installed permanent abandonment marker. Well P&A 10/14/75. Rec'd 1023' of 4-1/2" csg. Released rig. FINAL REPORT

OCT 21 1975