

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe, N.M.  
Lease No. 036253  
Unit ---

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING..... <input checked="" type="checkbox"/>
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	<u>Subsequent Report of Well Completion</u> <input checked="" type="checkbox"/>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 2, 1958

Well No. Gov't 13-16A is located 1975.7 ft. from S line and 657 ft. from W line of sec. 16  
SW 16 25N 11W N.M.P.M.  
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Dist San Juan New Mexico  
 (Field) (County or Subdivision) (State or Territory)


Kelly Busting  
The elevation of the ~~center of well~~ above sea level is 6423.6 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

12-7-57 Cemented 4-1/2", 9.52 casing at 4977' with 150 sacks construction cement.  
 12-9,  
 10-57 Found top of plug at 4961'. Perforated four 1/2" holes/ft. 4938-61'.  
 12-20-57 Sand-oil fractured with 30,000 gal. crude oil and 1#/gal. 20-40 mesh sand.  
 12-21-57 Landed tubing at 4925'. Swabbed to flowing.  
 12-24-57 Initial Production: Flowing 376 B/D gross rate, 375 B/D clean rate, 0.3% out, 131 MCF/D, GOR 350, 64/64" bean.

Completed 12-24-57

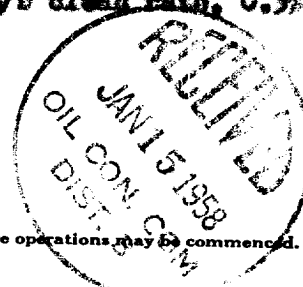

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company  
 Address 101 South Behrend Avenue  
Farmington, New Mexico

Original signed by  
 B. W. SHEPARD  
 By B. W. Shepard  
 Title Exploitation Engineer