
Form 5-331 (May 1963)						5. Lease bengnation and serial No. Mims No. 1 SF 078067			
(Do not	SUNDRY NOTI	CES AND REPO	ORTS ON or plug back to for such propose	WELLS o a different reservoir.		6. IF INDIAN, ALLOTTEE OR TR	IBE NAME		
OIL X WELL X 2. NAME OF OPP	GAS WELL OTHER		7. UNIT AGREEMENT NAME Carson Unit 8. FARM OR LEASE NAME						
3. ADDRESS OF		Colorado 80202	· ········			9. WELL NO.			
1700 Broadway, Denver, Colorado 80202 4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1960' FNL & 612.7' FWL Section 14						Bisti 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Section 14-T25N-R12W			
14. PERMIT NO.	ERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GE, etc.) 6238.1 KB					12. COUNTY OF PARISH 13. STATE San Juan New Mexico			
16.	Check Ap	propriate Box To In	dicate Natur	e of Notice, Repo	rt, or O	ther Data			
	NOTICE OF INTENTION TO:						EQUENT REPORT OF:		
TEST WATE FRACTURE T SHOOT OR A REPAIR WEI	CILIZE	PULL OR ALTER CASING MULTIPLE COMPLETE ABANDON* CHANGE PLANS		WATER SHUT-OFF FRACTURE TREATMEN SHOOTING OR ACIDIZ (Other)	ING	REPAIRING WELL ALTERING CASING ABANDONMENT* of multiple completion on We	-X		
proposed	OPOSED OR COMPLETED OPE work. If well is direction is work.)*	RATIONS (Clearly state a onally drilled, give subsu	Il pertinent det irface locations	Completion or	Recomple	tion Report and Log form.) including estimated date of st depths for all markers and a	tarting any		
		See at	tachment						

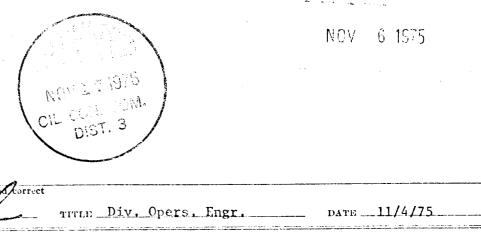

DATE __

NOV 1 1 1976

for Federal or State office use)

APPROVED BY APPROVAL, IF ANY

*See Instructions on Reverse Side

M. L. SEELINGER

WELL PLUGGED AND ABANDONED				DICTI
SHELL OIL COMPANY	LEASE	CARSON UNIT	WELL NO.	BISTI 12-14
FROM: 9/23 - 9/25/75	DIVISION COUNTY	WESTERN.	ELEV	6238.1 KB
7,25 - 7,25,75		SAN JUAN	STATE	NEW MEXICO

NEW MEXICO BISTI FIELD Carson 12-14

"FR" TD 4864. WO #518446 provides funds to P&A well. Well currently SI. MI&RU Bedford Well Service. PU & ran 2-3/8 tbg in hole; found PBTD @ 4827. Pulled 2 jts tbg. RU pmp & circ'd hole w/frh wtr. Mixed 20 sx cmt & spt'd on btm. Pulled tbg to 3000' & SI for night. 9/21 Rig SD for weekend. 9/22 Ran 2-3/8 tbg back in hole & tagged top of cmt plug @ 4500'. Mixed 20 sx mud & circ'd hole. Pulled & LD 2-3/8 tbg. RU csg pullers. Est initial free-point @ 600'. Worked csg for 3 hrs. Csg freepoint now @ 950. SD for night.

Carson Unit 12-14

TD 4864. RU & shot csg @ 1046. Pulled 26 jts 4-1/2 csg. PU & ran tbg to 1240. Spt'd 75 sx cmt. Est top of cmt @ 900'. Pulled tbg to 300'. Spt'd 35 sx cmt. Pulled tbg to 170'. Spt'd 30 sx cmt. Pulled & LD tbg. RD Bedford Well Service. Sep \$57.24 1975

Carson Unit 12-14

TD 4864. Installed surface plug w/10 sx of cmt & abandon hole marker. Cleaned up location & hazled 1046 4-1/2 FINAL REPORT

SEP 25 19/5