

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 078155

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

West Bisti Unit

8. FARM OR LEASE NAME

9. WELL NO.

166

10. FIELD AND POOL, OR WILDCAT

Bisti Lower Gallup

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec 12-T25N-R13W

12. COUNTY OR PARISH

San Juan

13. STATE

NM

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER

2. NAME OF OPERATOR

Gulf Oil Corporation

3. ADDRESS OF OPERATOR

P. O. Box 670, Hobbs, NM 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

660' FNL & 660' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6256' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

TA

REPAIRING WELL

ALTERING CASING

ABANDONMENT*


X

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Check tubing, found paraffin build up to 900'. Attempted to release packer, tubing parted. Found big holes and corrosion 2312'-2781'. POH with packer. Set CIBP at 4595', cap with 35' cement. Found bad casing 1606'-4002'. Ran 2-3/8" tubing open-ended to 4500'. Closed in pending possible P&A 1-14-82.

Temporary abandonment is approved for 90 days.
At the end of that time it's required to permanently
repair casing or plug and abandon the well.

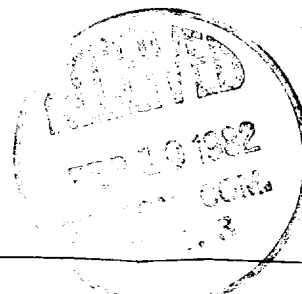

18. I hereby certify that the foregoing is true and correct

SIGNED

R. P. Puterbaugh

TITLE

Area Engineer

DATE

2-3-82

(This space for Federal use only)

APPROVED BY

CONDITIONS OF APPROVAL

APPROVED

FEB 08 1982

TITLE

DATE

AS AMENDED

For JAMES F. SIMS

DISTRICT ENGINEER

NMOCC

See Instructions on Reverse Side