


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe, N.M.
Lease No. 10-07-022
Unit Carson

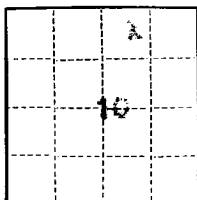

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	
Notice of Conversion to Injector <u>A</u>	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 24, 1962

Well No. 31-10 is located 600 ft. from [N] line and 1900 ft. from [E] line of sec. 10

10 10 25 N. 12 E. Twp. 36 N. R. 12 E. S. 10
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
10 San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the Well above sea level is 6243.1 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

Status: 1.2. 4995, 4993; casing 2-3/8" x 237', 4-1/2" x 495'; perfor., 1/2" holes/ft. in intervals 4990-95, 4944-51, 4887-97, 4804-07, 4714-16.

Proposed Work:

1. Pressure test tubing with 1000 psi for 15 min.
2. Pull tubing and bail clean.
3. Run 2-3/8" open-ended tubing to bottom and swab while running clean Point Look-out water (treated with Iriton X-100 detergent) down casing. When fluid cleans up, pull tubing.
4. Run 2-3/8" tubing with packer ten feet above perforations.
5. Dump 60 bbls. of inhibited water down annulus to displace uninhibited fluid. Set packer and fill with inhibited water.
6. Run pressure and temperature surveys as directed.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company

Address Post Office Box 1200

Albuquerque, New Mexico

Original Signed By W. M. MARSHALL
By W. M. Marshall
Title Division of Operations

