


SUBMIT IN TRIPlicate

Location Santa Fe, N.M.

Lease No. SF-07863

Unit Carson Unit

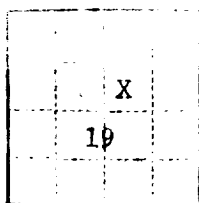

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	X
NOTICE OF INTENTION TO ABANDON WELL		

INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA

April 17

19 64

Carson Unit

Well No. 32-19 is located 1980 ft. from ~~XX~~ ^[N] line and 1980 ft. from ~~XXX~~ ^[E] line of sec. 19...NE/4 19
(4 Sec. and 1/4 Sec. No.)25N
(Twp.)11W
(Range)NNPM
(Township)Bisti
(Field)San Juan
(County or Subdivision)N.M.
(State or Territory)

Kelly Bushing


The elevation of the ~~surface~~ ~~rock~~ above sea level is 6452 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate running jobs, cementing points, and all other important proposed work)

Status: TD 5015; PBD 5008; Casing 8-5/8 at 108; 4-1/2 at 5015. Perfs 4873-4991.

Well started producing mud. Suspected casing failure. Pulled tubing and ran tubing packer and set at 4873. Oil flashed with 330 bbls. lease crude at 5 BPM and 2800 psi. Recovered lead oil at rate of 34 BDO. New 1P 21 BDG, 17 BDO, 1000 GOR.

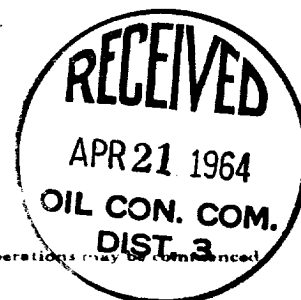

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced

Company Shell Oil Company

Address P. O. Box 1200

Farmington, N. M.

By
Joe E. Dozier, Jr.

Title Division Production Supt.