

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 000373

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Hanson

9. WELL NO.

2

10. FIELD AND POOL OR WILDCAT

Basin Dakota

11. SEC., T., R., OR BLK. AND
SURVEY OR AREA

Sec. 6, T25N, R10W

12. COUNTY OR PARISH 13. STATE

San Juan

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☐ GAS WELL ☒ OTHER2. NAME OF OPERATOR
TENNECO OIL COMPANY3. ADDRESS OF OPERATOR
Suite 1200 Lincoln Tower Bldg., Denver, Colo. 802034. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1450' FSL and 800' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6488.0 GR.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☒
☒

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL



ALTERING CASING

ABANDONMENT**

☐
☐
☐
☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Moved in completion unit 1/13/74, cleaned out to
PBTD - 6326'. Tested casing to 1200 psi - held
OK. Ran 195 jts. 2-7/8" 6.4# J-55 tubing landed
at 6079'. Perforated 6194'- 6190' and 6220'-6203'
with 2 JSPF. Frac'd with 50,000# 20/40 sand
followed by 10,000# 10/20 sand in six stages.
Blew well to clean up. Shut in pending further
testing.

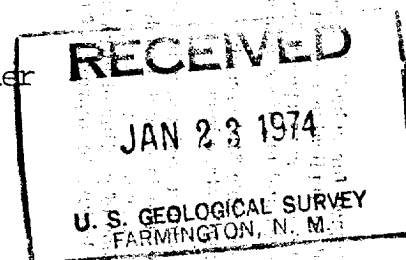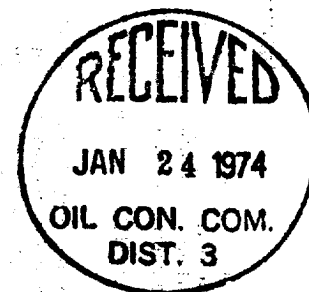

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Production Clerk

DATE

Jan. 18, 1974

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: