

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 25443

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL GAS WELL OTHER

7. UNIT AGREEMENT NAME

2. NAME OF OPERATOR

Dugan Production Corp.

8. FARM OR LEASE NAME

Red Mac

3. ADDRESS OF OPERATOR

Box 234, Farmington, NM 87401

9. WELL NO.

3

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

790' FNL - 1000' FWL

10. FIELD AND POOL, OR WILDCAT

Undesignated - PC

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec 3, T25N, R12W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6185' GR

12. COUNTY OR PARISH

San Juan

13. STATE

NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETE

FRACTURE TREATMENT

ALTERING CASING

SHOOT OR ACIDIZE

ABANDON*

SHOOTING OR ACIDIZING

ABANDONMENT*

REPAIR WELL

CHANGE PLANS

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

11-7-75

Moved in Morrow Drilling Company rig, spudded 7-7/8" hole @ 2:00 PM 11-6-75, drilled to 34' and ran one jt 5-1/2" OD 14# J-55 "B" condition csg, TE 33.45' set @ 33' GR, cemented w/5 sx to surface. Job complete 3:30 PM 11-6-75.

11-18-75

TD 1202', ran Welex electric log. Ran 39 jts 2-7/8" OD 6.5# J-55 8R EUE tbg for csg, TE 1188.81 set @ 1189' GR. Cemented w/75 sx BJ 2% Lodense cement with 1/4# Cello-flake per sk, had good circulation while cementing, bumped plug w/1500 psi - plug held OK, worked pipe during cementing operation - plug held OK. Released press to 800 psi. POB 4:22 PM 11-17-75.

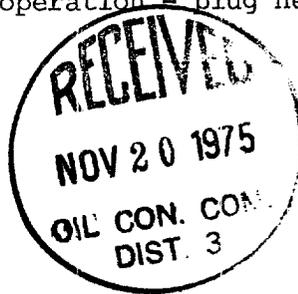

NOV 19 1975

18. I hereby certify that the foregoing is true and correct

SIGNED

Thomas A. Dugan
Thomas A. Dugan

TITLE

Engineer

DATE

11-18-75

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: