


(SUBMIT IN TRIPLICATE)

Land Office Santa Fe
Lease No. 079364
Unit Rincon Unit

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

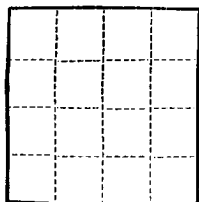

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....	<u>Water Frac.</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 24, 1962

Well No. 103 is located 1697 ft. from N line and 1460 ft. from W line of sec. 31


SW Section 31 (1/4 Sec. and Sec. No.) 27-N (Twp.) 5-W (Range) N.M.P.M. (Meridian)
Basin Dakota (Field) Rio Arriba (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 6658 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 10-18-62, T.D. 7577'. C.O.T.D. 7500'.
Perf 7274-78 (3 SPF); 7300-06 (2 SPF); 7390-06 (2 SPF);
7428-32 (3 SPF); 7464-70 (2 SPF);
Frac w/31,000 gallons water, 75,000# sand. Flush w/7000
gallons water. I.R. 28.2 BPM. Tr pr 3200#, max pr 4000#,
BDP 1200#. 4 drops of 12 balls.

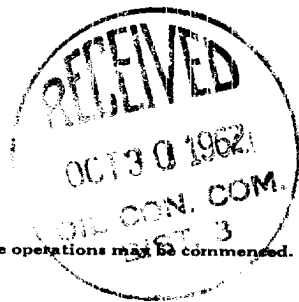

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 990

Farmington, New Mexico

By ORIGINAL SIGNED H.E. McANALLY

Title Petroleum Engineer