

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. MM 03547  
Unit \_\_\_\_\_  
Drosch WJB

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<b>I</b>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	<b>RECEIVED</b>
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	<b>MAR 8 1959</b>
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

2-28, 19 59


Well No. MM-8 is located 990 ft. from N line and 990 ft. from E line of sec. 34  
NE 1/4 34 27N 6W 104PM  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
South Blanco Rio Arriba New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6616 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spotted at 2:30 PM 2-25-59  
Drilled to TD 147'.  
Cemented 134' of 10 3/4" 32.75# H-40 8-1 Sals. short Coupling Casing at 1.7'  
w/125 sacks 2# Calcium Chloride.  
Cement Circulated.  
BHX Plug down 1:30 AM 2-26-59.  
Tested Casing w/800# for 30 min. it held OK.

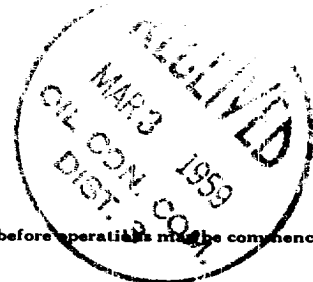

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Gaulkins Oil Company  
Address P. O. Box 967  
Farmington, New Mexico  
By Frank Gray  
Title Field Supt.