


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 07034
Unit Blanco Unit

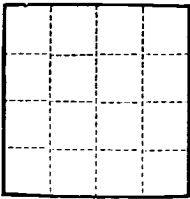

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

May 9

19 60

Well No. 12000 is located 1650 ft. from N line and 1840 ft. from EX line of sec. 20

34 1/4 Sec. 21
(1/4 Sec. and Sec. No.)

27 Twp.
(Twp.)

30
(Range)

S.M.P.M
(Meridian)

Blanco N.V. / So. Blanco Dek. Rio Arriba
(Field) (County or Subdivision)

New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 5101 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 12-10-59, Total Depth 3370.


Ran 110 joints 9 5/8", J55, 3 1/2", Casing (3351) set at 3363'

with 120 sacks regular cement, 12 1/2" fine Gilsonite, 4 1/2" Gel.

followed with 30 sacks of regular cement.

Held 3000' - 30 minutes.

Top of cement by temperature survey at 2430'.

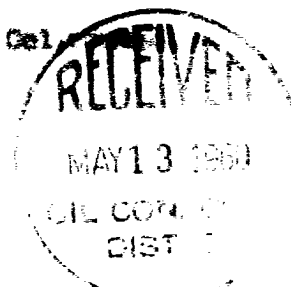

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 977

Farmington, New Mexico

By ORIGINAL SIGNED A.M. SMITH

Title Petroleum Engineer