

EPFS


EL PASO FIELD SERVICES

FIELD PIT SITE ASSESSMENT FORM

GENERAL	Meter: <u>70647</u> Location: <u>Rincon Unit #16</u> Operator #: _____ Operator Name: <u>Unocal</u> P/L District: <u>Blanco</u> Coordinates: Letter: <u>C</u> Section <u>25</u> Township: <u>27</u> Range: <u>7</u> Or Latitude _____ Longitude _____ Pit Type: Dehydrator _____ Location Drip: ☒ Line Drip: _____ Other: _____ Site Assessment Date: <u>11/15/94</u> Area: <u>03</u> Run: <u>22</u>
SITE ASSESSMENT	NMOCD Zone: (From NMOCD Maps) Inside ☒ (1) Outside ☐ (2) Land Type: BLM ☒ (1) State ☐ (2) Fee ☐ (3) <i>Denny & Trust</i> DEPUTY OIL & GAS INSPECTOR SEP 10 1996 Depth to Groundwater Less Than 50 Feet (20 points) ☒ (1) 50 Ft to 99 Ft (10 points) ☐ (2) Greater Than 100 Ft (0 points) ☐ (3) Wellhead Protection Area : Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points) Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) ☐ (1) 200 Ft to 1000 Ft (10 points) ☐ (2) Greater Than 1000 Ft (0 points) ☒ (3) Name of Surface Water Body _____ (Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds) Distance to Nearest Ephemeral Stream ☐ (1) < 100' (Navajo Pits Only) ☐ (2) > 100' TOTAL HAZARD RANKING SCORE: <u>20</u> POINTS
REMARKS	Remarks : <u>Topo Inside Redline Inside</u>

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 250° Footage from Wellhead 95'
b) Length : 15' Width : 12 Depth : 0

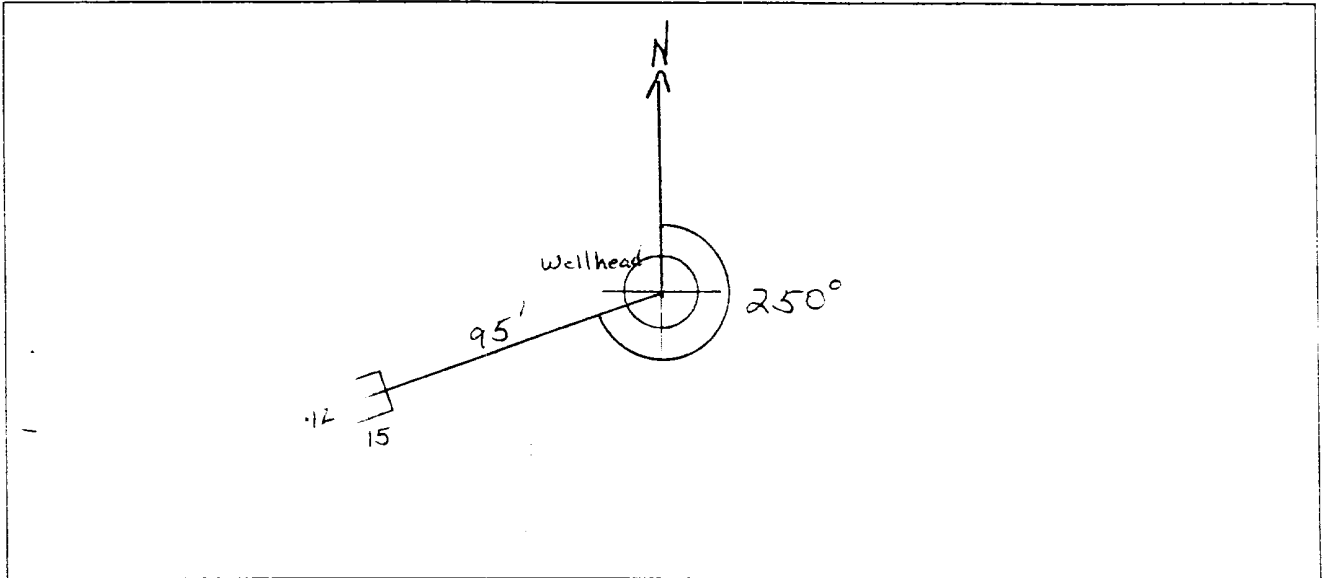

REMARKS :

Pictures 1000 (17-20) Roll-4

Pit covered and capped. All measurements taken from
approximate center of old pit. Marked w/ Survey lath. Old
pit appeared to be in sandstone.

Completed By:

Steve T. P...

Signature

11/15/94

Date

FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: <u>70647</u> Location: <u>RINCON UNIT #16</u> Coordinates: Letter: <u>C</u> Section <u>25</u> Township: <u>27</u> Range: <u>7</u> Or Latitude _____ Longitude _____ Date Started : <u>11-21-94</u> Run: <u>03</u> <u>22</u>
FIELD OBSERVATIONS	Sample Number(s): <u>KP 348</u> Sample Depth: <u>5'</u> Feet Final PID Reading <u>008</u> PID Reading Depth <u>5'</u> Feet Yes No Groundwater Encountered ☐ ☒ Approximate Depth _____ Feet
CLOSURE	Remediation Method : Excavation ☐ Approx. Cubic Yards _____ Onsite Bioremediation ☐ Backfill Pit Without Excavation ☒ Soil Disposition: Envirotech ☐ Tierra ☐ Other Facility ☐ Name: _____ Pit Closure Date: <u>11-21-94</u> Pit Closed By: <u>B.E.F</u>
REMARKS	Remarks : <u>No Line Markers. At 5 Hit Rock Took Sample</u> _____ _____
Signature of Specialist:	<u>Kelly Padilla / Sec</u>



SPLI I

FIELD SERVICES LABORATORY
ANALYTICAL REPORT

PIT CLOSURE PROJECT - Soil Samples Inside the GWV Zone

SAMPLE IDENTIFICATION

	Field ID	Lab ID
SAMPLE NUMBER:	KR 348	946507
MTR CODE SITE NAME:	70647	N/A
SAMPLE DATE TIME (Hrs):	11-21-94	1120
SAMPLED BY:	N/A	
DATE OF TPH EXT. ANAL:	11-29-94	11-29-94
DATE OF BTEX EXT. ANAL:	SV	12/02/94
TYPE DESCRIPTION:	VC	Brown sand + clay

REMARKS: BTEX done at ATI and EPNG

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS				ATI Results
			DF	Q	M(g)	V(ml)	
BENZENE	<0.005	MG/KG	0.00108		4.63	SV	<0.025
TOLUENE	<0.005	MG/KG					<0.025
ETHYL BENZENE	<0.005	MG/KG					<0.025
TOTAL XYLENES	<0.005	MG/KG					<0.025
TOTAL BTEX	<0.020	MG/KG					<0.10
TPH (418.1)	69.9	MG/KG			2.02	78	—
HEADSPACE PID	8	PPM					Surrogate % 87
PERCENT SOLIDS	92.2	%					Dilution Factor 1

-- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 --

The Surrogate Recovery was at 100.9% for this samp All QA/QC was acceptable.

Narrative:

ATI Results attached

DF = Dilution Factor Used

Approved By:

Date:

12/27/94

NOT
USED
D



Analytical**Technologies**, Inc.

2709-D Pan American Freeway, NE Albuquerque, NM 87107
Phone (505) 344-3777 FAX (505) 344-4413

ATI I.D. 411401

December 7, 1994

El Paso Natural Gas Company
P.O. Box 4990
Farmington, NM 87499

Project Name/Number: PIT CLOSURE 24324

Attention: John Lambdin

On 11/30/94, Analytical Technologies, Inc., (ADHS License No. AZ0015), received a request to analyze **non-aqueous** samples. The samples were analyzed with EPA methodology or equivalent methods. The results of these analyses and the quality control data, which follow each set of analyses, are enclosed.


If you have any questions or comments, please do not hesitate to contact us at (505) 344-3777.

Letitia Krakowski, Ph.D.
Project Manager

H. Mitchell Rubenstein, Ph.D.
Laboratory Manager

MR:jt

Enclosure

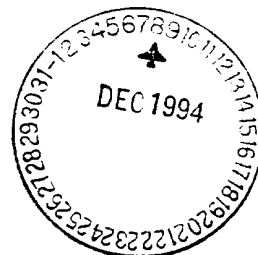



Analytical Technologies, Inc.

GAS CHROMATOGRAPHY RESULTS

TEST : BTEX (EPA 8020)
CLIENT : EL PASO NATURAL GAS CO. ATI I.D.: 411401
PROJECT # : 24324
PROJECT NAME : PIT CLOSURE

SAMPLE ID. #	CLIENT I.D.	MATRIX	DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED	DIL. FACTOR
04	946506	NON-AQ	11/21/94	12/01/94	12/03/94	1
05	946507	NON-AQ	11/21/94	12/01/94	12/03/94	1
06	946508	NON-AQ	11/22/94	12/01/94	12/05/94	20

PARAMETER	UNITS	04	05	06
BENZENE	MG/KG	<0.025	<0.025	<0.50
TOLUENE	MG/KG	0.07	<0.025	0.07
ETHYLBENZENE	MG/KG	<0.025	<0.025	42
TOTAL XYLENES	MG/KG	0.04	<0.025	22

SURROGATE:

BROMOFLUOROBENZENE (B) 106 37 75