

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 679365-A
Unit Rincon Unit


SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Water Fracture</u> X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

April 26, 1956

Well No. 02 is located 1030 ft. from S line and 810 ft. from W line of sec. 23
SW Section 23 27N 6W 16MPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco Alamogordo
(Field) (County or Subdivision)

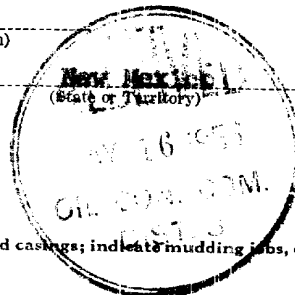

The elevation of the derrick floor above sea level is 5516 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

4-15-56 Total Depth C.O. to 5530'.
 Water fractured Lower Point Lookout perforated intervals 5435-5446, 5456-5502 with 4 shots per foot, with 63,900 gallons water and 60,000# sand. Breakdown pressure 1800#, maximum pressure 1800#, average treating pressure 1650#. Injection rate 51 bbls./min. Flush 5600 gallons.

4-15-56 Total Depth P.B. to 5410'.
 Water fractured Upper Point Lookout perforated intervals 5297-5310, 5359-5372 with 4 shots per foot, with 66,000 gallons water and 60,000# sand. Maximum pressure 1700#, average treating pressure 1650#. Injection rate 56.5 bbls./min. Flush 5600 gallons.

(Over)

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By W. F. Corbett

Title Petroleum Engineer

4-16-56 Total Depth P.B. to 4690'.
Water fractured Upper Cliff House perforated intervals 4883-4898, 4862-4872 with
71,000 gallons water and 60,000# sand. Maximum pressure 1850#, average treating
pressure 1800#. Injection rate 47.5 bbls./min. Flush 5000 gallons.

4-16-56 Total Depth P.B. to 5050'.
Water fractured Lower Cliff House perforated intervals 4900-4917, 4934-4946
and 4962-4970 with 63,900 gallons water and 60,000# sand. Maximum pressure
1800#, average treating pressure 1750#. Injection rate 56 bbls./min. Flush
5100 gallons.

4-16-56 Total Depth P.B. to 5280'.
Water fractured Menatee perforated intervals 5074-5084, 5090-5097 and 5156-5164
with 4 shots per foot, with 63,500 gallons water and 60,000# sand. Breakdown
pressure 2300#, maximum pressure 2300#, average treating pressure 2250#. Injection
rate 45 bbls./min. Flush 3300 gallons.