


(SUBMIT IN TRIPLICATE)

Land Office **Santa Fe**
Lease No. **079365**
Unit **San Juan 20-6 Unit**
14-08-001-1031

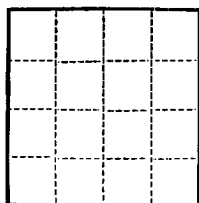

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

February 8, 1957


Well No. **69 (14)** is located **390** ft. from **N** line and **450** ft. from **E** line of sec. **24**
SW Section 24 **27N** **04W** **114E**
 (¼ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco & Wildcat **Rio Arriba** **New Mexico**
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is **6621** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 1-22-57, Total Depth 3476'.
 Ran 108 joints 7 5/8", J-55, 26.4#, casing (3476') set at 3476' with 100
 sacks regular cement, 100 sacks Pozzolan, 50# Floccide and 4½ Gal. 1/8# Floccide, sk.
 followed with 50 sacks Best cement.
 Held 1000# 30 minutes.
 Top of cement by temperature survey at 2250'.

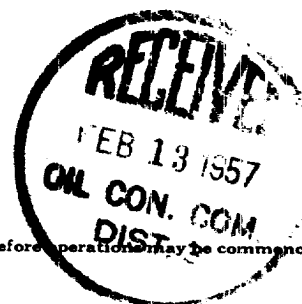

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **El Paso Natural Gas Company**

Address **Box 997**
Farmington, New Mexico

ORIGINAL SIGNED E. S. OBERLY

By _____
 Title **Petroleum Engineer**